

INSTRUCTION MANUAL MEASURING STATION

MS SERIES
MS05A
MS1A



MS05A MS1A



Although this manual describes the Bluetooth operation, this instrument does not have Bluetooth functionality.

- Thank you for selecting the TOPCON product.
- Please read this Instruction Manual carefully before using this product.
- Verify that all equipment is included.
 - ☞ "35. STANDARD EQUIPMENT"
- MS has a function to output data to a connected host computer. Command operations from a host computer can also be performed. For details, refer to "Interfacing with the SDR Electronic Field Book" and Command Explanations manuals and ask your local dealer.
- The specifications and general appearance of the instrument may be altered at any time and may differ from those appearing in brochures and this manual.
- The content of this manual is subject to change without notice.
- Some of the diagrams shown in this manual may be simplified for easier understanding.

HOW TO READ THIS MANUAL

Regarding other manuals

- The MS comes equipped with 2 manuals for operation information: Manuals below are electronic manuals provided on a CD-ROM in PDF format. Adobe Reader is necessary in order to view these documents. The latest version of Acrobat Reader can be downloaded from the Adobe homepage.
 1. MS Instruction Manual (this manual):
Explains basic operation and functions of the MS.
 2. Mesh-Scan Survey Program Explanations :
Explains how to measure using the Mesh-Scan Survey function
- For Auto Tracking measurement, read this manual in conjunction with the On-demand Remote Control System Manual.

Symbols

The following conventions are used in this manual.



: Indicates precautions and important items which should be read before operations.



: Indicates the chapter title to refer to for additional information.



: Indicates supplementary explanation.



: Indicates an explanation for a particular term or operation.

[Softkey] etc. : Indicates softkeys on the display and window dialog buttons.

{Key} etc. : Indicates keys on the operation panel.

<Screen title> etc.: Indicates screen titles.

Notes regarding manual style

- Except where stated, "MS" means MS05A and MS1A, and "total station" means "MS series" in this manual.
- Location of softkeys in screens used in procedures is based on the factory setting. It is possible to change the allocation of softkeys.
 Softkey allocation: "30.6 Allocating Key Functions"
- Learn basic operations in "4. PRODUCT OUTLINE" and "5. BASIC OPERATION" before you read each measurement procedure. An overview of the available MS functions is given in "4.1 Functions". For selecting options and inputting figures, see "5.1 Basic Key Operation".
- Measurement procedures are based on continuous measurement. Some information about procedures when other measurement options are selected can be found in "Note" (.
- KODAK is a registered trademark of Eastman Kodak Company.
- Windows and Windows CE are registered trademarks of Microsoft Corporation.
- All other company and product names featured in this manual are trademarks or registered trademarks of each respective organization.

CONTENTS

1. PRECAUTIONS FOR SAFE OPERATION	1
2. PRECAUTIONS	4
3. LASER SAFETY INFORMATION	7
4. PRODUCT OUTLINE	9
4.1 Functions	9
4.2 Parts of the Instrument	11
4.3 Mode Structure	14
5. BASIC OPERATION	15
5.1 Basic Key Operation	15
5.2 Display Functions	20
5.3 Inputting Characters using the Input Panel	26
5.4 SETTINGS Mode	27
6. USING THE CF CARD SLOT	29
6.1 Inserting/Removing the CF Card	29
7. USING THE BATTERY	31
7.1 Battery Charging	31
7.2 Installing/Removing the Battery	32
8. CONNECTING TO EXTERNAL DEVICES	35
8.1 Wireless Communication using Bluetooth Technology ...	35
8.2 Communication between the MS and Companion Device	39
8.3 Connecting to USB devices	40
8.4 Connection via RS232C cable	42
9. SETTING UP THE INSTRUMENT	43
9.1 Centering	43
9.2 Levelling	44
10. POWER ON/OFF	47
10.1 Resolving Software Issues	48
10.2 Configuring the Touch Panel	48
10.3 Powering the MS ON/OFF from an External Instrument .	49
11. TARGET SIGHTING	50
11.1 Auto Pointing Settings	51
11.2 Auto-Pointing Function for Target Sighting	53
11.3 Manually Sighting the Target	55

CONTENTS

12. MEASUREMENT WITH AUTO TRACKING	56
12.1 Auto Tracking Settings	56
12.2 Measurement with Auto Tracking	58
13. ANGLE MEASUREMENT	61
13.1 Measuring the Horizontal Angle between Two Points (Horizontal Angle 0°)	61
13.2 Setting the Horizontal Angle to a Required Value (Horizontal Angle Hold)	62
13.3 Turning the Instrument from the Reference Angle to a Specified Angle	63
13.4 Angle measurement and Outputting the Data	64
14. DISTANCE MEASUREMENT	65
14.1 Returned Signal Checking	65
14.2 Distance and Angle Measurement	67
14.3 Distance Measurement and Outputting the Data	68
14.4 REM Measurement	69
15. TOPOGRAPHY MEASUREMENT	71
15.1 Entering Instrument Station Data	71
15.2 Azimuth Angle Setting	73
15.3 Topography Measurement	76
16. COORDINATE MEASUREMENT	78
16.1 Entering Instrument Station Data	78
16.2 Azimuth Angle Setting	79
16.3 3-D Coordinate Measurement	82
16.4 Reading in Registered Coordinate Data	84
17. RESECTION MEASUREMENT	86
17.1 Coordinate Resection Measurement	87
17.2 Height Resection Measurement	91
18. SETTING-OUT MEASUREMENT	96
18.1 Distance Setting-out Measurement	96
18.2 Coordinates Setting-out Measurement	102
18.3 REM Setting-out Measurement	105
19. POINT PROJECTION	108
19.1 Defining Baseline	108
19.2 Point Projection	111
20. Offset Measurement	113

CONTENTS

20.1	Single-distance Offset Measurement	113
20.2	Angle Offset Measurement	116
20.3	Two-distance Offset Measurement	118
21.	MISSING LINE MEASUREMENT	121
21.1	Measuring the Distance between 2 or more Points	121
21.2	Changing the Starting Point	123
22.	SURFACE AREA CALCULATION	125
23.	ROUTE SURVEYING	130
23.1	Instrument Station Settings	130
23.2	Straight Line Calculation	131
23.3	Circular Curve Calculation	134
23.4	Clothoid Curve	136
23.5	3 Point Calculation	141
23.6	Intersection Angle/Azimuth Angle Calculation	144
23.7	Route Calculation	147
24.	CROSS SECTION SURVEY	160
24.1	Instrument Station Settings	160
24.2	Cross Section Survey	161
25.	REGISTERING/reviewing DATA	166
25.1	Registering Known Point Data	166
25.2	Registering Notes	167
25.3	Reviewing Data	168
26.	SELECTING / DELETING A JOB	170
26.1	Selecting a JOB	170
26.2	Deleting a JOB	172
27.	RECEIVING COORDINATE DATA	173
28.	OUTPUTTING JOB DATA	176
29.	REGISTERING/DELETing CODE	180
30.	CHANGING THE SETTINGS	182
30.1	Observation Conditions	182
30.2	Instrument Configuration	184
30.3	EDM Settings	186
30.4	Allocating User-defined Tabs	191
30.5	Customizing Screen Controls	193
30.6	Allocating Key Functions	195

CONTENTS

30.7	Units	199
30.8	Changing Password	200
30.9	Restoring Default Settings	201
30.10	Date and Time	201
31.	WARNING AND ERROR MESSAGES	202
32.	CHECKS AND ADJUSTMENTS	207
32.1	Plate Level	207
32.2	Circular Level	208
32.3	Tilt Sensor	209
32.4	Collimation	212
32.5	Reticle	214
32.6	Optical Plummet	216
32.7	Additive Distance Constant	217
33.	Power Supply System	219
34.	Target System	220
35.	STANDARD EQUIPMENT	225
36.	Optional Accessories	228
37.	SPECIFICATIONS	231
38.	EXPLANATION	238
38.1	High Accuracy with the 360° Prism	238
38.2	Manually Indexing the Vertical Circle by Face Left, Face Right Measurement	238
39.	REGULATIONS	240
40.	INDEX	243

1. PRECAUTIONS FOR SAFE OPERATION

For the safe use of the product and prevention of injury to operators and other persons as well as prevention of property damage, items which should be observed are indicated by an exclamation point within a triangle used with WARNING and CAUTION statements in this Instruction Manual. The definitions of the indications are listed below. Be sure you understand them before reading the manual's main text.

Definition of Indication

	WARNING	Ignoring this indication and making an operation error could possibly result in death or serious injury to the operator.
	CAUTION	Ignoring this indication and making an operation error could possibly result in personal injury or property damage.

-  This symbol indicates items for which caution (hazard warnings inclusive) is urged. Specific details are printed in or near the symbol.
-  This symbol indicates items which are prohibited. Specific details are printed in or near the symbol.
-  This symbol indicates items which must always be performed. Specific details are printed in or near the symbol.

General

Warning

-  Do not use the unit in areas exposed to high amounts of dust or ash, in areas where there is inadequate ventilation, or near combustible materials. An explosion could occur.
-  Do not perform disassembly or rebuilding. Fire, electric shock, burns, or hazardous radiation exposure could result.
-  Never look at the sun through the telescope. Loss of eyesight could result.
-  Do not look at reflected sunlight from a prism or other reflecting object through the telescope. Loss of eyesight could result.
-  Direct viewing of the sun using the telescope during sun observation will cause loss of eyesight. Use a solar filter (option), such as that in "36. OPTIONAL ACCESSORIES", for sun observation.
-  When securing the instrument in the carrying case make sure that all catches, including the side catches, are closed. Failure to do so could result in the instrument falling out while being carried, causing injury.

Caution

-  Do not use the carrying case as a footstool. The case is slippery and unstable so a person could slip and fall off it.

1. PRECAUTIONS FOR SAFE OPERATION

-  Do not place the instrument in a case with a damaged catch, belt or handle. The case or instrument could be dropped and cause injury.
-  Do not wield or throw the plumb bob. A person could be injured if struck.
-  Keep hands and clothing away from rotating parts. Injury could result from being dragged into the part.
-  Do not touch the instrument or look through the telescope eyepiece while the motor drive is in operation. Hands could be caught in moving parts or an eye could be struck by the telescope and cause injury.* /
-  Secure handle to main unit with handle locks. Failure to properly secure the handle could result in the unit falling off while being carried, causing injury.
-  Tighten the adjustment tribrach clamp securely. Failure to properly secure the clamp could result in the tribrach falling off while being carried, causing injury.

Power Supply



Warning

-  Do not short circuit. Heat or ignition could result.
-  Do not disassemble, rebuild, mutilate, incinerate, heat or short circuit the battery and charger. Fire, electric shock, burns or an explosion could result.
-  Do not use voltage other than the specified power supply voltage. Fire or electrical shock could result.
-  Do not use damaged power cords, plugs or loose outlets. Fire or electric shock could result.
-  Do not use power cords other than those designated. Fire could result.
-  Do not place articles such as clothing on the battery charger while charging batteries. Sparks could be induced, leading to fire.
-  Use only the specified battery charger to recharge batteries. Other chargers may be of different voltage rating or polarity, causing sparking which could lead to fire or burns.
-  Do not heat or throw batteries into fire. An explosion could occur, resulting in injury.
-  Do not use the battery, charger or AC (power) cable for any other equipment or purpose. Fire or burns caused by ignition could result.
-  To prevent shorting of the battery in storage, apply insulating tape or equivalent to the terminals. Otherwise shorting could occur resulting in fire or burns.
-  Do not use batteries or the battery charger if wet. Resultant shorting could lead to fire or burns.



Do not connect or disconnect power supply plugs with wet hands. Electric shock could result.



Caution



Do not touch liquid leaking from batteries. Harmful chemicals could cause burns or blisters.

Tripod



Caution



When mounting the instrument to the tripod, tighten the centering screw securely. Failure to tighten the screw properly could result in the instrument falling off the tripod, causing injury.



Tighten securely the leg fixing screws of the tripod on which the instrument is mounted. Failure to tighten the screws could result in the tripod collapsing, causing injury.



Do not carry the tripod with the tripod shoes pointed at other persons. A person could be injured if struck by the tripod shoes.



Keep hands and feet away from the tripod shoes when fixing the tripod in the ground. A hand or foot stab wound could result.



Tighten the leg fixing screws securely before carrying the tripod. Failure to tighten the screws could lead to the tripod legs extending, causing injury.

Remote Trigger (DLC1)



Caution



Do not leave batteries within reach of small children. If swallowed, consult a physician immediately.

2. PRECAUTIONS


Telescope

- Aiming the telescope at the sun will cause internal damage to the instrument. Use the solar filter when observing the sun.

☞ "36. OPTIONAL ACCESSORIES"

Tribrach clamp and handle

- When the instrument is shipped, the tribrach clamp is held firmly in place with a locking screw to prevent the instrument from shifting on the levelling base. Before using the instrument the first time, loosen this screw with a screwdriver. And before transporting it, tighten the locking screw to fasten the tribrach clamp in place so that it will not shift on the levelling base.
- The MS handle can be removed. When operating the MS with the handle attached, always make sure that the handle is securely fixed to the MS body with the handle locks.

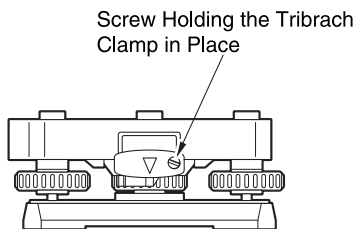

Precautions concerning water and dust resistance

MS conforms to IP65 specifications for waterproofing and dust resistance when the CF card cover and battery cover are closed.

- Make sure that moisture or dust particles do not come in contact with the terminal or connectors. Operating the instrument with moisture or dust on the terminal or connectors may cause damage to the instrument.
- Be sure to correctly attach the connector caps to protect the MS from moisture and dust particles when the connector is not in use.
- Make sure that the inside of the carrying case and the instrument are dry before closing the case. If moisture is trapped inside the case, it may cause the instrument to rust.

The lithium battery

The lithium battery is used to maintain the MS Calendar & Clock function. It can back up data for approximately 5 years of normal use and storage (Temperature = 20°, humidity = about 50%), but its lifetime may be shorter depending on circumstances.

Backing up data

Data should be backed up (transferred to an external device etc.) on a regular basis to prevent data loss.

The levelling base

Be sure to use levelling base WA100A.

Vertical and horizontal clamps

Always fully release the vertical/horizontal clamps when rotating the instrument or telescope. Rotating with clamp(s) partially applied may adversely affect accuracy.

Other precautions

- Never place the instrument directly on the ground. Sand or dust may cause damage to the screw holes or the centering screw on the base plate.
- Do not perform vertical rotation of the telescope when using the lens hood, diagonal eyepiece, or solar filter. Such accessories may strike the MS causing damage.
- Protect the instrument from heavy shocks or vibration.
- Protect the instrument from rain or drizzle with an umbrella or waterproof cover.
- When the operator leaves the instrument attached to the tripod, the vinyl cover should be placed on the instrument.
- Never carry the instrument on the tripod to another site.
- Turn the power off before removing the battery.
- Remove the battery before placing the MS in its case.
- Make sure that the instrument and the protective lining of the carrying case are dry before closing the case. The case is hermetically sealed and if moisture is trapped inside, the instrument could rust.
- Consult your local dealer before using the instrument under special conditions such as long periods of continuous use or high levels of humidity. In general, special conditions are treated as being outside the scope of the product warranty.

Maintenance

- Wipe off moisture completely if the instrument gets wet during survey work.
- Always clean the instrument before returning it to the case. The lens requires special care. First, dust it off with the lens brush to remove tiny particles. Then, after providing a little condensation by breathing on the lens, wipe it with the wiping cloth.
- If the display is dirty, carefully wipe it with a soft, dry cloth. To clean other parts of the instrument or the carrying case, lightly moisten a soft cloth in a mild detergent solution. Wring out excess water until the cloth is slightly damp, then carefully wipe the surface of the unit. Do not use any organic solvents or alkaline cleaning solutions.
- Store the instrument in a dry room where the temperature remains fairly constant.
- Check the tripod for loose fit and loose screws.
- If any trouble is found on the rotatable portion, screws or optical parts (e.g. lens), contact your local dealer.
- When the instrument is not used for a long time, check it at least once every 3 months.

"32. CHECKS AND ADJUSTMENTS"

- When removing the instrument from the carrying case, never pull it out by force. The empty carrying case should be closed to protect it from moisture.
- Check the instrument for proper adjustment periodically to maintain the instrument accuracy.

Exceptions from responsibility

- The user of this product is expected to follow all operating instructions and make periodic checks (hardware only) of the product's performance.
- The manufacturer, or its representatives, assumes no responsibility for results of faulty or intentional usage or misuse including any direct, indirect, consequential damage, or loss of profits.

2. PRECAUTIONS

- The manufacturer, or its representatives, assumes no responsibility for consequential damage, or loss of profits due to any natural disaster, (earthquake, storms, floods etc.), fire, accident, or an act of a third party and/or usage under unusual conditions.
- The manufacturer, or its representatives, assumes no responsibility for any damage (change of data, loss of data, loss of profits, an interruption of business etc.) caused by use of the product or an unusable product.
- The manufacturer, or its representatives, assumes no responsibility for any damage, and loss of profits caused by usage different to that explained in the Instruction Manual.
- The manufacturer, or its representatives, assumes no responsibility for damage caused by incorrect operation, or action resulting from connecting to other products.

3. LASER SAFETY INFORMATION


MS is classified as a Class 3R Laser Product and Class 1 LED Product according to IEC Standard Publication 60825-1 Amd. 2: 2001 and United States Government Code of Federal Regulation FDA CDRH 21CFR Part 1040.10 and 1040.11 (Complies with FDA performance standards for laser products except for deviations pursuant to Laser Notice No.50, dated July 26, 2001.)

- EDM device in objective lens:
- (When using prism or reflective sheet as target)
- Light:

Class 3R Laser Product

Class 1 Laser Product

Class 1 LED product

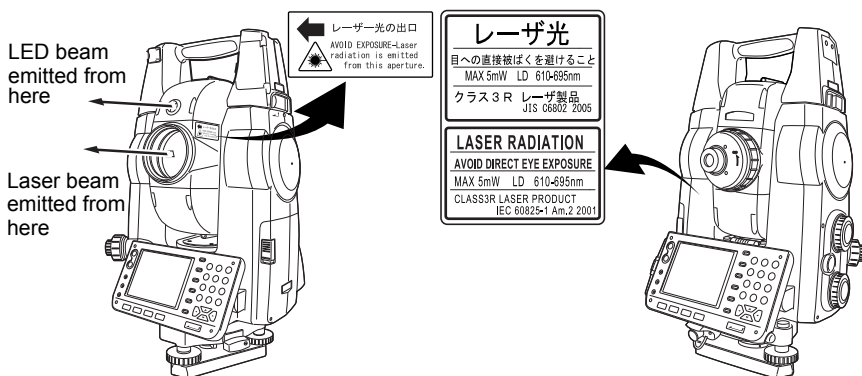

- EDM device is classified as Class 3R Laser Product when reflectorless measurement is selected. When the prism or reflective sheet is selected as target, the output is equivalent to the safer class 1.

Warning

- Use of controls or adjustments or performance of procedures other than those specified herein may result in hazardous radiation exposure.
- Follow the safety instructions on the labels attached to the instrument as well as in this manual to ensure safe use of this laser and LED product.
- Never point the laser beam at another person. If the laser beam strikes skin or an eye, it could cause serious injury.
- Do not look directly into the laser beam source or Light source. Doing so could cause permanent eye damage.
- Do not stare at the laser beam. Doing so could cause permanent eye damage.
- If an eye injury is caused by exposure to the laser beam, seek immediate medical attention from a licensed ophthalmologist.
- Never look at the laser beam through a telescope, binoculars or other optical instruments. Doing so could cause permanent eye damage.
- Sight the target so that the laser beam does not stray from them.

Caution

- Perform checks at start of work and periodic checks and adjustments with the laser beam emitted under normal conditions.
- When the instrument is not being used, turn off the power and replace the lens cap.
- When disposing of the instrument, destroy the battery connector so that the laser beam cannot be emitted.
- Operate the instrument with due caution to avoid injuries that may be caused by the laser beam unintentionally striking a person in the eye. Avoid setting the instrument at heights at which the path of the laser beam may strike pedestrians or drivers at head height.
- Never point the laser beam at mirrors, windows or surfaces that are highly reflective. The reflected laser beam could cause serious injury.
- When using the laser-pointer function, be sure to turn OFF the output laser after distance measurement is completed. Even if distance measurement is canceled, the laser-pointer function is still operating and the laser beam continues to be emitted.
- Only those who have been received training as per the following items shall use this product.
 - Read the Instruction Manual for usage procedures for this product.
 - Hazardous protection procedures (read this chapter).
 - Requisite protective gear (read this chapter).
 - Accident reporting procedures (stipulate procedures beforehand for transporting the injured and contacting physicians in case there are laser induced injuries).
- Persons working within the range of the laser beam are advised to wear eye protection which corresponds to the laser wavelength of the instrument being used
- Areas in which the lasers are used should be posted with laser warning notices.
- The LED beam is emitted when the Light is set to ON and the power is turned ON. Before turning ON the power check that there are no persons in the LED beam path. Alternatively, always set the Light to OFF when you have finished measurement.

4. PRODUCT OUTLINE

4.1 Functions

MS has the following features to make operation more efficient.

1. High accuracy with reflectorless measurement



TOPCON own optics, electrical circuits, and processing algorithms combine to provide superior reflectorless accuracy at distances as short as 30cm.



2. Various interface options



Data link options for the MS include both a CF card slot and USB ports.

3. Full colour touch panel display



Not only does the colour screen improve usability, but the Graphic option allows the user to visualize setting out operations. In addition to the operation keys, the touch panel with stylus pen offers another user-friendly method for selecting screens and inputting characters.

 "5.2 Display Functions"

4. Trigger Key for Easier Operation



Each screen contains a number of softkeys. Softkeys displayed in bold type control the flow of measurement operation. Pressing the trigger key located on the side of the MS will perform exactly the same operation as the bolded softkey in the current screen. This allows the user to continue operation without having to return to the display to press softkeys.

 "4.2 Parts of the Instrument"  Trigger key"

5. SETTINGS Mode



One-touch of the **{SETTINGS}** key allows the user to jump to and from the SETTINGS mode during operation without exiting measurement.

 "4.3 Mode Structure", "5.4 SETTINGS Mode"

6. TOPCON original Independent Angle Calibration System (IACS) technology



This revolutionary technology provides an even higher level of stability and reliability for angle measurement. With IACS technology, the MS independently calibrates angle to a high degree of accuracy, and eliminates the need for a reference standard instrument when performing calibration.

 Independent angle calibration cannot be performed by the user. Consult your local dealer.

4. PRODUCT OUTLINE

7. Sighting the target using Auto Pointing



Once the instrument is pointed in the general direction of the target, simply pressing **[SRCH]** will automatically sight the center of the prism. When used in collaboration with the On-demand Remote Control System, the MS will locate the RC-Controller and automatically sight the target allowing all measurement to be performed from target side.

 "11.2 Auto-Pointing Function for Target Sighting" and "30.3 EDM Settings"

8. Wide range of advanced programs




One touch of the **{PROGRAM}** key allows the user to switch from Basic mode to Program mode in order to use advanced measurement programs. The position of menus and softkeys can be user-defined for greater ease-of-use.


 Switching modes: "4.3 Mode Structure", rearranging softkeys: "30.6 Allocating Key Functions"

4.2 Parts of the Instrument

Parts and functions of the instrument

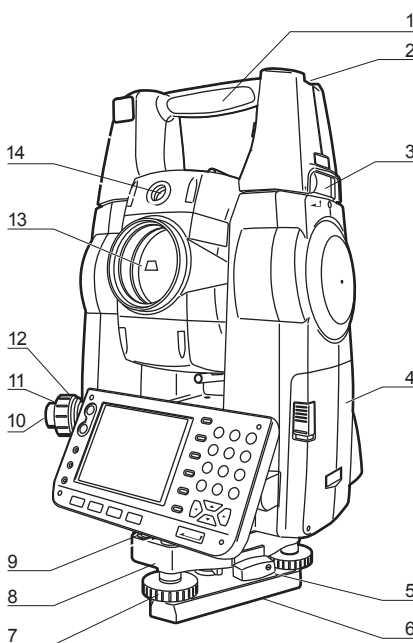

- 1 Handle
- 2 Tubular compass slot
- 3 Handle lock
- 4 Battery cover
- 5 Tribrach clamp
- 6 Base plate
- 7 Levelling foot screw
- 8 Circular level adjusting screws
- 9 Circular level
- 10 Optical plummet eyepiece
- 11 Optical plummet reticle cover
- 12 Optical plummet focussing ring
- 13 Objective lens
(Includes "Laser-pointer function")
- 14 Light

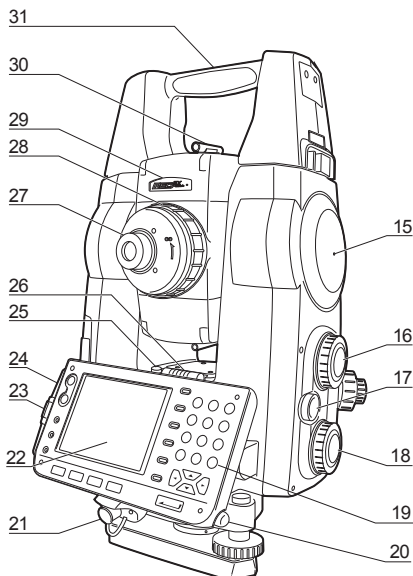

- 15 Instrument height mark
- 16 Vertical Jog dial
- 17 Trigger key
- 18 Horizontal Jog dial
- 19 Keyboard "5.1 Basic Key Operation"
- 20 Stylus pen holder
- 21 Combined communications and power supply connector
- 22 Display
- 23 CF card slot
"6. USING THE CF CARD SLOT"
- 24 USB ports
"13. ANGLE MEASUREMENT"
- 25 Plate level adjusting screw
- 26 Plate level
- 27 Telescope eyepiece screw
- 28 Telescope focussing ring
- 29 Laser radiation warning indicator
- 30 Peep sight
- 31 Instrument center mark

4. PRODUCT OUTLINE



Vertical and Horizontal Jog dials

The instrument and telescope can be rotated manually by hand or, for more precise adjustments, by turning the vertical and horizontal Jog dials.

The faster the Jog dials are turned, the faster the instrument and telescope rotate.

☞ "11.1 Auto Pointing Settings" step 3



Light

Aiming the Light at the target improves visibility of the target in the sighted direction thus making sighting in poor light more accurate.

The intensity of the illuminated point can be adjusted in "Light" in the EDM tab.



Laser radiation warning indicator

Laser radiation warning indicator is red when laser beam is emitted or laser-pointer is used, allowing the status of the laser beam to be ascertained from the telescope eyepiece side.



Peep sight

Use peep sight to aim the MS in the direction of the measurement point.

Turn the instrument until the triangle in the peep sight is aligned with the target.



Instrument height mark

The height of the MS is 236mm (from tribrach dish to this mark). "Instrument height" is input when setting instrument station data and is the height from the measuring point (where MS is mounted) to this mark.



Trigger key

When the Trigger key is pressed MS carries out the operation indicated by the softkey in bold type on the screen. This allows the user to continue operation without having to return to the display to press softkeys.



Laser-pointer function

A target can be sighted with a red laser beam in dark locations without the use of the telescope.

Removing the handle


1. Slide the handle locks in the direction as shown at right until a click is heard. The handle are now unlocked.



2. Pull the lock levers towards you and slide the handle back and up to remove. The handle lock levers, once released, will return to the original position.




- Make sure that the handle does not fall while being removed. Removing the handle requires a certain amount of force. As a result, always hold firmly when removing.

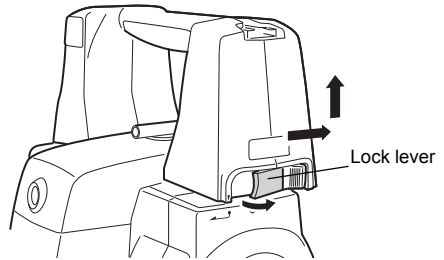


Attaching the handle

1. Align the handle with the mounting brackets.

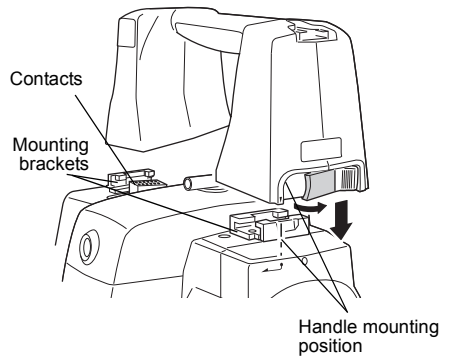


2. Slide the handle onto the mounting position until a click is heard. Check that the handle lock levers, once released, return to the closed position.

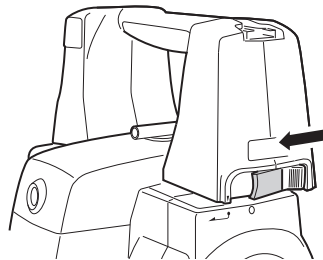

3. Slide the handle locks away from you to lock the handle. Check that the green sections of the handle locks are showing.




- Securely lock the handle in place before starting measurement.

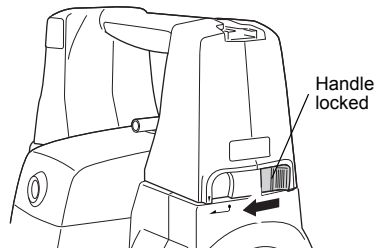

4.3 Mode Structure

The diagram below describes the different modes of the MS and key operations for navigating between them. Managing data functions are contained in Memory mode.

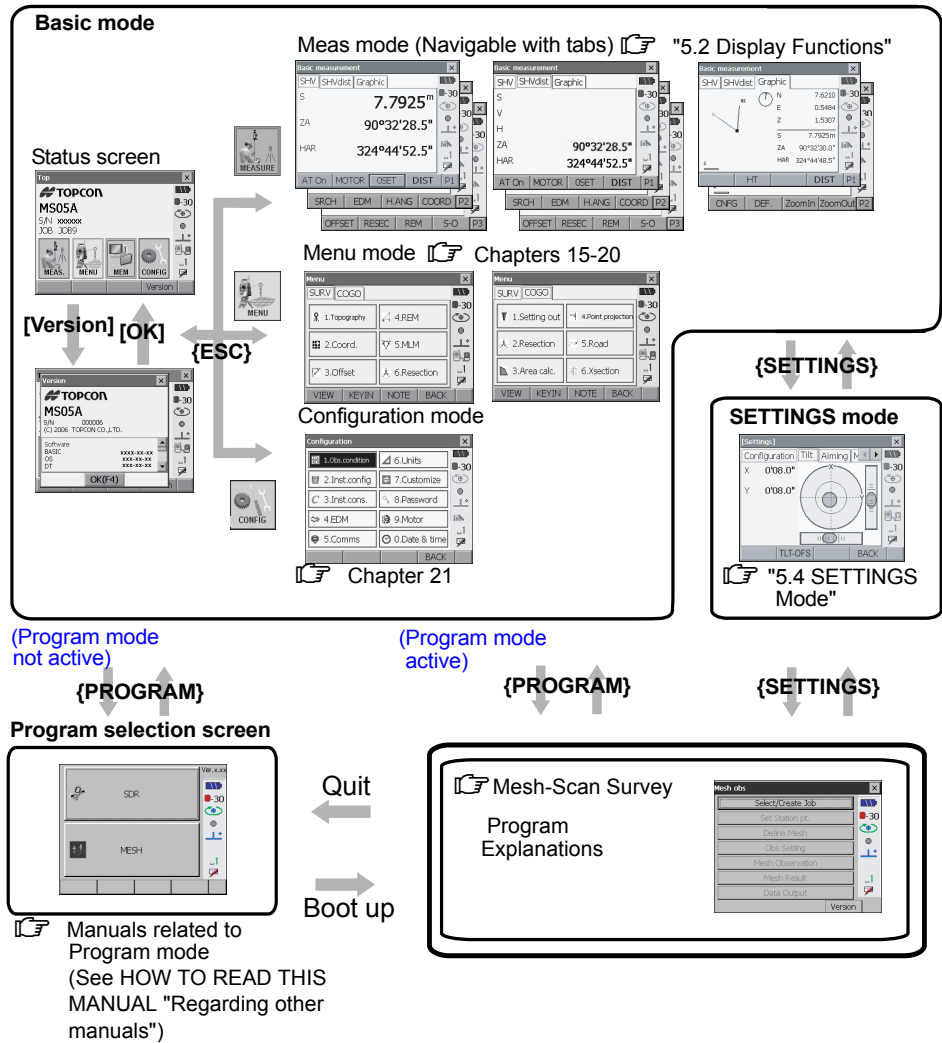


- Program mode and Mesh-Scan Survey program cannot be active simultaneously.
- Switching between modes is not possible during distance measurement or while the motor is in operation

5. BASIC OPERATION

Learn basic key operations here before you read each measurement procedure.

5.1 Basic Key Operation

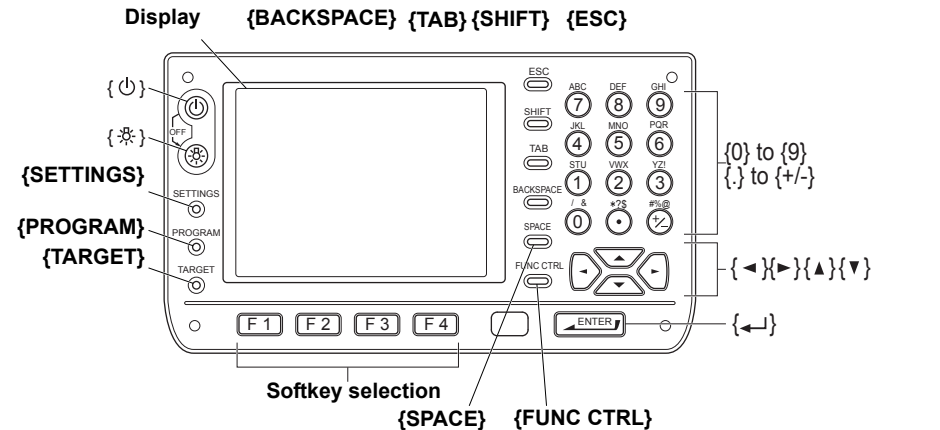

- Power ON/OFF**

{⏻}	Power ON
{⏻} (while pressing) + {☀️}	Power OFF
- Lighting up the reticle/keys and selecting screen backlight brightness**

{☀️}	Switches the reticle illumination/key backlight ON/OFF
	Switches the screen backlight brightness setting

📖 "30.2 Instrument Configuration"
- Switching to SETTINGS mode**

{SETTINGS}	Switches to screens for tilt correction, returned signal checking and general configuration
{SETTINGS}/{ESC}	Returns to the previous screen (mode)

📖 "5.4 SETTINGS Mode"
- Switching to Menu mode**

{PROGRAM}	Switches Basic mode to Menu mode (one direction only). Same as pressing [MENU] in Meas mode.
------------------	---
- Switching target type**

{TARGET}	Switches between target types
-----------------	-------------------------------

📖 "30.3 EDM Settings"

Note

- Changes can also be made by tapping the status bar icon with the stylus pen.
- 📖 "5.2 Display Functions"

5. BASIC OPERATION

● Switching the laser-pointer/Light ON/OFF

(Press and hold until a beep sounds)	Turns the laser-pointer/Light ON/OFF
--------------------------------------	--------------------------------------

Selecting laser-pointer/Light after pressing : "30.3 EDM Settings"

- Changes can also be made by tapping the status bar icon with the stylus pen.

"5.2 Display Functions"

● Softkey operation

Softkeys are displayed on the bottom line of the screen.

{F1} to {F4}	Select the function matching the softkeys
{FUNC CTRL}	Toggle between softkey pages

● Inputting letters/figures

Character input method can be selected from upper case alphabetic, lower case alphabetic and numeric characters.



- A selection can also be made by tapping the status bar icon with the stylus pen.

{0} to {9}	Input numeral or symbol printed above the key (during numeric input mode)
	Input alphabetic character in the order they are listed (in alphabetic input mode)
{.}	Input a decimal point (during numeric input mode)
{+/-}	Input a plus or minus sign (during numeric input mode)
{ESC}	Cancel the input data
{TAB}	Shift to the next item
{BACKSPACE}	Delete the character to the left
{SPACE}	Input a blank space (increments by 1 when setting the date and time)
{◀}/▶}	Move the cursor left/right during character input
{▲}/▼}	Move the cursor up/down during character input
{←}	Select/accept input word/value

● Selecting options

{▲}/▼}	Move the cursor/selection item up/down
{◀}/▶}	Move the cursor/selection item left/right or select other option
{TAB}	Shift to the next item
{SPACE}	Display other options
{←}	Select/accept the option

● Selecting tabs

{▲}/▼}	Move tab/cursor in tab up/down
{◀}/▶}	Display next tab at left/right

● Other operation

{ESC}	Return to previous screen
-------	---------------------------

 Tabs: "5.2 Display Functions"

Example: Entering "computer" (lower case) as the name of a new device

1. Tap the input mode icon in the status bar (second from bottom) until "_a" is displayed.



2. Press {7} three times.
"c" is displayed.




3. Press {5} three times.
"o" is displayed.



5. BASIC OPERATION

- Press **▶**.
Press **{5}**. "m" is displayed.

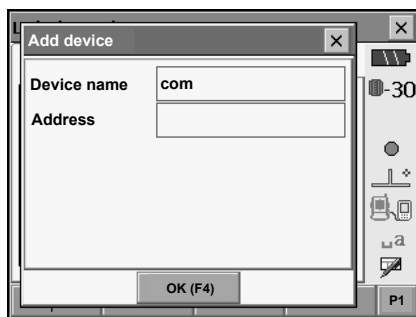


- Continue to input letters. Press **←** to complete inputting.


Example: selecting a reflector type

(Method 1)

- Select **[EDM]** in the first page of Meas mode or "EDM" in SETTINGS mode/Configuration mode.

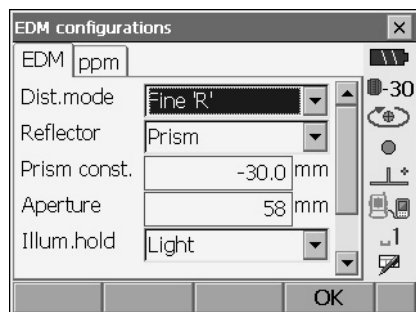

- Move to "Reflector" using **▲/▼/TAB**.
- Press **{SPACE}** to display a list of all options.

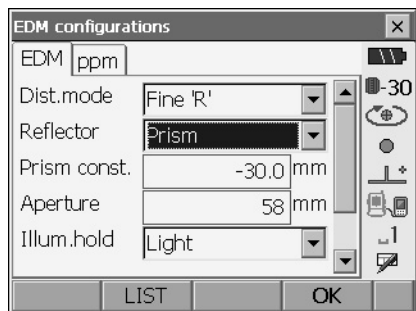

- Select an option using **▲/▼**.
- Press **←** to confirm selection.

(Method 2)

1. Select **[EDM]** in the first page of Measure mode or "EDM" in SETTINGS mode/Configuration mode.
2. Move to "Reflector" using **{▲}/{▼}/{TAB}**.
3. Switch between Prism, Sheet, and Reflectorless using **{◀}/{▶}**.
4. Press **{←}** to confirm selection.

5.2

Display Functions

Screens can be selected/operated using the keys on the keyboard or the touch panel. The touch panel can be operated using either the stylus pen provided or your fingers.



- Do not scratch the display or use any sharp implement other than the stylus pen to operate the touch panel.

Using the stylus

The stylus pen can be used to select menus and buttons on the screen and operate the scroll bar. The touch panel supports "tap", "double tap", and "drag" operations.


Operation	Method
Tap	Lightly tap the display once. This operation is equivalent to the clicking of a mouse button when using a computer.
Double tap	Lightly tap the display twice on the same point. This operation is equivalent to the "double-click" for a computer mouse.
Drag	Lightly apply the point of the stylus pen to the display and move in the desired direction, maintaining contact between the stylus and display all the time.

Displaying and operating screens


- To close a screen, tap the cross in the top right corner, or press {ESC}.
- Tabs, softkey allocations, displayed tab items, and character sizes can all be changed in accordance with user preferences.

"30. CHANGING THE SETTINGS"

● Status screen

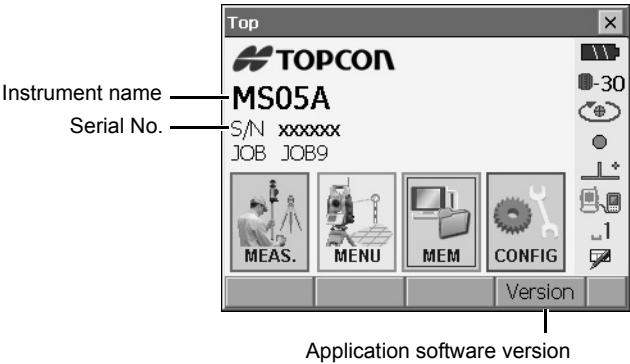

● Basic measurement screen

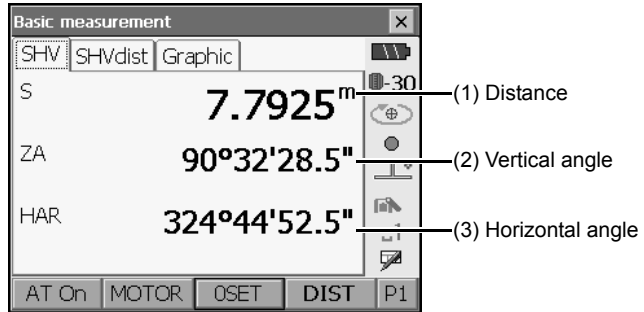

(1) Distance

Press **[SHV]** to switch between the SHV and SHVdist tabs. An SHVdist tab will be created when one does not exist.

☞ "30.1 Observation Conditions"

☞ "30.6 Allocating Key Functions"

(2) Vertical angle

The Vertical angle display can be switched between Zenith ($Z=0^\circ$)/Horiz ($H=0^\circ$)/Horiz ($H=\pm 90^\circ$). To switch vertical angle/slope in %, press **[ZA/%]** when allocated to the Meas mode screen. The capitalized letter in the softkey indicates the currently selected mode.

☞ "30.1 Observation Conditions"

(3) Horizontal angle


Press **[R/I]** when allocated to the Meas mode screen to switch the display status. The capitalized letter in the softkey indicates the currently selected mode.

HAR : Horizontal angle right


HAL : Horizontal angle left

☞ "30.6 Allocating Key Functions"

● Input screen/configuration screen

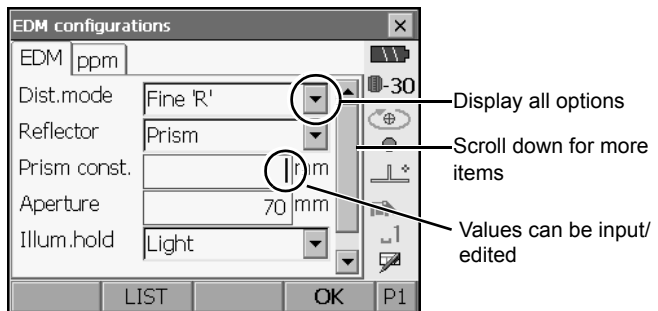

● Graphic tab

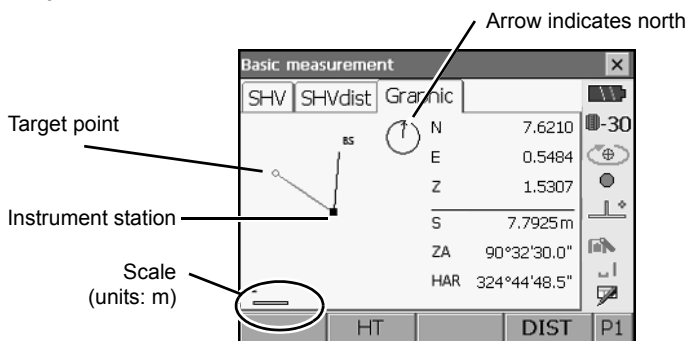

The Graphic tab display can be modified using the softkeys in the second page.

[CNFG]: In <Graphic configuration> the user can specify the orientation of the graphic tab display and which point, target or station, to set at the center of the display.


[DEF.]: Returns to the original orientation display.

[ZoomIn]: Zooms in.

[ZoomOut]: Zooms out.

● Selecting menus


To select a menu, tap the touch panel or press the relevant number key.

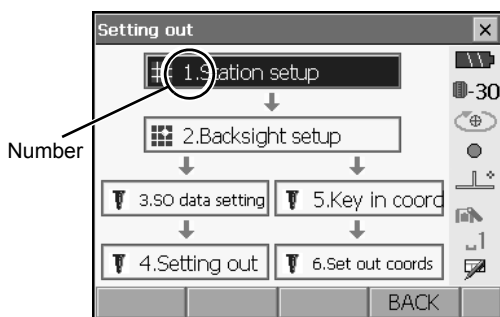

● Status bar

Indicates the current status of the instrument.
Tapping icons (1) to (7) will switch between the relevant options for that item. Tapping and holding will display a list of all available options for that item and, in certain cases, a link to the configuration screen for that item.

Settings: "30. CHANGING THE SETTINGS"

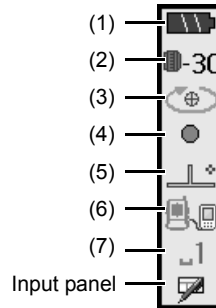

(1) Remaining battery power

Remaining battery power indicator and configuration of auto-power function (BDC58/external battery BDC60/61, Temperature = 25°C, EDM on).

The remaining battery power displayed when distance measurement or motor operation is in progress may differ to that displayed at other times.

- : Level 3 Full power
- : Level 2 Plenty of power remains
- : Level 1 Half or less power remains
- : Level 0 Little power remains. (Flashes red and black)
- : No power (Red display in the center of the screen) Stop measurement and charge the battery

"7. USING THE BATTERY"

(2) Target display

Selection of target type and configuration of prism constant.

● Prism -30.0mm	-30	: Prism (-30.0mm)
360°Prism -7.0mm	-7	: 360° Prism (-7.0mm)
SMR 0.0mm	0	: SMR (0.0mm) (only for MS with SMR functionality)
Sheet 0.0mm	0	: Sheet (0.0mm)
Reflectorless		: Reflectorless
Go to EDM Config.		

Target information can be edited/recorded in <Reflector setting>.

"30.3 EDM Settings"



SMR (Spherically Mounted Retroreflector)

The SMR target is a metallic sphere with a retroreflective surface used for industrial measurement. The naming of SMR targets differs from manufacturer to manufacturer. Measurement using the SMR is an optional function for the MS. The MS does not support measurement with the SMR. Use an SMR commercially available for laser tracker systems with an aperture of 38mm (1.5 inch). For details regarding adding this function and compatible SMRs, contact your local dealer.

5. BASIC OPERATION

(3) Motor configuration

Configuration of Auto Pointing/Auto Tracking status. The display may change slightly depending on the target type selected.

Track	
● Search	
None	
AT On	
Go to Motor config.	

: Auto Tracking ON

: Auto Pointing ON

: Both Auto Tracking and Auto Pointing OFF

: Start Auto Tracking. "AT Off" is displayed when performing Auto Tracking or when in "Prism wait" status. Tap to quit Auto Tracking.

One of the following icons will be displayed while the motor is in operation to indicate the current status of the MS.



: Rotating



: Rotating at fixed velocity



: Searching



: Auto Tracking in progress (when Auto Tracking set)



: Target "lost" (when Auto Tracking set)



: (Flashes red) Waiting for prism (when Auto Tracking set)

 Motor settings: "11.1 Auto Pointing Settings", "12.1 Auto Tracking Settings"



- Auto Tracking and Auto Pointing cannot be performed when "Reflectorless" has been selected as the target type.   will be displayed. Auto Tracking cannot be performed when "Sheet" has been selected as the target type.  will be displayed

- An arrow indicating turn direction will be displayed when the MS is rotating at a fixed velocity.

 Fixed velocity rotation: "5.4 SETTINGS Mode ● Fixed velocity rotation"

(4) Laser-pointer/Light/laser-guide

Configuration of laser-pointer/Light/laser-guide status.

 Switching the laser-pointer/Light/laser-guide ON/OFF: "5.1 Basic Key Operation"

● Light: On	○
Light: Off	●
Laser-pointer: On	
Laser-pointer: Off	•
Laser-guide : On	
Laser-guide : Off	
To EDM config.	

: Light ON

: Light OFF

: Laser-pointer ON

: Laser-pointer OFF

: Laser-guide ON (option)


: Laser-guide OFF (option)



- The laser-pointer/Light/laser-guide will be automatically switched OFF during distance measurement/Auto Pointing/Auto Tracking to prevent laser output exceeding the allowable range.

(5) Tilt angle compensation

The vertical and horizontal angles are automatically compensated for small tilt errors using the MS's dual-axis tilt sensor. This icon displays the status of this function.

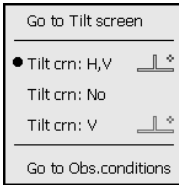

: Horizontal and vertical tilt angles compensated (blue)

: No compensation


: Only horizontal tilt angle compensated (green)

Note

-  is displayed when the instrument is out of level.

(6) Communication status

Selection and configuration of communication status with external devices. *Bluetooth* settings can only be selected when using instruments incorporating either the RC-TS3 or H-BT1 handle.

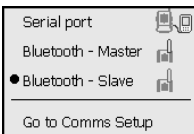

: Connection via RS232C cable

: Connection via *Bluetooth* (MS set as "Master" device) (blue antenna)

: Connection via *Bluetooth* (MS set as "Slave" device) (green antenna)

Connection status to external devices is displayed as follows.

i) Connection via *Bluetooth* wireless technology

When MS is set as the "Master" device the antenna mark is blue. When the MS is set as the "Slave" device the antenna mark is green.



: Connecting



: Cancelling connection



: (Antenna is purple - moving)

MS set to "Master": Inquiring about other *Bluetooth* devices



: (Antenna is purple - stationary)

Communication settings in progress/Preparing for

communication (Instrument just powered ON or just switched to "Slave")



: Connection error (icon flashes green and red)

ii) : Connection via RS232C cable

Note

- When *Bluetooth* is selected (MS set as "Master" device) a connection can be initiated/canceled by tapping  /  .

5. BASIC OPERATION

- An arrow (e.g.  / ) is displayed to indicate that data transmission is in progress. A red arrow indicates that data transmission has failed and data needs to be sent again.
- If a connection cannot be established or a connection error occurs, there may be dust particles on the contacts between the MS and handle. Wrap a dry cloth around your fingertip and wipe the contacts clean.

 Contacts: " 4.2 Parts of the Instrument Removing the handle/Attaching the handle"

(7) Input mode
Selection of input mode

_1	Inputting numbers and symbols
_A	Inputting upper case alphabetic characters
_a	Inputting lower case alphabetic characters


5.3 Inputting Characters using the Input Panel

Tap  to display <Input Panel>. This keyboard can be used to input numeric and alphabetic characters as well as symbols. Tap the icon again to close.

Note

- When <Input Panel> is covering the  icon of the status bar, use the stylus pen to drag the input panel to another part of the screen so that you can access the  icon.


Input panel

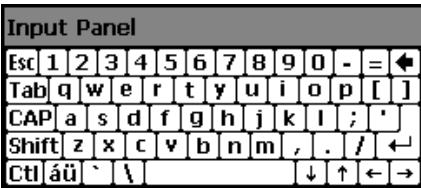

- Esc : Deletes all input characters
- Tab : Moves the cursor to the next text box
- CAP : Alternates between upper and lower case alphabetic characters and numbers/ symbols
- Shift : Alternates between upper and lower case alphabetic characters and numbers/ symbols. Is canceled after inputting a single character.
- Ctl : No function
- Del/↔ : Delete the character to the left/right or deletes the entire text in the active section
- ↔ : Move the cursor left/right
-  : Accept input characters
- Space : Input a blank space
- áu : Accesses further Latin/Germanic characters/symbols

5.4 SETTINGS Mode


Press **[SETTINGS]** to switch to screens for tilt correction, returned signal checking, motor operation, fixed velocity rotation, and general configuration.

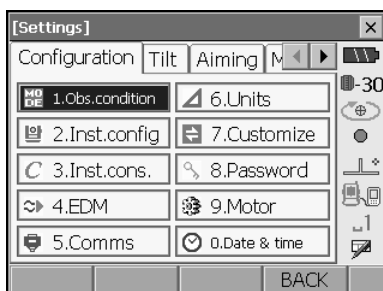

Performing settings: "30. CHANGING THE SETTINGS", Tilt settings: "9.2 Levelling", Returned signal checking: "14.1 Returned Signal Checking"

● Motor settings

The instrument can be automatically rotated to a desired vertical and/or horizontal angle by specifying the angle in the "Motor" tab and selecting **[ROTATE]**.

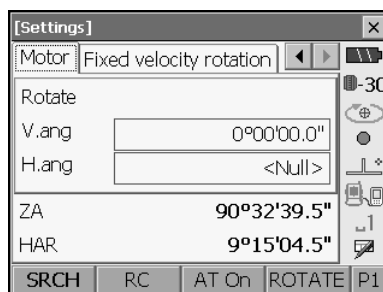


- The following operations can be performed using the softkeys in the second page.
 - [READ]** : Read in coordinates from Program mode and set as the desired angle.
 - [COORD]** : Specify rotation angle by inputting coordinates in <Key in coord>.
 - [TURN]** : Rotate the MS 180°.
 - [CNFG]** : Perform Motor configuration settings. "12.1 Auto Tracking Settings"

5. BASIC OPERATION

● Fixed velocity rotation

The MS horizontal angle and telescope can be rotated using the controls in the Fixed velocity rotation tab. Speed settings are from 1 to 16.

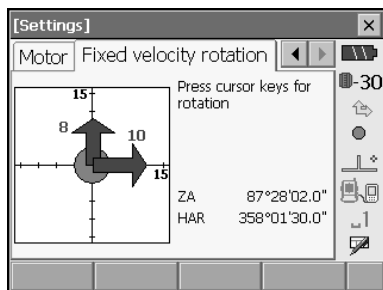

Tap the touch panel in the desired rotation direction.

Press **{ESC}** or tap the red center circle/  (arrow mark) in the status bar to stop rotation.

6. USING THE CF CARD SLOT

CF (Compact Flash) cards, for saving data, are supported by the MS. Management of JOB and survey data is done in Memory mode.



- Contact your local dealer for details regarding communication formats for CF card input/output.
- Data can also be transferred to an external device with memory capabilities for storage and/or editing using the MS's USB ports.

 "13. ANGLE MEASUREMENT"


6.1 Inserting/Removing the CF Card




- Do not remove the CF card during data read/write.
- Make sure the eject button is fully depressed when a CF card is inserted. A protruding eject button will be depressed when the card cover is closed causing the card to be ejected.
- Always close the card cover before moving the instrument. The card cover can be damaged if forced open beyond a certain angle.

PROCEDURE Inserting the CF card

1. Push the catch on the card cover away from the display to open.

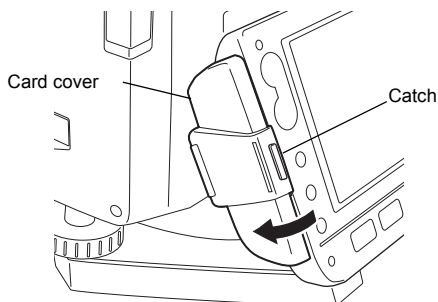


2. Insert the CF card.
3. Close the card cover.

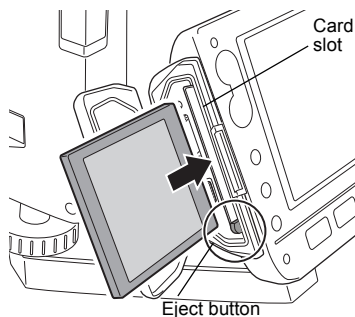


PROCEDURE Removing the CF card

1. Push the catch on the card cover away from the display to open.

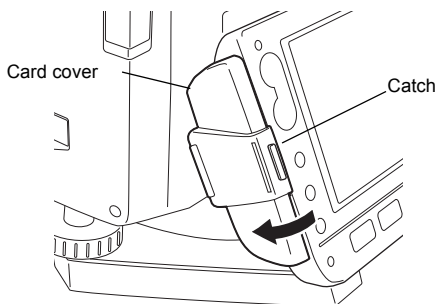

2. Press the eject button once to release. Once the eject button is fully protruded, press once more to remove the card from the card slot.

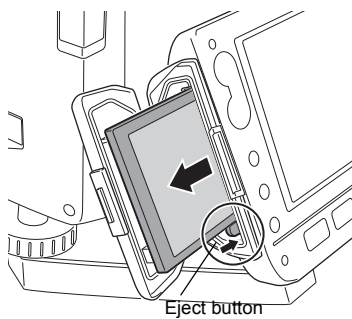

3. Check that the eject button is not protruding, then close the card cover. Make sure the cover is properly closed.

7. USING THE BATTERY

 Types of power source: "33. POWER SUPPLY SYSTEM"

7.1 Battery Charging



The battery was not charged at the factory. Charge the battery fully before using the MS.



- The charger will become rather hot during use. This is normal.
- Do not use to charge batteries other than those specified.
- The charger is for indoor use only. Do not use outdoors.
- Batteries cannot be charged, even when the charging lamp is flashing, when the temperature is outside the charging temperature range.
- Remove batteries from the charger before putting into storage.
- When not in use, disconnect the power cable plug from the wall outlet.

PROCEDURE

1. Connect the power cable to the charger and plug the charger into the wall outlet.
2. Mount the battery in the charger by matching the grooves on the battery with the guides on the charger.
3. When charging starts, the lamp starts blinking.
4. The lamp lights when charging is finished.
5. Remove the battery and unplug the charger.

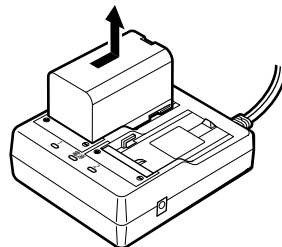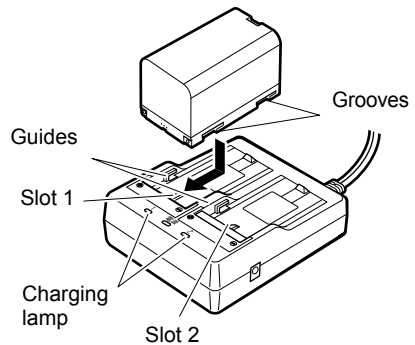



- Slots 1 and 2:
The charger starts charging the battery mounted first. If you place two batteries in the charger, the battery in slot 1 is charged first, and then the battery in slot 2. (🔧 step 2)
- Charging lamp:
The charging lamp is off when the charger is outside the charging temperature range or when the battery is mounted incorrectly. If the lamp is still off after the charger falls within its charging temperature range and the battery is mounted again, contact your local dealer. (🔧 steps 2 and 3)
- Charging time per battery (at 25°C):
BDC46B: about 2.5 hours
BDC58: about 4 hours
(Charging can take longer than the times stated above when temperatures are either especially high or low.)

7.2

Installing/Removing the Battery

Mount the charged battery.



- Before removing the battery, turn off the power to the instrument. If the battery is removed while the power is switched on, a warm boot occurs. File and folder data may be lost as a result.
- When installing/removing the battery, make sure that moisture or dust particles do not come in contact with the inside of the instrument.
- Remove batteries from the surveying instrument or charger before putting into storage.
- Store the battery in a dry room where the temperature is within the following ranges


Storage period	Temperature range
1 week or less	-20 to 50°C
1 week to 1 month	-20 to 45°C
1 month to 6 months	-20 to 40°C
6 months to 1 year	-20 to 35°C

For long-term storage, the battery should be charged at least once every six months.

- The BDC46B and BDC58 generate power using a chemical reaction and as a result have a limited lifetime. Even when in storage and not used for long periods, battery capacity deteriorates with the passage of time. This may result in the operating time of the battery shortening despite having been charged correctly. In this event, a new battery is required.

PROCEDURE Mounting the battery

1. Slide down the catches on the battery cover to open.
2. Insert the battery in the direction of the arrow printed on the side.
3. Close the battery cover. A click is heard when the cover is secure.

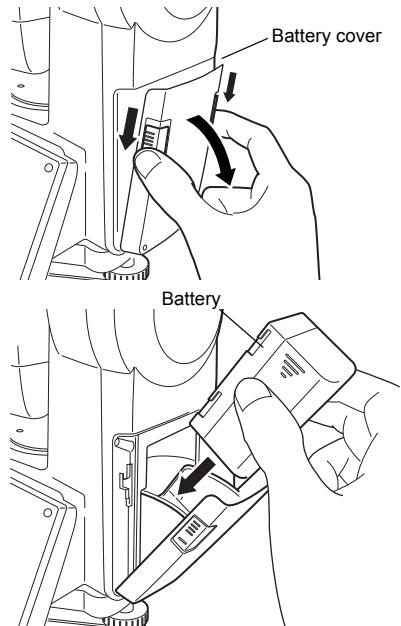

PROCEDURE Removing the battery


1. Slide down the catches on the battery cover to open.
2. Grip the battery by the arrow symbols printed on the side and slide out.
3. Close the battery cover. A click is heard when the cover is secure.

Note

- Battery cover
If the battery cover is open during power ON, MS notifies you by displaying the screen below and beeping.

7. USING THE BATTERY

- When the battery cover is closed, the previous screen is restored.

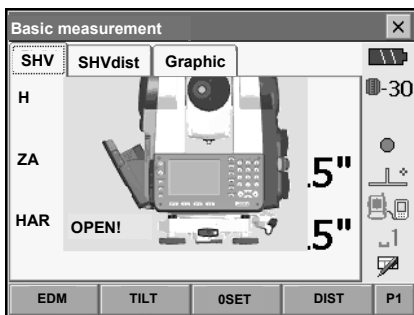

8. CONNECTING TO EXTERNAL DEVICES

The MS supports both USB and *Bluetooth* wireless technology for communication with data collectors, the On-demand Remote Control System etc.

Read this manual in conjunction with the operator's manual for the relevant external device.



Bluetooth communication:

Transferring data using the SFX function: SFX Dial-Up Program Explanations (Series MS), Output format and command operations: Interfacing with the SDR Electronic Field Book and Command Explanations manuals



- *Bluetooth* communication is only possible with instruments incorporating either the RC-TS3 or H-BT1 handle.

8.1

Wireless Communication using *Bluetooth* Technology

The *Bluetooth* module incorporated in the MS can be used for communication with *Bluetooth* devices such as the On-demand Remote Control System RC-Controller and data collectors.



Bluetooth connections



Communication between a pair of *Bluetooth* devices requires one device to be set as the "Master" and the other as the "Slave". To initiate connections from the MS side, set the MS as the "Master" device. To initiate connections from the paired device side, set the MS as the "Slave" device. The factory setting is "Slave".

PROCEDURE Necessary settings for *Bluetooth* communication

1. Select "Comms" in SETTINGS mode. Set Comms mode in the Comms setup tab to "*Bluetooth*".



- Changing communication settings during *Bluetooth* communication will cancel the connection.
- The  status bar icon cannot be tapped in <Communication Setup>.

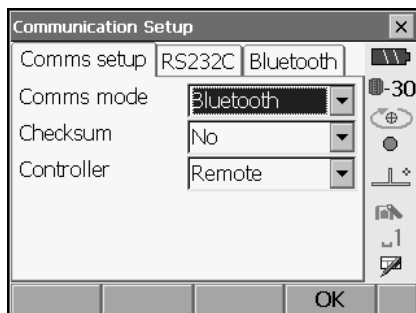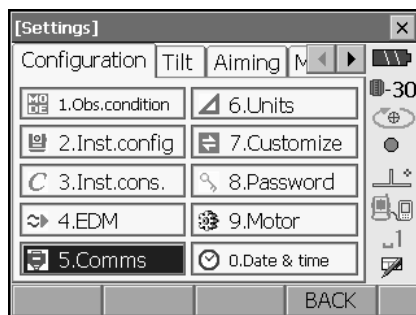


8. CONNECTING TO EXTERNAL DEVICES

2. Select a mode for the MS in the *Bluetooth* tab.
The factory setting is "Slave".
Register companion devices.

- "Master" cannot be selected when no companion devices have been registered.

 "Master"/"Slave":  Bluetooth connections"

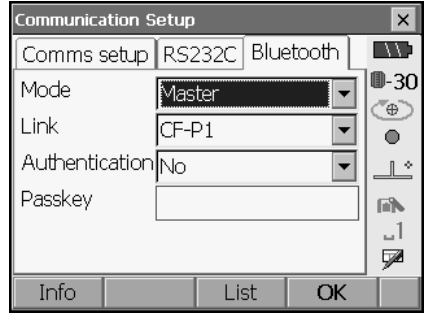

3. Select, in "Link", a companion device from among the *Bluetooth* devices already registered in the MS.



 Registering devices: "PROCEDURE
Registering Bluetooth companion devices"

- Companion devices cannot be selected when the MS is set as "Slave".

4. Set "Authentication" to "Yes" or "No".
If "Authentication" is set to "Yes" for the MS the passkey will also need to be input on the companion device.
5. When "Authentication" is set to "Yes", input the same passkey as that for the intended companion device. Even if "Authentication" is set to "No", a passkey is requested when authentication is set on the companion device being used.
- Up to 16 numeric characters can be input. Input characters will be displayed as asterisks (e.g. "*****"). The passkey was set to "0123" at the factory.
6. Press **[OK]** to finish settings.

PROCEDURE Registering Bluetooth companion devices

1. Power on the companion device.
2. Select "*Bluetooth*" in "Comms mode" in the Comms setup tab.
3. Press **[LIST]** to display a list of all registered devices.
Data collector devices can be set in the Serial tab and devices for use with the SFX Dial-Up Program in the SFX (Dial-Up) tab.

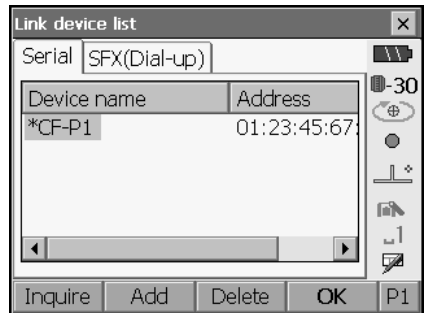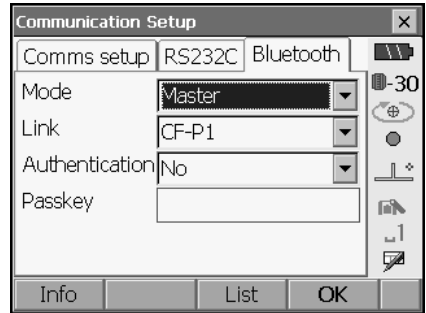

4. Register your *Bluetooth* device(s).

Press **[Add]** to display <Add device>. Input the device name and *Bluetooth* address and press **[OK]**. Up to 12 characters (numbers 0 to 9 and letters from A to F) can be input.



8. CONNECTING TO EXTERNAL DEVICES

Press **[Inquire]** to inquire about *Bluetooth* devices in the immediate vicinity of the MS and display their device name and address in a list. Select a device from this list and press **[OK]** to add to the Link device list in step 3.

Press **[Delete]** to delete the selected device name. Deleted device names cannot be retrieved.

- Select a device and press **[Edit]** in the second page to update the device name and/or device address.



5. Press **[OK]** to complete registration and return to the screen in step 2.

PROCEDURE Displaying *Bluetooth* information for the MS

1. Select "Comms" in SETTINGS mode.
2. Press **[Info]** in the *Bluetooth* tab to display information for the MS. Register the *Bluetooth* address (BD ADDR) displayed here in the paired device set as "Master".



Bluetooth device address

This is a number unique to one particular *Bluetooth* device used to identify devices during communication. This number consists of 12 characters (numbers 0 to 9 and letters from A to F). Some devices may be referred to by their *Bluetooth* device address.

8.2

Communication between the MS and Companion Device



- *Bluetooth* communication causes MS battery power to be depleted at a rate higher than that for normal operation.
 - Check that the companion device (data collector, computer, cellular phone, or On-demand Remote Control System etc.) is turned on and the relevant *Bluetooth* settings are complete.
 - All communication settings will be changed to factory settings when a cold boot is performed. Comms setup will need to be performed again.
- "8.1 Wireless Communication using Bluetooth Technology"

1. Complete the necessary MS settings for *Bluetooth* communication.

"8.1 Wireless Communication using Bluetooth Technology"

2. Start communication

When MS is set as the "Master" device, the **[Connect]** softkey is allocated to the fourth page of Meas mode. When **[Connect]** is pressed the MS searches for the device selected in "Link" and a connection starts. When a connection has been successfully established is displayed in the status bar.

The establishing of a connection can also be initiated by tapping in the status bar.

Status bar, communication status:


"5.2 Display Functions"



- When MS is set as the "Slave" device, the establishing of a connection can only be initiated/ canceled by the companion device set as "Master".
3. Press **[Cancel]** in the fourth page of Meas mode to terminate the connection.
A connection can also be terminated by tapping in the status bar.

8.3 Connecting to USB devices

MS has two different USB ports. Topcon Co., Ltd. cannot guarantee that all USB devices are compatible with the MS USB ports.

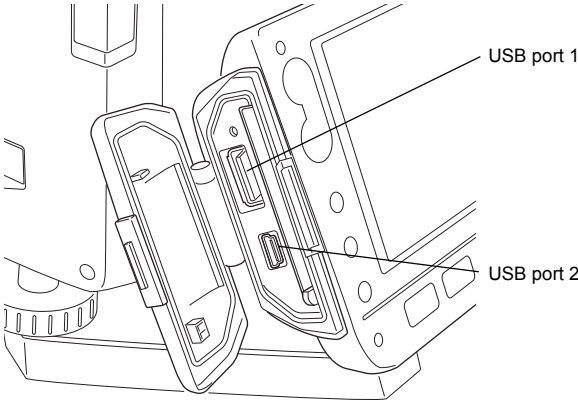

Each port is used for connection to different types of devices.

Port name	Device type
USB port 1	USB memory devices etc.
USB port 2	computers etc.

Connecting the MS to a computer to transfer data from Program mode

1. Power OFF the MS. Connect the MS and computer using the USB cable.
☞ "10. POWER ON/OFF"



•The computer does not need to be turned off before connection.

2. Press { ⏻ } while pressing { ⬅️ }. "USB Mode" will be displayed on the screen of the MS. After a short period (approx. 1 minute) <Removable disk> will be displayed on the computer screen.
3. The JOB data and observation data displayed in <Removable disk> can be copied and/or transferred to the computer.

Note

- The computer display may vary depending on Windows settings.



Follow the instructions below to ensure that the MS continues to operate normally during USB transfer.

- Do not change the folder hierarchy or folder names in <Removable Disk>.
- Do not format the removable disk.

4. Double-click  in the computer task bar.
"Safely Remove Hardware" is displayed. Select "USB Mass Storage Device" and press "Stop".
After confirming the subsequent prompt, disconnect the USB cable from the computer and MS.
5. Press {  } while pressing {  }. The next time the MS is powered ON, the Meas mode screen will be displayed.




- Do not disconnect the USB cable or turn off the MS or computer while files are being copied/ transferred.

8.4 Connection via RS232C cable

PROCEDURE Basic cable settings


1. Connect the cable.
🔌 Cables: "36. OPTIONAL ACCESSORIES"

2. Select "Comms" in SETTINGS mode.
Set communication conditions in the Comms setup tab. Set "Comms mode" to "RS232C".

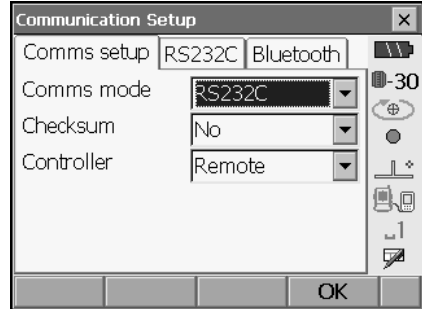

3. Set options in the RS232C tab according to the selection made in the Comms setup tab.
*: factory settings

Baud rate:
1200/2400/4800/9600*/19200/38400bps
Data bits: 7/8* bits
Parity: Not set*/Odd/Even
Stop bit: 1*/ 2

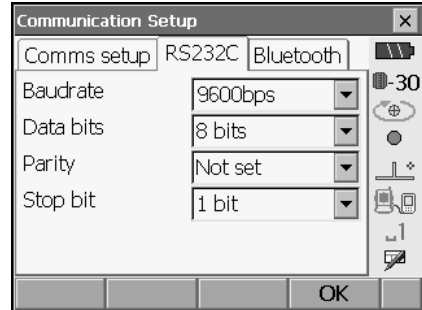

9. SETTING UP THE INSTRUMENT




- Mount the battery in the instrument before performing this operation because the instrument will tilt slightly if the battery is mounted after levelling.


9.1 Centering

PROCEDURE

1. Make sure the legs are spaced at equal intervals and the head is approximately level. Set the tripod so that the head is positioned over the surveying point. Make sure the tripod shoes are firmly fixed in the ground.

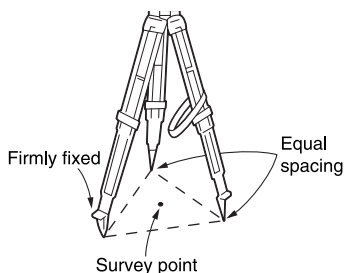


2. Place the instrument on the tripod head. Supporting it with one hand, tighten the centering screw on the bottom of the unit to make sure it is secured to the tripod.

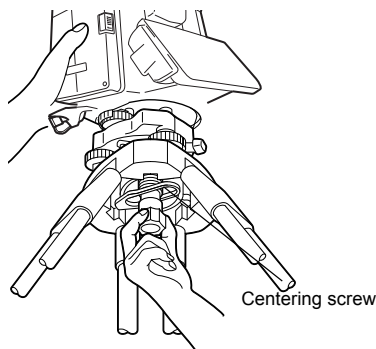

3. Looking through the optical plummet eyepiece, turn the optical plummet eyepiece to focus on the reticle. Turn the optical plummet focusing ring to focus on the surveying point.

Focussing on the survey point

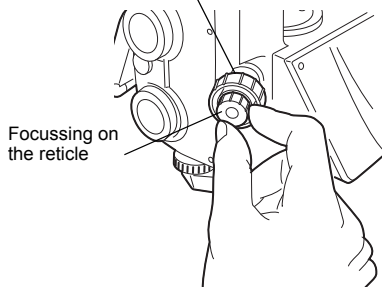

9.2 Levelling


Instrument can be levelled using the screen.

 **Note** Levelling on the screen"


PROCEDURE

1. Adjust the levelling foot screws to center the surveying point in the optical plummet reticle.
2. Center the bubble in the circular level by either shortening the tripod leg closest to the offcenter direction of the bubble or by lengthening the tripod leg farthest from the offcenter direction of the bubble. Adjust one more tripod leg to center the bubble.


Turn the levelling foot screws while checking the circular level until the bubble is centered in the center circle.

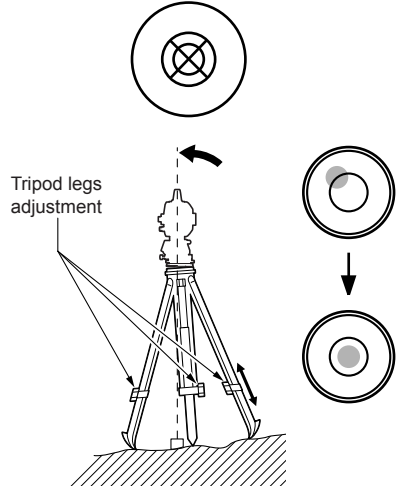

3. Turn the upper part of the instrument until the plate level is parallel to a line between levelling foot screws A and B. Center the air bubble using levelling foot screws A and B simultaneously. The bubble moves towards a clockwise rotated levelling foot screw.

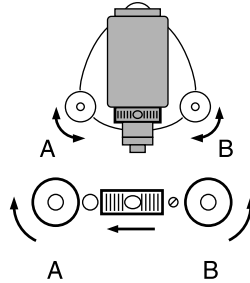


4. Turn the upper part of the instrument though 90°. The plate level is now perpendicular to a line between levelling foot screws A and B. Center the air bubble using levelling foot screw C.

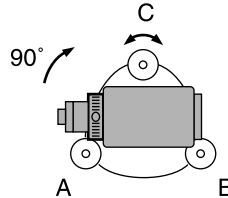

5. Turn another 90° and check bubble position
Turn the upper part of the instrument a further 90° and check to see if the bubble is still in the center of the plate level. If the bubble is off-center, perform the following:
 - a. Turn levelling foot screws A and B equally in opposite directions to remove half of the bubble displacement.
 - b. Turn the upper part a further 90°, and use levelling foot screw C to remove half of the displacement in this direction.

Or adjust the plate level.

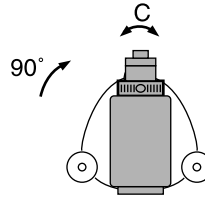


-  "32.1 Plate Level"
6. Turn the instrument and check to see if the air bubble is in the center position in all directions.
If it is not, repeat the levelling procedure.
7. Loosen the centering screw slightly.
Looking through the optical plummet eyepiece, slide the instrument over the tripod head until the surveying point is exactly centered in the reticle.
Retighten the centering screw securely.
8. Check again to make sure the bubble in the plate level is centered
If not, repeat the procedure starting from step 3.

PROCEDURE Levelling on the screen


1. Press {  } to power on.
 "10. POWER ON/OFF"
2. Press { **SETTINGS** } to enter SETTINGS mode.

9. SETTING UP THE INSTRUMENT

3. Select the Tilt tab to display the circular level on the screen.
"●" indicates the bubble in circular level. The range of the inside circle is $\pm 2.5'$ and the range of the outside circle is $\pm 4.5'$.

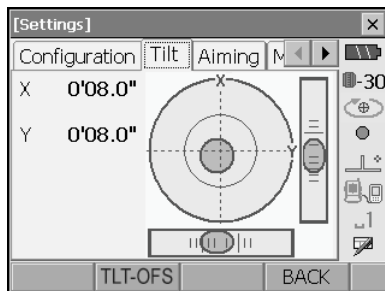

4. Center "●" in the circular level.
☞ "9.2 Levelling" steps 1 to 2
5. Turn the instrument until the telescope is parallel to a line between levelling foot screws A and B.

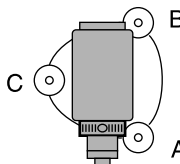

6. Set the tilt angle to 0° using foot screws A and B for the X direction and levelling screw C for the Y direction.
7. Press **{ESC}** to return to Meas mode.

Note

- Press **[TLT-OFS]** to enter <Tilt offset/Meas>.
☞ "32.3 Tilt Sensor"

10. POWER ON/OFF

PROCEDURE Power ON

1. Press {  }.

When the power is switched on, a self-check is run.
The Meas mode screen is displayed.

If "Out of range" is displayed, the instrument tilt sensor is indicating that the instrument is out of level. Level the instrument once again and the horizontal and vertical angles will be displayed.



- "Tilt crn." in "Obs. condition" should be set to "No" if the display is unsteady due to vibration or strong wind.



"30.1 Observation Conditions"



Resume function

The Resume function redisplay the screen appearing before the instrument was powered OFF when the instrument is powered back ON. All parameter settings are also saved. Even if remaining battery power is completely depleted, this function will remain active for 1 minute, after which it is canceled. Replace a depleted battery as soon as possible.

PROCEDURE Power OFF

Press {  } while pressing {  }.



- When there is almost no battery power remaining, the battery mark in the status bar will start to blink. In this event, stop measurement, switch off the power and charge the battery or replace with a fully charged battery.
 - To save power, power to the MS is automatically cut off if it is not operated for a fixed period of time. This time period can be set in "Power off" in <Inst.config.>.
-  "30.2 Instrument Configuration"

10.1 Configuring the Touch Panel

When using for the first time, or after performing a cold boot, the screen for configuring the touch panel will be displayed.

Follow the instructions on the screen. Tap the cross-hairs at the center of the display with the stylus pen. Tap 5 times. Press {←} to complete touch panel configuration. Press {ESC} to retain previous settings. After tapping 5 times the display backlight will dim and the display on the reverse face will illuminate. Tap the cross-hairs on the reverse face display a further 5 times.

Carefully press and briefly hold stylus on the center of the target.
Repeat as the target moves around the screen.
Press the Esc key to cancel.



- Touch panel configuration can be performed at any time during normal operation by pressing [PNL CAL] in <Inst.config.>.

 "30.2 Instrument Configuration"

10.2 Resolving Software Issues

If you are experiencing problems with the MS and suspect a fault in the program, you should try a warm boot. If the problem is not resolved with a warm boot the next step is to perform a cold boot. A warm boot will not erase surveying data in Memory mode but will cancel the resume function. Whenever possible transmit the data to a personal computer before rebooting.

PROCEDURE

1. Power OFF the instrument.
2. Press {⏻} while pressing {←}.
The instrument is reset and powers ON as normal.



Cold boot

If the problem is not resolved with a warm boot the next step is to perform a cold boot. A cold boot will not erase surveying data in Memory mode but all the parameters will be changed to the factory settings. If the data in the memory is necessary, **BE SURE TO TRANSFER IT TO A PERSONAL COMPUTER BEFORE PERFORMING A COLD BOOT.**

To perform a cold boot, while holding {F3}, {F1}, and {BACKSPACE}, press {⏻}.

The instrument is reset and powers ON as normal.


 "30.10 Restoring Default Settings"



Problems Powering OFF

When the instrument cannot be powered OFF as normal, depress the reset button with the tip of the stylus pen. Then, power ON as normal.

- Pressing the Reset button may result in file and folder data being lost.

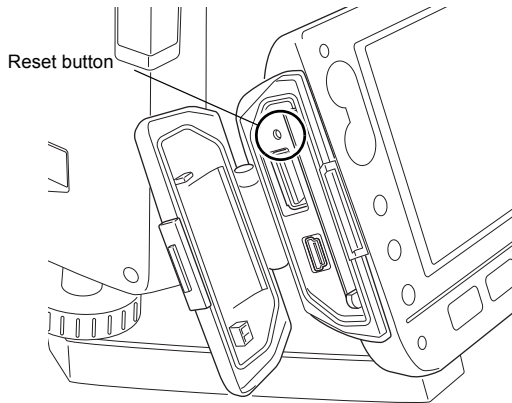


10.3 Powering the MS ON/OFF from an External Instrument

The MS can be powered ON/OFF from an external device such as a computer or data collector. Powering OFF from the paired *Bluetooth* device during *Bluetooth* communication is only possible when the MS is set as the "Slave" device.

When the MS is powered OFF from a paired *Bluetooth* device during *Bluetooth* communication, the screen shown at right will be displayed.

Powering ON the MS from the paired *Bluetooth* device or by pressing {  } on the MS itself redisplay the screen appearing before the instrument was powered OFF.

Powering OFF the MS during *Bluetooth* communication will cancel the *Bluetooth* connection. If this screen is displayed continuously for 30 minutes, power to the MS is automatically cut off.

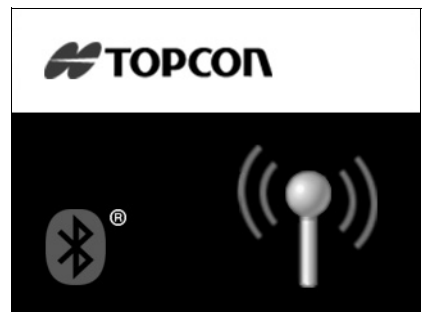

- The password must be input after powering ON the MS from an external device when a password has been set.



Remote PWR-On function: "30.2 Instrument Configuration"
Setting a password: "30.8 Changing Password"

11. TARGET SIGHTING

A target can be automatically sighted using the Auto Pointing function or manually sighted by the operator using the peep sight and telescope. When Auto Pointing is performed, the MS determines the direction in which the light beam reflected from the target (prism, SMR (only for MS with SMR functionality) or reflective sheet target) has returned and automatically rotates the telescope to align the collimation axis of the total station with the center of this target.

Caution

- The instrument emits a laser beam until the center of the prism is sighted.



- Auto Pointing can only be performed when a prism, sheet or SMR (only for MS with SMR functionality) is used as the target. For reflectorless measurement, the target must be sighted manually.
- Use SOKKIA reflective prisms/reflective sheets for higher precision measurement. Use an SMR commercially available for laser tracker systems with an aperture of 38mm (1.5 inch).
- Auto Pointing cannot be performed if the prism is located at the zenith. In this case, manually sight the target.


"11.3 Manually Sighting the Target"

- If more than one prism is located in the field of sight during Auto Pointing, an operation error will occur and the MS will not be able to find the target.
- A prism beyond glass cannot be searched because a measurement error occurs.
- If an obstacle blocks the laser beam path between the MS and the prism, MS cannot find the target correctly.
- When there is sunlight or extremely strong light entering the telescope from the sighting direction or being reflected directly from the objective lens, the MS will evade such light to protect the CCD sensor. When evasion is not possible, search, sighting, and Auto Tracking operations may be automatically canceled. Avoid sunlight and extremely strong light when operating the MS.
- If strong light shines directly into the objective lens, measurement cannot be performed correctly.
- Position the prism in alignment with the objective lens. A prism with a prism constant of -40mm can eliminate the error caused by tilted prism.
- The following table suggests what size target to use for different distances when performing Auto Pointing with a reflective sheet target.

Distance	Target size
3 to 10m	RS10 (10mm)
3 to 20m	RS20 (20mm)
3 to 30m	RS30 (30mm)
5 to 50m	RS50 (50mm)

11.1 Auto Pointing Settings


1. Select "Motor" in <Configuration>.
Set Auto Pointing functions in the Configuration tab.
Set "A.T. Setting" to "Search".

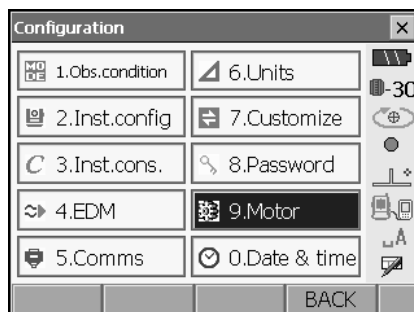

Settings and Options

(*: factory settings)

- (1) Accu. search
 - Fine*/Rapid*
- (2) Centering mode
 - Advanced/Standard*
- (3) A.T. Setting
 - None/Search*/Track
- (4) Srch method
 - G.S.*/R.C.
- (5) Accu.rotate
 - 5"/10"/20"/30"/60"

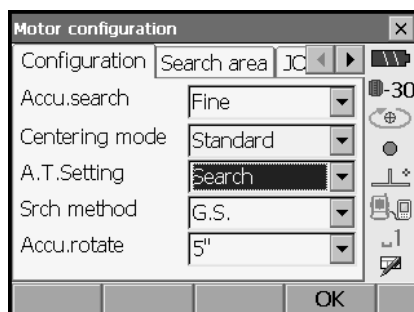

Accu. search

Set to "Fine" for greater accuracy during Auto Pointing. Make sure that the prism is securely mounted on a tripod etc.

Set to "Rapid" when supporting the pole by hand.

When "Fine" is set the MS checks that the prism position is stable, then searches for the prism direction. Once the MS confirms that the prism is sighted at the approximate center of the field-of-view, Auto Pointing is complete. Although this setting provides greater accuracy, when supporting the pole by hand, hand movements will result in Auto Pointing taking too long to complete and a "Time out" error will occur.

When "Rapid" is set however, Auto Pointing can be performed even with slight instability of prism position or minor shifts of target position in the field-of-view. The MS will use the data obtained to determine the direction of the target.

Auto Pointing performed using the "Rapid" setting can be completed in a much quicker time than the "Fine" setting.

"Fine" is recommended when a high level of measurement accuracy is needed.

11. TARGET SIGHTING



Centering mode

This setting refers to internal operation of the Auto Pointing function.

The "Advanced" setting executes Auto Pointing with an emphasis on stability in the movement of the telescope. As a result, Auto Pointing takes longer to complete but sighting accuracy is improved. The "Standard" setting enables Auto Pointing at a comparatively faster speed than "Advanced".



Srch method

Selects search before distance measurement option.

When set to "G.S." the MS will search for the target in the area specified in the Search area tab. When set to "R.C.", the MS will wait for a Turning command to be issued from the RC-Controller before starting Auto Pointing. Such commands can only be received when using instruments incorporating either the RC-TS3 or RC-TS3A handle.



Search operation during Auto Pointing

When the target enters the field-of-view within the set time limit for Auto Pointing completion, the MS stops moving and the offset between the target and telescope reticle is added to the angle measurement value obtained from the encoder and compensated using image processing calculation. Although this compensation reduces measurement time and increases search accuracy, there is a possibility that the target and telescope reticle appear to be misaligned. Compensated values are displayed in blue.

If the MS is rotated (manually or using the jog dials) more than 10", compensation will be canceled, the angle reverts to that obtained from the encoder, and the angle values are once again displayed in black. Compensation is automatically performed when performing Auto Tracking. Terminating Auto Tracking or powering OFF the MS will cancel the compensation function.




Accu. rotate

This option allows the user to set a tolerance range for setting accuracy (after rotation to a specified angle). For example, when this option is set to 30" and [TURN], [H.ANG], or [ROTATE] is pressed, the MS will stop rotation within 30" of the specified rotation angle.


2. Set the area in which to perform target sighting in the Search area tab. Drag the box to specify the desired area or input vertical and horizontal angle values.

Angle values can only be specified in 1°30' steps (e.g. 1°30', 3°00', 4°30' etc.). Input values not conforming to this format will be automatically rounded up.

3. Press [OK].

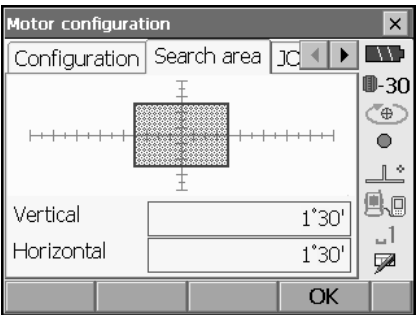

4. Set the Jog dial turning speed for vertical and horizontal rotation of the telescope. The "Shift" point signifies the dial turning speed at which telescope rotation switches from the Lo speed setting to the Hi speed setting. This Shift point, along with the Lo and Hi speed settings can be configured according to user preference.

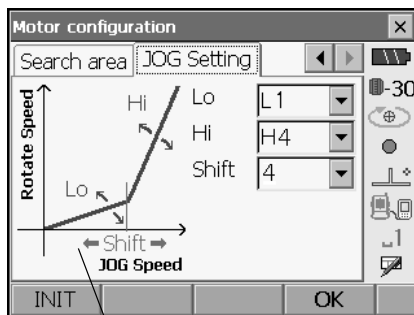

The larger the number set in (3) the further to the right the Shift point is set

Settings and Options

(*: factory settings)

- (1) Lo
1 to 4 (1*) (steps. 4 is fastest)
- (2) Hi
1 to 4 (4*) (steps. 4 is fastest)
- (3) Shift point
1 to 4 (4*) (steps)

Press **[INIT]** to return JOG Setting tab settings only to their factory settings.

11.2 Auto-Pointing Function for Target Sighting

PROCEDURE

1. Use the peep sight to aim the objective lens in the general direction of the target. The vertical and horizontal Jog dials can be used for precise adjustments of the instrument and telescope
 JOG Setting tab: "11.1 Auto Pointing Settings" step 3.
2. Press **[SRCH]** in any Meas mode screen. The telescope and top half of the instrument rotate and target auto-search begins. When the target is found, the instrument sights the center of the prism and stops.
 Allocating the **[SRCH]** softkey:
 "30.6 Allocating Key Functions"

11. TARGET SIGHTING



- When "A.T. Setting" in <Motor configuration> is set to "Search" the function of the following softkeys will change depending on the option selected in "Srch. method".
 - ☞ Motor settings: "11.1 Auto Pointing Settings"
- "Turning" operation: The MS locates the On-demand Remote Control System RC-Controller by detecting the laser beam output by the RC-Controller, then starts Auto Pointing.

"Motor" setting	When "Search" set in "A.T. Setting"		When "None" set in "A.T. Setting"
	"Srch method" is R.C.	"Srch method" is G.S. (Global Search)	
[SRCH]	Performs Auto Pointing		
[DIST]	Performs Turning operation then angle/ distance measurement	Performs Auto Pointing then angle/distance measurement	Performs angle and distance measurement
[RC]	Rotates directly in the direction of the RC-Controller then performs Auto Pointing		
[<-RC]	Rotates in a counterclockwise direction (from the point of view of the RC-Controller) then performs Auto Pointing		
[RC->]	Rotates in a clockwise direction (from the point of view of the RC-Controller) then performs Auto Pointing		
[RC Cont]	Nullifes the current measurement position then continues Turning operation		
[AT On]	Performs Turning operation then Auto Tracking	Performs Auto Pointing then Auto Tracking	Performs Auto Tracking *1

*1: Pressing [AT On] when A. T. Setting is set to "None" will result in one of the following operations being performed.
When "R.C." selected: Performs Turning operation then Auto Tracking
When "G.S." selected: Performs Auto Pointing then Auto Tracking


11.3 Manually Sighting the Target



- When sighting the target, strong light shining directly into the objective lens may cause the instrument to malfunction. Protect the objective lens from direct light by attaching the lens hood.

►PROCEDURE

- Look through the telescope eyepiece at a bright and featureless background.
Turn the eyepiece clockwise, then counterclockwise little by little until just before the reticle image becomes focussed.
Using these procedures, frequent reticle refocussing is not necessary, since your eye is focussed at infinity.

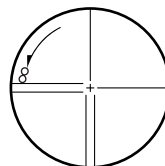

- Use the peep sight to bring the target into the field of view. Turn the vertical and horizontal Jog dials for fine sighting adjustments.
- Turn the telescope focussing ring to focus on the target.
Turn the vertical and horizontal fine motion screws to align the target with the reticle.
The last adjustment of each fine motion screw should be in the clockwise direction.
- Readjust the focus until there is no parallax.
Readjust the focus with the focussing ring until there is no parallax between the target image and the reticle.



Eliminating parallax

This is the relative displacement of the target image with respect to the reticle when the observer's head is moved slightly before the eyepiece.
Parallax will introduce reading errors and must be removed before observations are taken.
Parallax can be removed by refocussing the reticle.



Greater accuracy when sighting manually

For greater accuracy when sighting manually, set A.T. Setting to "None" then automatically rotate the telescope to a specified angle. When the target is in the field-of-view, use the Jog dials to make fine adjustments and accurately sight the center of the prism.

 "11.3 Manually Sighting the Target"

It is recommended that a slow Jog dial turning speed is used for greater stability when performing fine adjustments.

12. MEASUREMENT WITH AUTO TRACKING

With the Auto Tracking function, the MS searches for and sights the target. The MS will then following that target as it is moved from measurement point to measurement point. The On-demand Remote Control System is recommended for high performance Auto Tracking measurement.

Caution

- The instrument emits a laser beam during Auto Pointing and Auto Tracking operation.




- Auto Pointing model does not support Auto Tracking.
- Auto Tracking can only be performed when a prism or SMR (only for MS05A with SMR functionality) is used as the target. Auto Tracking is not possible with reflective sheet and reflectorless measurement. In this chapter, "prism" means prism and SMR.
- Use SOKKIA reflective prisms for higher precision measurement. Use an SMR commercially available for laser tracker systems with an aperture of 38mm (1.5 inch).
- If more than one prism is located in the field of sight during Auto Tracking, an operation error will occur and the MS will not be able to find the target.
- The MS cannot perform Auto Pointing/Auto Tracking when there is glass between the MS and the prism. A measurement error will occur.
- If an obstacle blocks the laser beam path between the MS and the prism, MS cannot find the target correctly.
- When there is sunlight or extremely strong light entering the telescope from the sighting direction or being reflected directly from the objective lens, the MS will evade such light to protect the CCD sensor. When evasion is not possible, search, sighting, and Auto Tracking operations may be automatically canceled. Avoid sunlight and extremely strong light when operating the MS.

12.1


Auto Tracking Settings

PROCEDURE

1. Select "Motor" in <Configuration>.
Set Auto Tracking functions in the Configuration tab.
Set "A.T. Setting" to "Track".

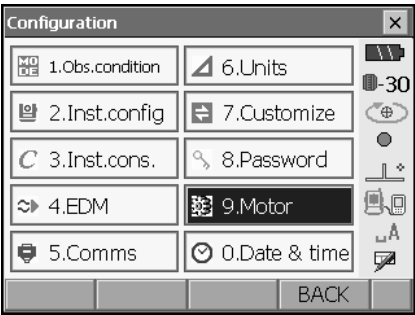


 Configuration tab: "11.1 Auto Pointing Settings"

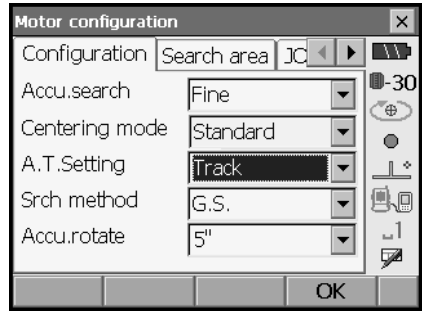

2. Set the area in which to perform target sighting in the Search area tab. Drag the box to specify the desired area or input vertical and horizontal angle values.


Angle values can only be specified in 1°30' steps (e.g. 1°30', 3°00', 4°30' etc.). Input values not conforming to this format will be automatically rounded up.

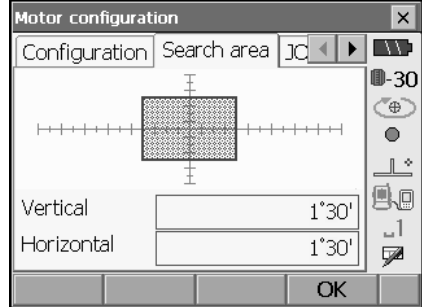

3. When necessary, set the Jog dial turning speed for vertical and horizontal rotation of the telescope.

 JOG Setting tab: "11.1 Auto Pointing Settings" step 3

Press **[INIT]** to return JOG Setting tab settings only to their factory settings.

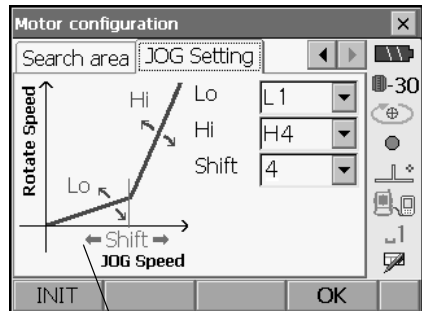

4. Press **[OK]**.

The larger the number set in (3) the further to the right the Shift point is set

12.2 Measurement with Auto Tracking

PROCEDURE

1. Use the peep sight to aim the objective lens in the general direction of the target. (The vertical and horizontal Jog dials can be used for precise adjustments of the instrument and telescope.)
 JOG Setting tab: "11.1 Auto Pointing Settings" step 3
2. Select **[DIST]**, **[RC Cont]**, or **[SRCH]** in any Meas mode screen. The telescope and top half of the instrument rotate and target auto-search begins. When the target is found, the target is aligned in the field-of-view and Auto Tracking starts.
 Allocating softkeys: "30.6 Allocating Key Functions"
3. Press **[AT Off]** in a Meas mode screen to stop Auto Tracking.




- When **[STOP]** is pressed, distance measurement will stop but Auto Tracking will remain active.



Lost Prism

In the event that an obstacle prevents the MS sighting the target during Auto Tracking, the instrument will predict the direction in which the target will travel and continue Auto Tracking based on this prediction. If the MS re-acquires the target in this predicted direction, Auto Tracking continues without change. If the target is not re-acquired however, Auto Tracking will stop and the MS will enter "prism wait" status for a period of 60 seconds. If the target enters the field of view or a Turning command is received from the RC-Controller during "prism wait", the MS will search for the target, then resume Auto Tracking. If the target is not re-acquired during the "prism wait" period, the target is considered "lost" and sighting terminates. Start Auto Tracking procedure again from step 1.

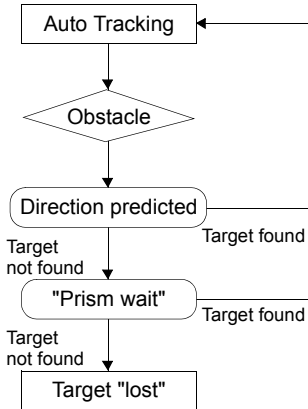

Note

- When "A.T. Setting" in <Motor configuration> is set to "Track" the function of the following softkeys will change depending on the option selected in "Srch. method" and Auto Tracking will be added.

 Motor settings: "11.1 Auto Pointing Settings"

12. MEASUREMENT WITH AUTO TRACKING



Turning operation

The MS locates the On-demand Remote Control System RC-Controller by detecting the laser beam output by the RC-Controller, then starts Auto Pointing.

"Motor" setting	When "Track" set in "A.T. Setting"		When "None" set in "A.T. Setting"
	"Srch method" is R.C.	"Srch method" is G.S. (Global Search)	
[SRCH]	Performs Auto Pointing then Auto Tracking		Performs Auto Pointing
[DIST]	Performs Turning operation then distance measurement/Auto Tracking	Performs Auto Pointing then distance measurement/Auto Tracking	Performs angle and distance measurement
[RC]	Rotates directly in the direction of the RC-Controller then performs Auto Pointing		Rotates in the direction specified by the RC-Controller then performs Auto Pointing
[<-RC]	Rotates in a counterclockwise direction (from the point of view of the RC-Controller) then performs Auto Pointing/Auto Tracking		Rotates in a counterclockwise direction (from the point of view of the RC-Controller) then performs Auto Pointing
[RC->]	Rotates in a clockwise direction (from the point of view of the RC-Controller) then performs Auto Pointing/Auto Tracking		Rotates in a clockwise direction (from the point of view of the RC-Controller) then performs Auto Pointing
[RC Cont]	Nullifies the current measurement position then continues Turning operation/Auto Tracking		Nullifies the current measurement position then continues Turning operation
[AT On]	Performs Turning operation then Auto Tracking	Performs Auto Pointing then Auto Tracking	Performs Auto Tracking *1

*1: Pressing [AT On] when A. T. Setting is set to "None" will result in one of the following operations being performed.

When "R.C." selected: Performs Turning operation then Auto Tracking

When "G.S." selected: Performs Auto Pointing then Auto Tracking

13. ANGLE MEASUREMENT

This section explains the procedures for basic angle measurement in Basic mode.

- It is possible to allocate softkeys in measurement menus to suit various applications and the ways that different operators handle the instrument.


 "30.6 Allocating Key Functions"

13.1 Measuring the Horizontal Angle between Two Points (Horizontal Angle 0°)


Use the "0SET" function to measure the included angle between two points. The horizontal angle can be set to 0 at any direction.

PROCEDURE

1. Sight the first target as at right.

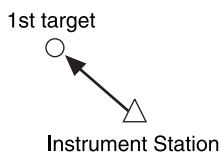


2. In the first page of the Meas mode screen, press **[0SET]**.
[0SET] will flash, so press **[0SET]** again.
The horizontal angle at the first target becomes 0°.

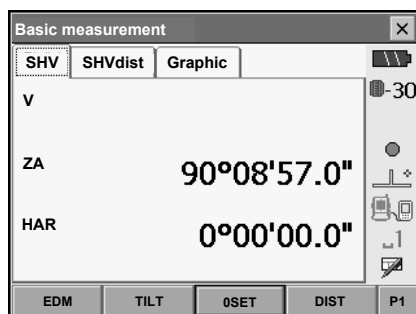


3. Sight the second target.

 2nd Target



The displayed horizontal angle (HAR) is the included angle between two points.

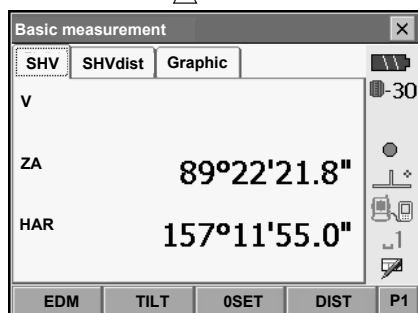

13.2 Setting the Horizontal Angle to a Required Value (Horizontal Angle Hold)



You can reset the horizontal angle to a required value and use this value to find the horizontal angle of a new target.

PROCEDURE

1. Sight the first target.
2. In the second page of Meas mode, press **[H.ANG]**. <Set H angle> is displayed.
3. Enter the angle you wish to set, then press **[OK]**.
The value that is input as the horizontal angle is displayed.

- Press **[SRCH]** to rotate the MS in the direction of the desired angle.
- The same setting can also be performed with coordinate and azimuth input.
 "16.2 Azimuth Angle Setting"
- Press **[REC]** to store the backsight station data in the current JOB. Input point number, target height and code, then press **[OK]**.

4. Press **[OK]** to confirm the input value and display the new horizontal angle.

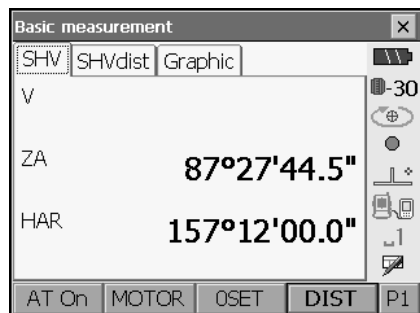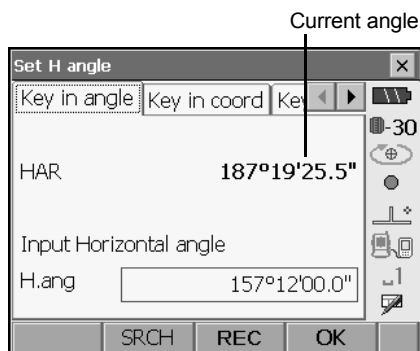

5. Sight the second target.
The horizontal angle from the second target to the value set as the horizontal angle is displayed.



- Pressing **[HOLD]** performs the same function as above.
- Press **[HOLD]** to set the displayed horizontal angle. Then, set the angle that is in hold status to the direction you require.

 Allocating **[HOLD]**: "30.6 Allocating Key Functions"

13.3 Turning the Instrument from the Reference Angle to a Specified Angle

The MS automatically turns from the reference direction to the specified angle (target).


- MS also turns to the target coordinates when reference angle is omitted.



- Rotation may not be completed correctly when specifying an angle near the zenith or nadir if "Tilt crn." or "Coll. crn" is set to "Yes" in "Obs.condition".


PROCEDURE

- Sight the point you will use as the reference angle and set it as the reference angle.
Sight the reference point and press **[0SET]**, or input the reference point angle.
 ☞ "13.1 Measuring the Horizontal Angle
 between Two Points (Horizontal Angle 0°)/
 "13.2 Setting the Horizontal Angle to a
 Required Value (Horizontal Angle Hold)"
- Press **{SETTINGS}** to switch to SETTINGS mode.
Select "Motor" in the Configuration tab.

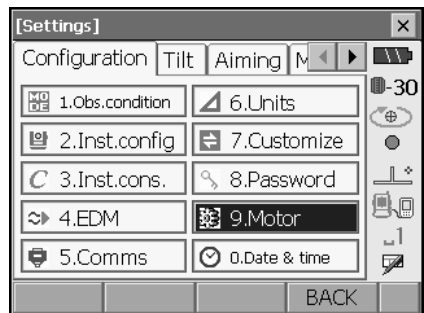

13. ANGLE MEASUREMENT

3. Enter the vertical and horizontal angles in the Motor tab.
 - Pressing **[READ]** in the second page displays recorded coordinates data. This data can be recalled and used for settings.
 "23.1 Instrument Station Settings"
 - The target angle can be obtained from the entered instrument station and target coordinates. Instrument station data is entered on the second page. Press **[OK]** to calculate both the horizontal and vertical angle from the coordinates.
4. After confirming the coordinates, press **[ROTATE]**. The MS moves to the point (target) entered in step 3.

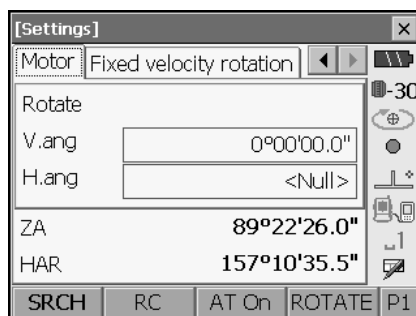

13.4 Angle measurement and Outputting the Data

The following explains angle measurement and the features used to output measurement results to a computer or other external devices.

 "13. ANGLE MEASUREMENT", Cables: "36. OPTIONAL ACCESSORIES",

Output format and command operations: Command Explanations manuals

PROCEDURE

1. Connect MS and external device.
2. Sight the target point.
3. Press **[HV out]** in Meas mode to output target measurement results to the external device.

14. DISTANCE MEASUREMENT

Perform the following settings as preparation for distance measurement in Basic mode.

- Distance measurement mode
- Target type
- Prism constant correction value
- ppm
- It is possible to allocate softkeys in measurement menus to suit various applications and the ways that different operators handle the instrument.
 "30.6 Allocating Key Functions"

Caution

- When using the laser-pointer function, be sure to turn OFF the output laser after distance measurement is completed. Even if distance measurement is canceled, the laser-pointer function is still operating and the laser beam continues to be emitted.



- Make sure that the target setting on the instrument matches the type of target used. MS automatically adjusts the intensity of the laser beam and switches the distance measurement display range to match the type of target used. If the target does not correspond to the target settings, accurate measurement results cannot be obtained.
- Accurate measurement results cannot be obtained if the objective lens is dirty. Dust it off with the lens brush first, to remove minute particles. Then, after providing a little condensation by breathing on the lens, wipe it off with the wiping cloth.
- During reflectorless measurement, if an object with a high reflective factor (metal or white surface) is positioned between the MS and the target, accurate measurement results may not be received.
- Scintillation may affect the accuracy of distance measurement results. Should this occur, repeat measurement several times and use the averaged value of the obtained results.

14.1 **Returned Signal Checking**

Check to make sure that sufficient reflected light is returned by the target sighted by the telescope. Checking the returned signal is particularly useful when performing long distance measurements.

Caution


- The laser beam is emitted during returned signal checking.



- Manually sight the target when checking the returned signal.
- When the light intensity is sufficient even though the center of the reflective prism and the reticle are slightly misaligned (short distance etc.), "●" will be displayed in some cases, but in fact, accurate measurement is impossible. Therefore make sure that the target center is sighted correctly.

PROCEDURE

1. Accurately sight the target manually.
☞ "11.3 Manually Sighting the Target"
2. Press **{SETTINGS}** to switch to SETTINGS mode and select the Aiming tab or press **[AIM]** in Meas mode.
☞ Allocating **[AIM]**: "30.6 Allocating Key Functions"

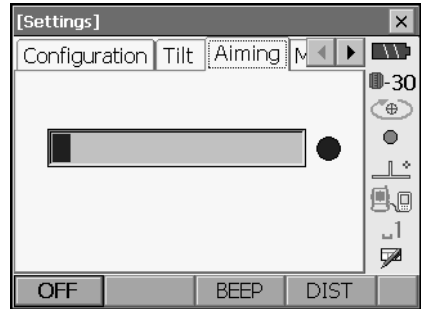

When **[AIM]** is pressed, a gauge indicating light intensity is displayed.

- The more [REDACTED] displayed, the greater the quantity of reflected light.
- If "●" is displayed, only enough light for the measurement is returned.
- When "●" is not displayed, accurately resight the target.

[BEEP]/[OFF]: Sets a buzzer sound when measurement is possible. Press to switch on and off.

[DIST]: Returns to Meas mode and starts angle and distance measurement regardless of "A.T. Setting" setting. This softkey is not displayed when the returned signal checking function is accessed from Program mode.

3. Press **[OFF]** to finish signal checking.
Press **{ESC}** or tap the cross in the top-right corner to return to the previous screen.

Note

- When [REDACTED] is displayed persistently, but "●" is not, contact your local dealer.
- If no key operations are performed for two minutes, the display automatically returns to the previous screen.

14.2 Distance and Angle Measurement

An angle can be measured at the same time as distance.


- The search range can be set.
-  "11.1 Auto Pointing Settings"

Caution


- The laser beam is emitted during Auto Pointing and Auto Tracking.

PROCEDURE

- Face the MS in the direction of the target
Use the peep sight to aim the MS and telescope toward the target.
 "11. TARGET SIGHTING"
- Start measurement.
Press **[DIST]** in the first page of Meas mode to start measurement.

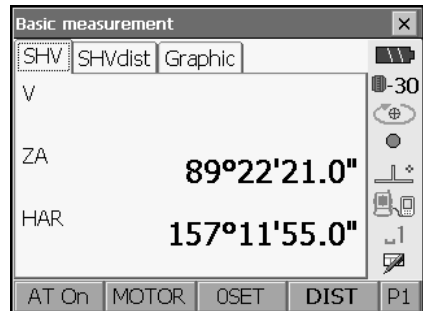

The measured distance data (S), vertical angle (ZA), and horizontal angle (HAR) are displayed.

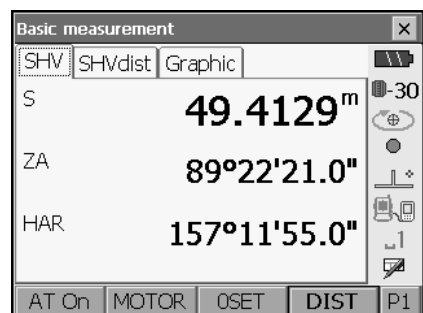

- Press **[STOP]** to quit distance measurement.

Note

- If the single measurement mode is selected, measurement automatically stops after a single measurement.

14. DISTANCE MEASUREMENT

- During fine average measurement, the distance data is displayed as S1, S2,... to S9. When the designated number of measurements has been completed, the average value of the distance is displayed in the "SA" line.
- The distance and angle that are most recently measured remain stored in the memory until the power is off and can be displayed at any time by pressing **[RCL]**.

 Allocating **[RCL]**: "30.6 Allocating Key Functions"

14.3 Distance Measurement and Outputting the Data

The following explains distance measurement and the features used to output measurement data to a computer or external devices.

 "13. ANGLE MEASUREMENT", Communication cables: "36. OPTIONAL ACCESSORIES".

Output format and command operations: Command Explanations manuals

PROCEDURE

1. Connect MS and external device.
2. Sight the target point.
3. Press **[HVD out]** in Meas mode to start distance measurement. Target measurement results are output to the external device.


 Output type: "30.6 Allocating Key Functions",
"30.1 Observation Conditions"
4. Press **[STOP]** to finish data output and return to the Meas mode.

14.4 REM Measurement

An REM measurement is a function used to measure the height to a point where a target cannot be directly installed such as power lines, overhead cables and bridges, etc. The height of the target is calculated using the following formula.

$$Ht = h_1 + h_2$$

$$h_2 = S \sin \theta_{z1} \times \cot \theta_{z2} - S \cos \theta_{z1}$$

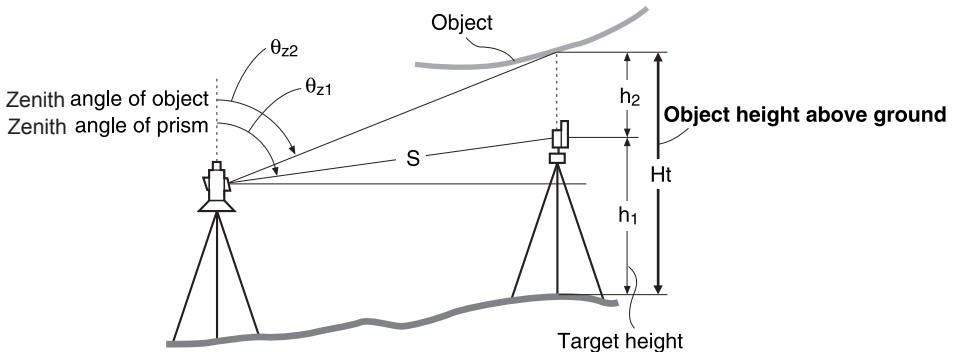


- It is possible to allocate softkeys in measurement menus to suit various applications and the ways that different operators handle the instrument.

☞ "30.6 Allocating Key Functions"


PROCEDURE

- Set the target directly under or directly over the object and measure the target height with a tape measure etc.

Press **[HT]** and enter the target height.

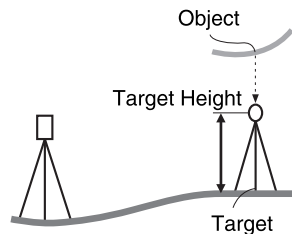

- Select "REM" in the "SURV" tab of <Menu>.

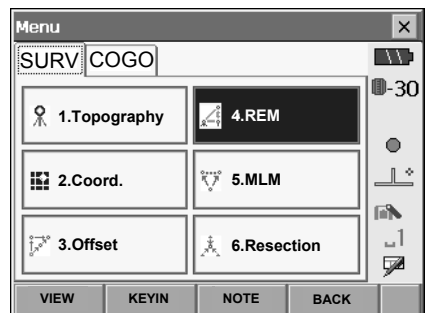

14. DISTANCE MEASUREMENT

3. Sight the target and press **[DIST]** to start measurement. Press **[STOP]** to stop the measurement.

The measured distance data, vertical angle and horizontal angle are displayed.

Remote elevation

Need base point obs.

S

ZA 89°02'07.5"

HAR 170°02'47.5"

HT DIST

Remote elevation

Ht.

S 49.4129 m

ZA 89°02'07.2"

HAR 170°02'47.5"

HT DIST REM

4. Sight the object, then press **[REM]** to start REM measurement is started. The height from the ground to the object is displayed in "Ht.". Press **[STOP]** to stop the measurement.

- To re-observe the target, sight the target then press **[DIST]**.
- To continue REM measurement, press **[REM]**.

Remote elevation

Ht. 2.5655 m

S 49.4129 m

ZA 54°44'01.5"

HAR 170°02'47.4"


HT DIST REM



- When measurement data already exists, select **[REM]** in the "SURV" tab of <Menu> as in step 2 to proceed to step 4 and start REM measurement. Press **[STOP]** to stop the measurement.

15. TOPOGRAPHY MEASUREMENT

It is possible to find angle and distance to the target based on station point coordinates, instrument height, target height, and azimuth angles of the backsight station which are entered in advance. Measurement can be continuously performed and recorded.

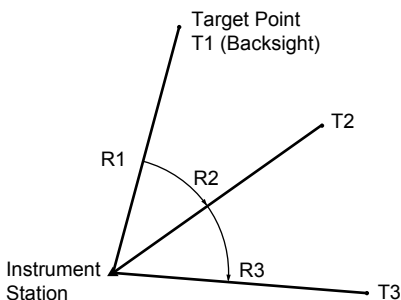


- It is possible to allocate softkeys in measurement menus to suit various applications and the ways that different operators handle the instrument.
☞ "30.6 Allocating Key Functions"

15.1 Entering Instrument Station Data

Before performing topography measurement, enter instrument station coordinates, instrument height and target height.

PROCEDURE



1. First measure instrument height with a tape measure, etc.
2. Select "Topography" in the "SURV" tab of <Menu>.

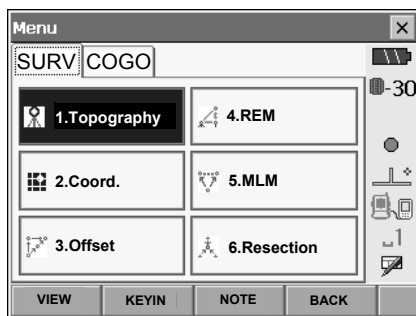

15. TOPOGRAPHY MEASUREMENT

3. Select "Station setup" in <Topography> and enter instrument station coordinates, point number, instrument height and code.

- Press **[READ]** to read in coordinate data registered in Memory mode.

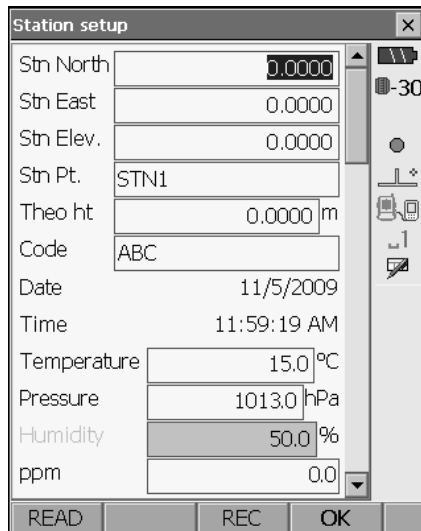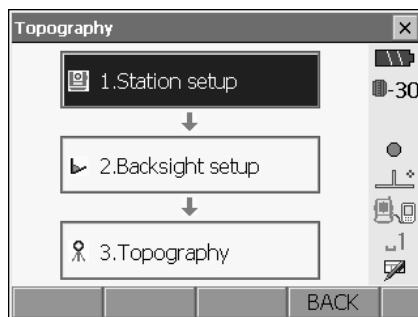


4. Press **[OK]** to set the input values. <Set H angle> is displayed.

- When **[REC]** is pressed, instrument station data is stored in the current JOB and the input values are set.

15.2 Azimuth Angle Setting


Based on the instrument station coordinates and backsight station coordinates already been set, the azimuth angle of the backsight station is calculated.

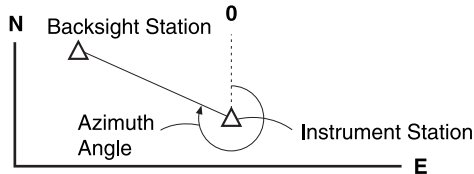

PROCEDURE Entering coordinates


1. Select "Backsight setup" in <Topography>. <Set H angle> is displayed.

- <Set H angle> can also be displayed from the screen in step 4 of "15.1 Entering Instrument Station Data".

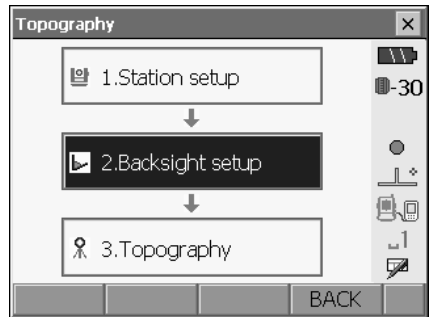


2. Select the Key in coord tab and enter the backsight station coordinates.

- **[READ]:** Reads in coordinate data registered in Memory mode.
- **[Azimuth]:** Switches horizontal angle setting method.
 Horizontal angle settings

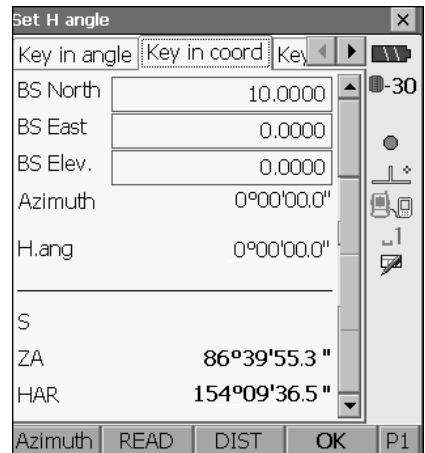

15. TOPOGRAPHY MEASUREMENT

- Sight the backsight station and press **[DIST]**. Press **[STOP]** to display the distance calculated from coordinates, the measured distance, and the difference between the two. Press **[YES]** to set the azimuth angle and return to <Topography>. Press **[REC]** to store the backsight station data in the current JOB. Input point number, target height and code, then press **[OK]**.

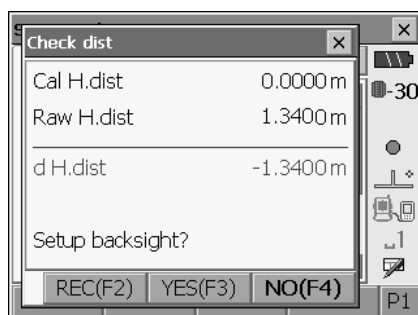

3. Press **[OK]** to set the input values. <Topography> is displayed.


PROCEDURE Entering angle

1. Select "Backsight setup" in <Topography>. <Set H angle> is displayed.

<Set H angle> can also be displayed from the screen in step 4 of "15.1 Entering Instrument Station Data".

2. Select the Key in angle tab and enter the desired angle in "H.ang".

- Press **[REC]** to store the backsight station data in the current JOB. Input point number, target height and code, then press **[OK]**.

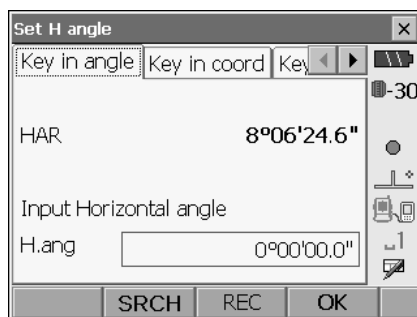

3. Press **[OK]** to set the input values. <Topography> is displayed.


PROCEDURE Entering azimuth

1. Select "Backsight setup" in <Topography>. <Set H angle> is displayed.
 - <Set H angle> can also be displayed from the screen in step 4 of "15.1 Entering Instrument Station Data".
2. Select the Key in azimuth tab and enter the desired angle in "Azimuth".

- **[Azimuth]**: Switches horizontal angle setting method.

 "Horizontal angle settings"

- Press **[REC]** to store the backsight station data in the current JOB. Input point number, target height and code, then press **[OK]**.

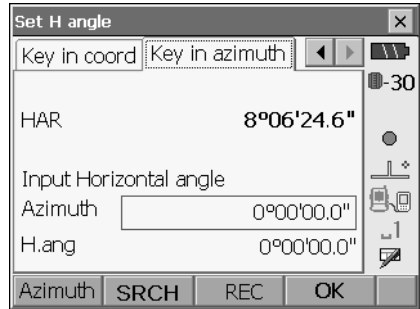

3. Press **[OK]** to set the input values. <Topography> is displayed.



Horizontal angle settings


Azimuth (set both horizontal and azimuth angles to the same value)/H.ANG (input both horizontal and azimuth angles)/None (input azimuth angle only)/0 SET (horizontal angle set to 0°)

15.3 Topography Measurement

The angle and distance to a target can be found by measuring the target based on the settings of the instrument station and backsight station.


PROCEDURE

1. Sight the target at the target point.
2. Select "Topography" in <Topography>.

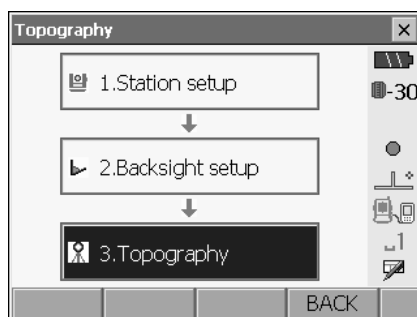

Press **[DIST]** to start measurement. Press **[STOP]** to stop the measurement. The measurement results are displayed. Select the Graphic tab to display measurement results on a graph.

- When recording data in the current JOB, input point number, target height, and code, then press **[REC]**.
- Press **[AUTO]** to perform coordinate measurement and automatically record the results. **[AUTO]** is convenient for recording measurement data when point number, code, and target height are not set.
- Press **[A-OFS]/[D-OFS]** on the second page to perform angle/distance offset measurement.
 "20. OFFSET MEASUREMENT"

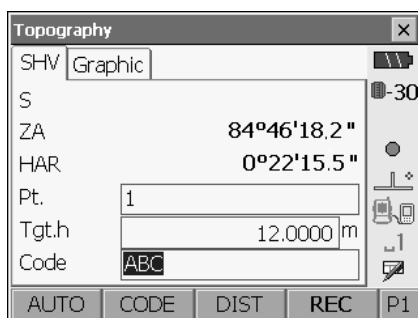

3. Sight the next target and press **[DIST]** to begin measurement. Continue until all targets have been measured.
4. When topography measurement is completed, press **{ESC}** or tap the cross in the top-right corner to return to <Topography>.

Note

- If the same point number is input, the following screen is displayed. Recording instrument station data and backsight station data is an exception.

S	2.2822 m
ZA	46°56'12.0 "
HAR	16°09'21.5 "
Pt.	3
Target	0.0000 m
Save data ?	


ADD(F1) NO(F4) P1

Press **[ADD]** to record the point as another record with the same name.

Press **[NO]** to input a new name.

16.COORDINATE MEASUREMENT

By performing coordinate measurements it is possible to find the 3-dimensional coordinates of the target based on station point coordinates, instrument height, target height, and azimuth angles of the backsight station which are entered in advance.

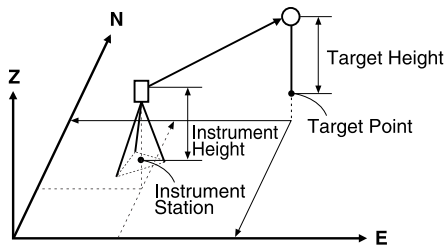

- It is possible to allocate softkeys in measurement menus to suit various applications and the ways that different operators handle the instrument.
☞ "30.6 Allocating Key Functions"


16.1

Entering Instrument Station Data


Before performing coordinate measurement, enter instrument station coordinates, instrument height and target height.

PROCEDURE

- First measure the target height and instrument height with a tape measure, etc.
- Select "Coord." in the "SURV" tab of <Menu>.

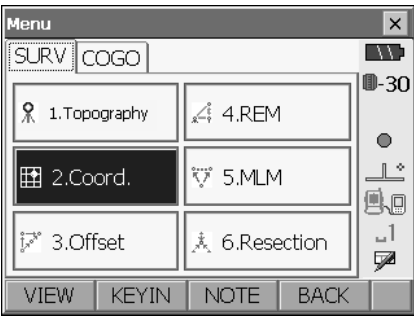


3. Select "Station setup" and enter instrument station coordinates, point number, instrument height and code.

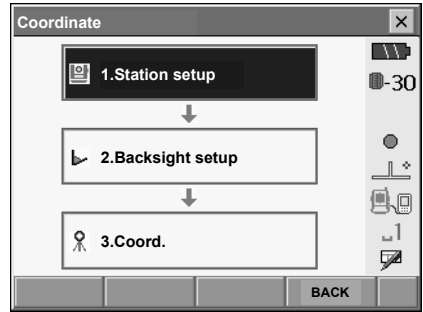

- Press **[READ]** to read in coordinate data stored in the current JOB and the coordinate search JOB.


☞ "16.4 Reading in Registered Coordinate Data"

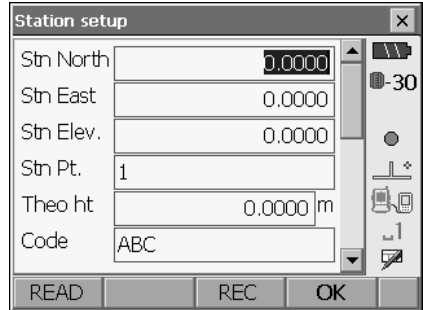

4. Press **[OK]** to set the input values. <Set H angle> is displayed again.
- When **[REC]** is pressed, instrument station data is stored in the current JOB and the input values are set.

16.2 Azimuth Angle Setting


Based on the instrument station coordinates and backsight station coordinates which have already been set, the azimuth angle of the backsight station is calculated.

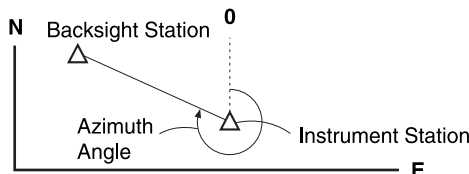

PROCEDURE Entering coordinates

1. Select "Backsight setup" in <Coordinate>. <Set H angle> is displayed.


- <Set H angle> can also be displayed from the screen in step 4 of "16.1 Entering Instrument Station Data".

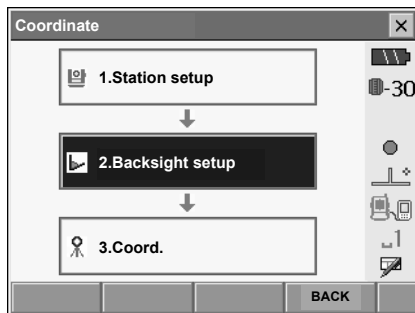


2. Select the Key in coord tab and enter the backsight station coordinates.

- **[READ]**: Reads in coordinate data registered in Program mode.
 "23.1 Instrument Station Settings"
- **[SRCH]**: Performs Auto Pointing. Rotates the MS in the direction of the backsight.

3.

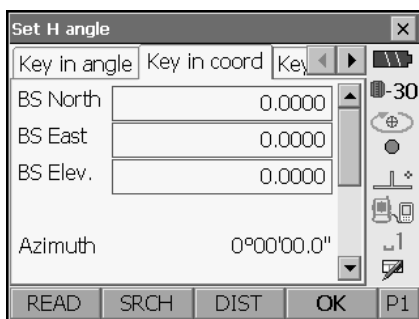

- Sight the backsight station and press **[DIST]**. Press **[STOP]** to display the distance calculated from coordinates, the measured distance, and the difference between the two. Press **[YES]** to set the azimuth angle and display <Coord. measurement>. Press **[REC]** to store the backsight station data in the current JOB. Input point number, target height and code, then press **[OK]**.

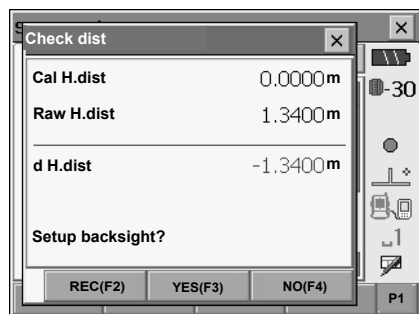

4. Press **[OK]** to set the input values. <Coord. measurement> is displayed.

PROCEDURE Entering angle

1. Select "Backsight setup" in <Coordinate>. <Set H angle> is displayed.
- . <Set H angle> can also be displayed from the screen in step 4 of "16.1 Entering Instrument Station Data".
2. Select the Key in angle tab and enter the desired angle in "H.ang".
 - **[SRCH]**: Performs Auto Pointing. Rotates the MS in the direction of the backsight.

3. Press **[OK]** to set the input values. <Coord. measurement> is displayed.
 - Press **[REC]** to store the backsight station data in the current JOB. Input point number, target height and code, then press **[OK]**. <Coord. measurement> is displayed.

PROCEDURE Entering azimuth

1. Select "Backsight setup" in <Coordinate>. <Set H angle> is displayed.
- . <Set H angle> can also be displayed from the screen in step 4 of "16.1 Entering Instrument Station Data".
2. Select the Key in azimuth tab and enter the desired angle in "Azimuth".
 - **[SRCH]**: Performs Auto Pointing. Rotates the MS in the direction of the backsight.
 - **[Azimuth]**: Switches horizontal angle setting method.
 - ☞ "Horizontal angle settings"

16. COORDINATE MEASUREMENT

3. Press **[OK]** to set the input values. <Coord. measurement> is displayed.

 - Press **[REC]** to store the backsight station data in the current JOB. Input point number, target height and code, then press **[OK]**. <Coord. measurement> is displayed.



Horizontal angle settings

Azimuth (set both horizontal and azimuth angles to the same value)/H.ANG (input both horizontal and azimuth angles)/None (input azimuth angle only)/0 SET (horizontal angle set to 0°)

16.3 3-D Coordinate Measurement

The coordinate values of the target can be found by measuring the target based on the settings of the instrument station and backsight station.

The coordinate values of the target are calculated using the following formulae.

$$N1 \text{ Coordinate} = N0 + S \times \sin Z \times \cos Az$$

$$E1 \text{ Coordinate} = E0 + S \times \sin Z \times \sin Az$$


$$Z1 \text{ Coordinate} = Z0 + S \times \cos Z + ih - fh$$

N0: Station point N coordinate S: Slope distance ih: Instrument height

E0: Station point E coordinate Z: Zenith angle fh: Target height

Z0: Station point Z coordinate Az: Direction angle

"Null" coordinates will not be included in calculations. "Null" is not the same as zero.

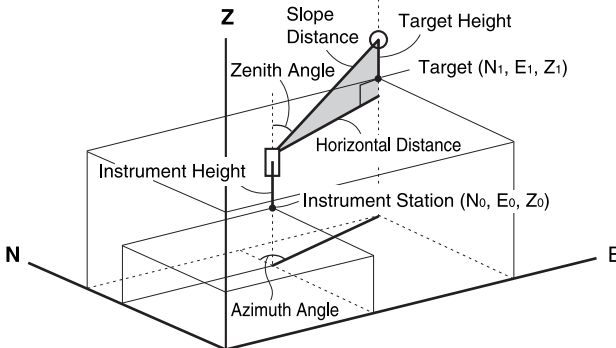


PROCEDURE

1. Sight the target at the target point.
2. Select "Coord." in <Coordinate>.

Press **[DIST]** to start measurement. Press **[STOP]** to stop the measurement. The coordinates of the target point are displayed. Select the Graphic tab to display coordinates on a graph.

- When recording data in the current JOB, input point number, target height, and code, then press **[REC]**.
- Press **[AUTO]** to perform coordinate measurement and automatically record the results. **[AUTO]** is convenient for recording measurement data when not setting point number, code, and target height.
- Press **[A-OFS]/[D-OFS]** on the second page to perform angle/distance offset measurement.
 "20. OFFSET MEASUREMENT"


3. Sight the next target and press **[DIST]** to begin measurement. Continue until all targets have been measured.
4. When coordinate measurement is completed, press **[ESC]** or tap the cross in the top-right corner to return to <Coordinate>.

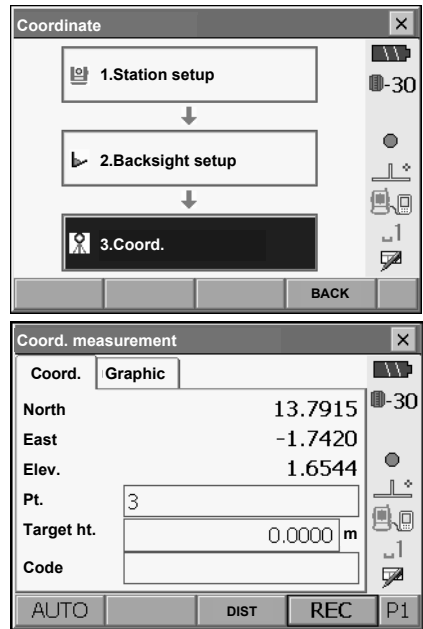


16.4 Reading in Registered Coordinate Data

16.4.1 Selecting points from registered coordinates

When **[READ]** is pressed, coordinate data stored in the current JOB and the coordinate search JOB is recalled and displayed in <Coord reference>. The points thus displayed can then be selected as points for the current operation. The List and Graphic tabs are linked so that when a particular point is selected in one tab, the same point is automatically selected in the other tab.

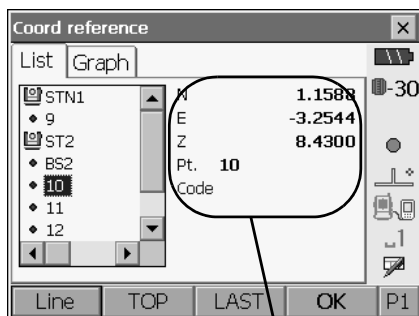

Details of the selected data

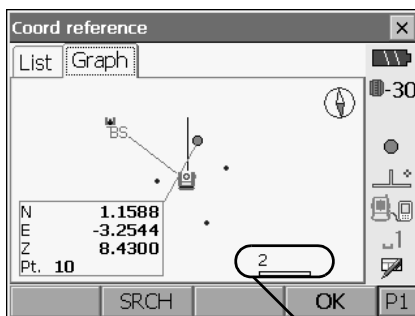

Scale bar

The screen contains the following softkeys:

[Line]/[Page]: Switch the operation of {▲}/{▼} from page scroll to point scroll.

[TOP]: Select the first point in the list.

[LAST]: Select the last point in the list.

[SRCH]: Search for point number.

[CNFG] (on the second page):


Change the display setting.

[DEF.] (on the second page):

Return to the default display format.

16.4.2 Searching for a point

1. Press **[SRCH]** in <Coord reference>.
2. Enter a point number and press **[OK]** or **[←]** to start the search. Up to 14 characters can be input. Any existing point with a matching number will be displayed at the top of the list.

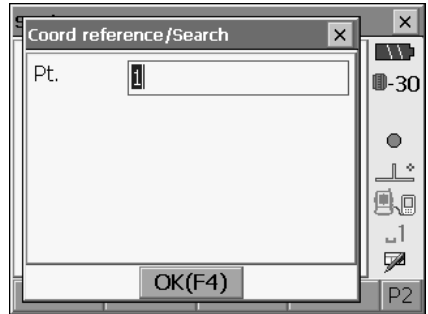

16.4.3 Configuration

1. Press **[CNFG]** on the second page of <Coord reference> to change the display setting.
2. Change the settings.

JOB data and Coord JOB:

Displayed JOB can be selected.

Settings:



Orientation of the display can be selected from telescope direction, north or south.

Center:

Center point for the display can be selected from instrument station or target point.

Pt.name:

Switch point name display on/off.

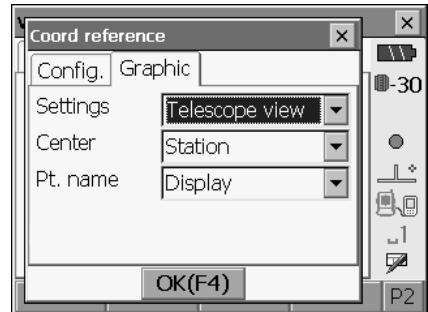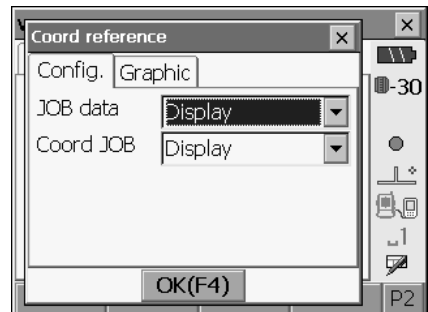


3. Press **[OK]** to confirm the settings.

17. RESECTION MEASUREMENT

Resection is used to determine the coordinates of an instrument station by performing multiple measurements of points whose coordinate values are known. Registered coordinate data can be recalled and set as known point data. Residual of each point can be checked, if necessary

Entry	Output
Coordinates of known point : (N_i, E_i, Z_i)	Station point coordinates : (N_0, E_0, Z_0)
Observed horizontal angle : H_i	
Observed vertical angle : V_i	
Observed distance : D_i	

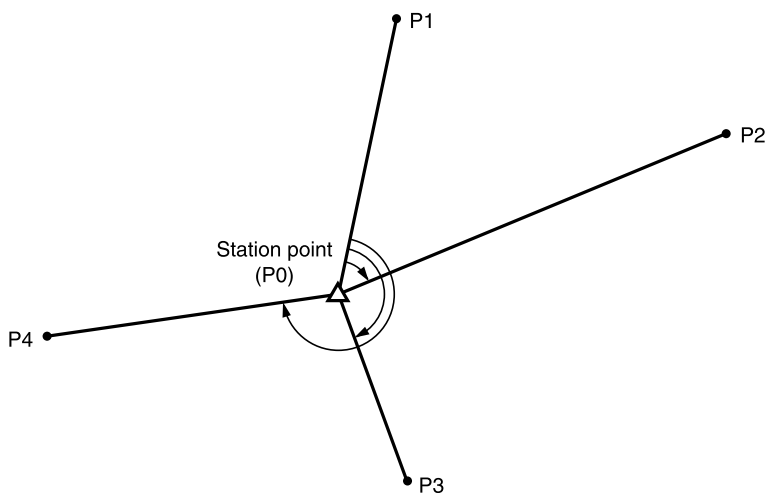

- Between 2 and 10 known points can be measured by distance measurement, and between 3 and 10 known points by angle measurement.
- The more known points there are and the more points there are whose distance can be measured, the higher the precision of the coordinate value calculation.
- It is possible to allocate softkeys in measurement menus to suit various applications and the ways that different operators handle the instrument.


 "30.6 Allocating Key Functions"

17.1 Coordinate Resection Measurement


N, E, Z of an instrument station is determined by the measurement.

PROCEDURE

1. Select "Resection" in <Menu>.

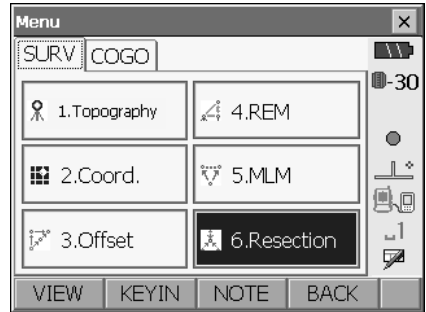

2. Select "NEZ" to display <Resection/Known point>.

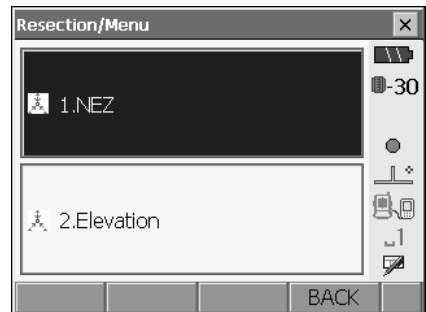


3. Input the known point.

After setting the coordinates and target height for the first known point press **[NEXT]** to move to the second point.

- Press **[READ]** to read in registered coordinate data registered in Program mode.
 📁 "23.1 Instrument Station Settings"
- Press **[PREV]** to return to settings for the previous point.

When all required known points have been set, press **[OK]**.

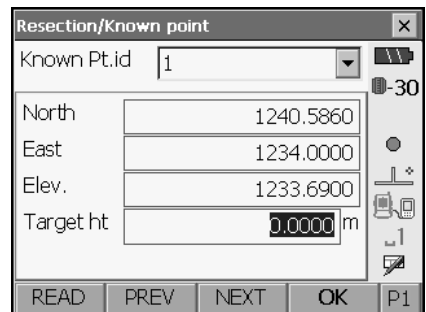

17. RESECTION MEASUREMENT

4. Sight the first known point and press **[DIST]** to begin measurement.
The measurement results are displayed on the screen.
- When **[ANGLE]** has been selected, the distance cannot be displayed.

Resection/measurement known points	
Pt. 1	A03-80420
North	1240.5860
East	1234.0000
Elev.	1233.6900
S	1.8655 m
ZA	90°43'22.5"
HAR	249°01'55.5"

Buttons: ANGLE DIST

5. Press **[YES]** to use the measurement results of the first known point.
- You can also input target height here.
 - Press **[NO]** to return to the screen in step 3 and perform measurement again.

Resection/result	
S	12.8321 m
ZA	93°16'09.5"
HAR	159°27'31.0"
Target ht	0.0000 m

Buttons: YES(F1) NO(F4)

6. Repeat procedures 3 to 4 in the same way from subsequent points.
When the minimum quantity of observation data required for the calculation is present, **[CALC]** is displayed.

Resection/result	
S	21.2425 m
ZA	86°21'15.0"
HAR	77°10'36.5"
Target ht	0.0000 m

Buttons: CALC(F1) YES(F3) NO(F4)

[AUTO] will be displayed for the 3rd point onwards for Auto Tracking models. Pressing **[AUTO]** will rotate the instrument to the next point and start auto measurement.

- Press **[STOP]** during auto measurement to display a confirmation message. Press **[YES]** in this message to return to the first point measured using auto measurement. Measurement can now be continued manually. Press **[NO]** to continue measurement manually from the current position.

Resection/measurement known points	
Known Pt.id	3
North	0.3661
East	0.2335
Elev.	0.0002
S	95°27'48.5"
ZA	32°34'14.5"
HAR	32°34'14.5"

Buttons: AUTO ANGLE DIST

7. Press **[CALC]** or **[YES]** to automatically start calculations after observations of all known points are completed.
 - Instrument station coordinates, station elevation, and standard deviation, which describes the measurement accuracy, are displayed.
 - These values are displayed automatically after observation is complete when performing auto measurement.

Standard deviation for the northing and easting coordinates of each point are displayed in the Detail tab.

Resection/result	
Result	Detail
Stn North	1234.5680
Stn East	9012.3462
Stn Elev.	789.0129
σ N	0.0071
σ E	0.0038
σ Z	0.0001

Buttons: RE_OBS, REC, OK

Resection/result													
Result	Detail												
	<table border="1"> <thead> <tr> <th></th> <th>σ N</th> <th>σ E</th> <th>σ Z</th> </tr> </thead> <tbody> <tr> <td>1st</td> <td>-0.0004</td> <td>0.0002</td> <td>-0.0001</td> </tr> <tr> <td>2nd</td> <td>0.0009</td> <td>-0.0001</td> <td>0.0001</td> </tr> </tbody> </table>		σ N	σ E	σ Z	1st	-0.0004	0.0002	-0.0001	2nd	0.0009	-0.0001	0.0001
	σ N	σ E	σ Z										
1st	-0.0004	0.0002	-0.0001										
2nd	0.0009	-0.0001	0.0001										

Buttons: BAD, RE_CALC, RE_OBS, OK, P1

8. If there are problems with the results of a point, align the cursor with that point and press **[BAD]**. "BAD" is displayed to the right of the point. Repeat for all results that include problems.


Resection/result													
Result	Detail												
	<table border="1"> <thead> <tr> <th></th> <th>σ N</th> <th>σ E</th> <th>σ Z</th> </tr> </thead> <tbody> <tr> <td>1st</td> <td>-0.0004</td> <td>0.0002</td> <td>-0.0001</td> </tr> <tr> <td>2nd BAD</td> <td>0.0009</td> <td>-0.0001</td> <td>0.0001</td> </tr> </tbody> </table>		σ N	σ E	σ Z	1st	-0.0004	0.0002	-0.0001	2nd BAD	0.0009	-0.0001	0.0001
	σ N	σ E	σ Z										
1st	-0.0004	0.0002	-0.0001										
2nd BAD	0.0009	-0.0001	0.0001										

Buttons: BAD, RE_CALC, RE_OBS, OK, P1


9. Press **[RE CALC]** to perform calculation again without the point designated in step 8. The result is displayed.
 - If there are no problems with the result, go to step 10.
 - If problems with the result occur again, perform the resection measurement from step 3.

17. RESECTION MEASUREMENT

- Press **[RE OBS]** to measure the point designated in step 8.
If no points are designated in step 8, all the points or only the final point can be observed again.
- Auto measurement is possible from the 1st point when performing re-observation.
- Press **[ADD]** when there is a known point that has not been measured or when a new known point is added.

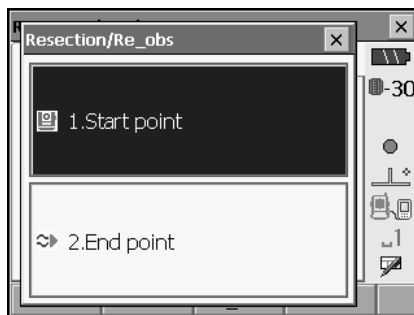

10. Press **[OK]** in <Resection/result> to display <Resection/Set h angle>.
11. Select an angle mode and press **[YES]** to set the azimuth angle of the first known point as the backsight point and return to <Resection/Menu>.
12. Press **[NO]** to return to <Resection/Menu> without setting the azimuth angle.

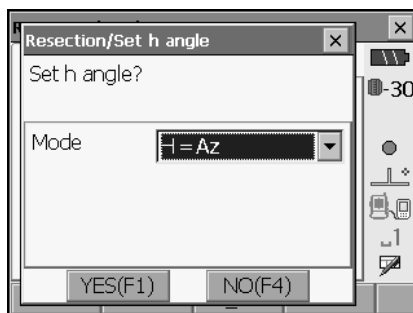

Horizontal angle settings

H=Az (set horizontal angle to the same value as azimuth angle)/Az (set azimuth angle only)/H (set horizontal angle to measured value)



- It is also possible to perform resection measurement by pressing **[RESEC]** when allocated to the Meas mode screen.
-  Allocating **[RESEC]**: "30.6 Allocating Key Functions"


17.2 Height Resection Measurement

Only Z (height) of an instrument station is determined by the measurement.


- Known points must be measured by distance measurement only.
- Between 1 and 10 known points can be measured.

PROCEDURE


1. Select "Resection" in the "SURV" tab of <Menu>.

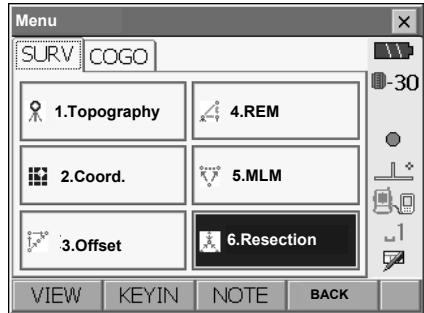

2. Select "Elevation" to display <Resection/Known point>.

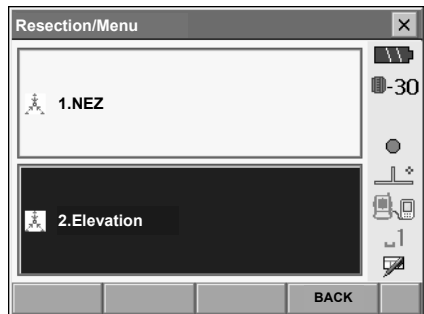

3. Input the known point.
After setting the elevation and target height for the first known point press **[NEXT]** to move to the second point.
 - Press **[READ]** to read in data registered in Memory mode.
 - Press **[PREV]** to return to settings for the previous point.
 - When reading in known point data in the current JOB, press **[REC]** on the second page.
 When all required known points have been set, press **[OK]**.

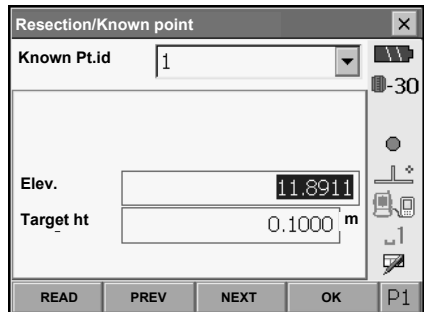

17. RESECTION MEASUREMENT

4. Sight the first known point and press **[DIST]** to begin measurement.
The measurement results are displayed on the screen.
5. If measuring two or more known points, repeat procedures 3 to 4 in the same way from the second point.
When the minimum quantity of observation data required for the calculation is present, **[CALC]** is displayed
6. Press **[CALC]** or **[YES]** to automatically start calculations after observations of all known points are completed.
- Instrument station elevation and standard deviation, which describes the measurement accuracy, are displayed in the Result tab.
 - When recording instrument station data in the current JOB, press **[REC]**.

Standard deviation values for each point are displayed in the Detail tab.

Resection/measurement known points

Pt.1	A03-80420
Elev.	11.8911
S	
ZA	89°21'02.0"
HAR	130°37'41.5"

DIST

Resection/result

S	5.3860 m
ZA	91°08'57.2"
HAR	241°59'33.1"
Target ht	0.1000 m

CALC(F1) YES(F3) NO(F4)

Resection/result

Result Detail

Stn Elev.	789.0122
σZ	0.0066

RE_OBS REC OK


Resection/result

Result Detail

	σZ
1...	0.1223
2nd	0.1223

BAD RE_CALC RE_OBS OK P1

7. If there are problems with the results of a point, align the cursor with that point and press **[BAD]**. "BAD" is displayed to the right of the point. Repeat for all results that include problems.

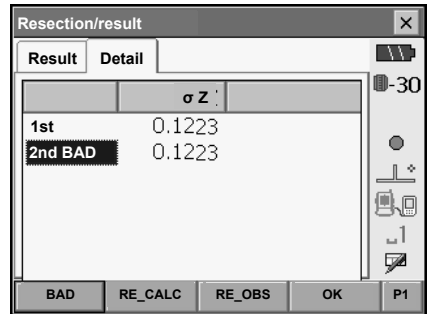

8. Press **[RE CALC]** to perform calculation again without the point designated in step 8. The result is displayed.


If there are no problems with the result, go to step 10.

If problems with the result occur again, perform the resection measurement from step 3.

- Press **[RE OBS]** to measure the point designated in step 8.

If no points are designated in step 8, all the points or only the final point can be observed again.

- Press **[ADD]** when there is a known point that has not been measured or when a new known point is added.

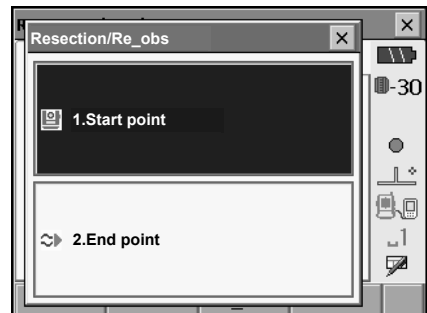


9. Press **[OK]** to finish resection measurement and return to Meas mode. Only Z (elevation) of the instrument station coordinate is set. N and E values are not overwritten.

17. RESECTION MEASUREMENT



Resection calculation process

The NE coordinates are found using angle and distance observation equations, and the instrument station coordinates are found using the method of least squares. The Z coordinate is found by treating the average value as the instrument station coordinates.

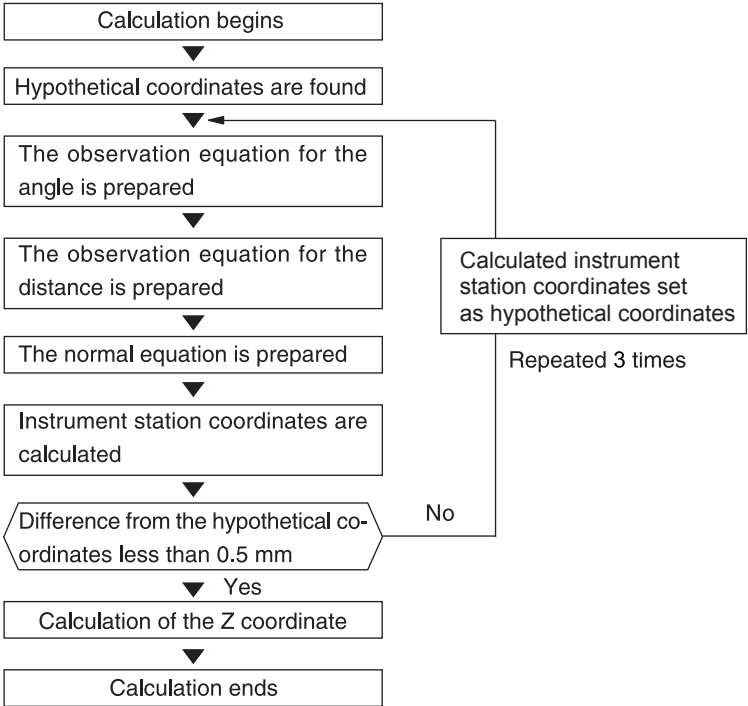




Precaution when performing resection

In some cases it is impossible to calculate the coordinates of an unknown point (instrument station) if the unknown point and three or more known points are arranged on the edge of a single circle.

An arrangement such as that shown below is desirable.




 It is sometimes impossible to perform a correct calculation in a case such as the one below.



When they are on the edge of a single circle, take one of the following measures.

 - (1) Move the instrument station as close as possible to the center of the triangle.
- (2) Observe one more known point which is not on the circle.
- (3) Perform a distance measurement on at least one of the three points.



- In some cases it is impossible to calculate the coordinates of the instrument station if the included angle between the known points is too small. It is difficult to imagine that the longer the distance between the instrument station and the known points, the narrower the included angle between the known points. Be careful because the points can easily be aligned on the edge of a single circle.

18.SETTING-OUT MEASUREMENT

Setting-out measurement is used to set out the required point.

The difference between the previously input data to the instrument (the setting-out data) and the measured value can be displayed by measuring the horizontal angle, distance or coordinates of the sighted point.

The horizontal angle difference distance difference, and coordinate difference are calculated and displayed using the following formulae.

Horizontal difference

Displayed value (angle) = Horizontal angle of setting-out data - measured horizontal angle

Displayed value (distance) = measured horizontal distance x tan (horizontal angle of setting out data - measured horizontal angle)

Slope distance difference

Displayed value (slope distance) * = measured slope distance - slope distance setting-out data

* Horizontal distance or height difference can be input in the above formula.

Coordinate difference

Displayed value (coordinates)* measured N setting-out coordinates - N coordinates of setting-out data

* E or Z coordinates can be input in the above formula

Height difference (REM setting out measurement)


Displayed value (height) = measured REM data - REM data of setting out data

- Setting out data can be input in various modes: slope distance, horizontal distance, height difference, coordinates and REM measurement.
- It is possible to allocate softkeys in the Setting-out measurement menu to suit various applications and the ways that different operators handle the instrument.

☞ "30.6 Allocating Key Functions"


18.1 Distance Setting-out Measurement

The point is to be found based on the horizontal angle from the reference direction and the distance from the instrument station.

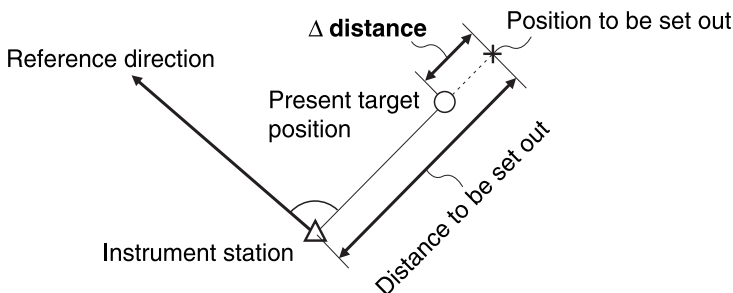

PROCEDURE


1. Select "Setting out" in the "COGO" tab of <Menu> to display <Setting out>.

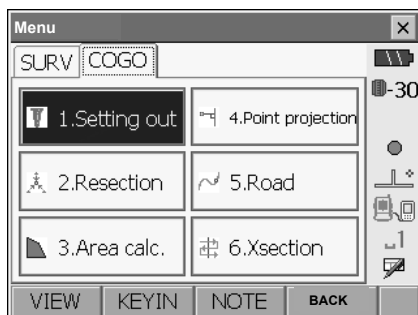

2. Select "Station setup" to display <Station setup>. Enter data for the instrument station and press **[OK]** to move to Backsight setup.
 ↳ "15.1 Entering Instrument Station Data"

- Press **[READ]** to read in coordinate data registered in Memory mode.

3. Set the azimuth angle for the backsight station. Press **[OK]** to return to <Setting out>.
 ↳ "15.2 Azimuth Angle Setting"

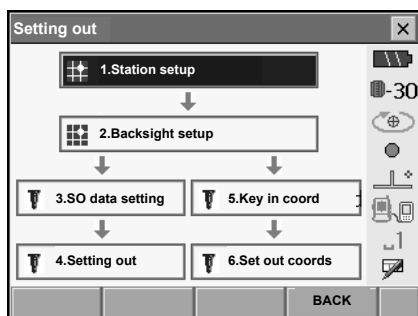

Reference Direction




Instrument station

18. SETTING-OUT MEASUREMENT

4. Select "SO data setting" In <Setting out> to display <SO data setting>. In the distance mode that conforms to your measurement requirements, enter the included angle between the reference point and the setting-out point in "SO.H.ang", and the distance (slope distance, horizontal distance or height difference) from the instrument station to the position to be set out in "SO.Sdist".

- Each time **[/Shvr]** is pressed, the distance mode changes from "S" (slope distance), "H" (horizontal distance), "V" (height difference), and "Ht." (REM).
- When **[READ]** is pressed, coordinates registered in Memory mode can be recalled and used. The distance selected according to the selected distance input mode is calculated using these coordinate values.
- Press **[COORD]** in the second page and input coordinates in <Key in coord>. The angle and distance from these coordinates to the position to be set out will be calculated.
- When recording known point data in the current JOB, press **[REC]** in <Key in coord>. Enter known point coordinates, point number, and code, then press **[OK]**.

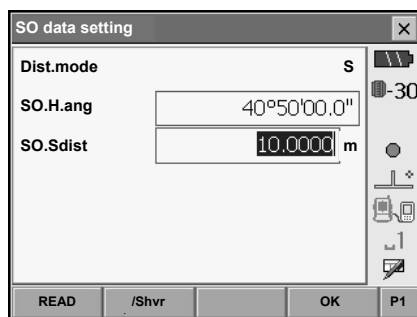

SO data setting


Dist.mode S

SO.H.ang 40°50'00.0"

SO.Sdist 10.0000 m

READ /Shvr OK P1

The screen shows the 'SO data setting' window. It has a title bar with a close button. The main area contains three input fields: 'Dist.mode' with a dropdown set to 'S', 'SO.H.ang' with the value '40°50'00.0"', and 'SO.Sdist' with the value '10.0000 m'. On the right side, there is a vertical toolbar with icons for back, forward, and other functions. At the bottom, there are four buttons: 'READ', '/Shvr', 'OK', and 'P1'.

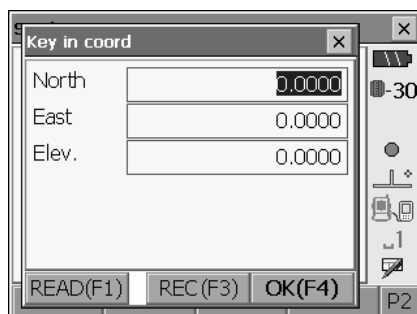

Key in coord


North 0.0000

East 0.0000

Elev. 0.0000

READ(F1) REC(F3) OK(F4) P2

This is the first page of the 'Key in coord' screen. It has a title bar with a close button. The main area contains three input fields: 'North' with the value '0.0000', 'East' with the value '0.0000', and 'Elev.' with the value '0.0000'. On the right side, there is a vertical toolbar with icons for back, forward, and other functions. At the bottom, there are three buttons: 'READ(F1)', 'REC(F3)', and 'OK(F4)', followed by a page indicator 'P2'.

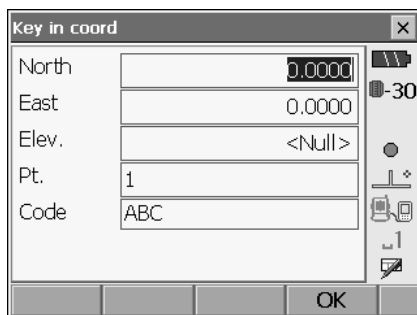

Key in coord

North 0.0000

East 0.0000

Elev. <Null>

Pt. 1



Code ABC

OK

This is the second page of the 'Key in coord' screen. It has a title bar with a close button. The main area contains five input fields: 'North' with the value '0.0000', 'East' with the value '0.0000', 'Elev.' with the value '<Null>', 'Pt.' with the value '1', and 'Code' with the value 'ABC'. On the right side, there is a vertical toolbar with icons for back, forward, and other functions. At the bottom, there is a single 'OK' button.



5. Enter values and press **[OK]** to display the screen at right.

Press **[H.ROTA]** to automatically rotate the MS until the difference in horizontal angle to the setting out point reads 0°.

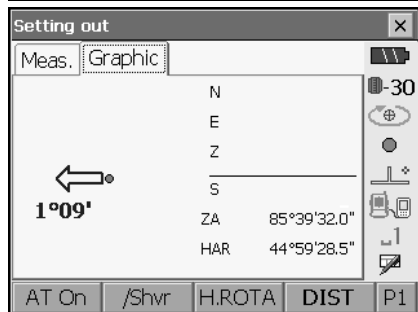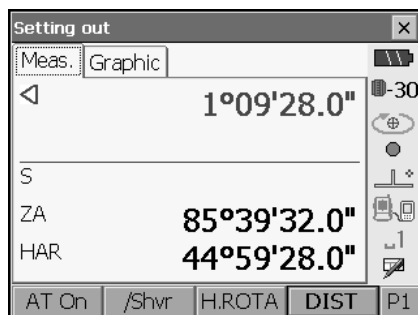

Arrows indicate direction to move

6. Position the target on the line of sight and press **[DIST]** to begin distance measurement. The distance and direction to move the target until the setting out point is located is displayed on the MS. The sighting point measurement results (currently installed position of the target) are displayed.

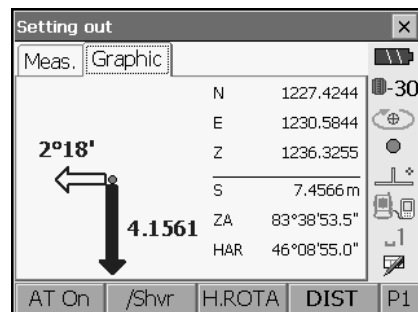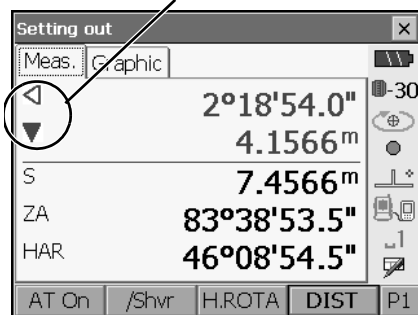

18. SETTING-OUT MEASUREMENT

- Movement indicator (Red indicates that target position is correct)
Arrows indicating horizontal direction will point in the opposite direction when viewing the display in Face 2.
- ◁ : (Viewed from MS) Move target to the left
- ▷ : (Viewed from MS) Move target to the right
- ◁▷: Target position is correct
- ▼ : (Viewed from MS) Move target closer
- ▲ : (Viewed from MS) Move target away
- ▲▼: (Viewed from MS) Target position is correct
- ▲ : Move target upward
- ▼ : Move target downward
- ▲▼: Target position is correct
- Each time **[/Shvr]** is pressed, the distance input mode changes from "H" (horizontal distance), "V" (height difference), "R" (slope distance), and "S" (slope distance).
- Press **[CNFG]** to set setting out accuracy. When the position of the target is within this range both arrows will be displayed to indicate that the target position is correct.

7. Move the target until the distance to the setting-out point reads 0m. When the target is moved within the allowed range, all distance and position arrows are displayed.


Setting out

Meas.		Battery: -30
◁▷	0°00'00.0"	
▲▼	0.0000 m	
S	7.4566 m	
ZA	83°38'53.5"	
HAR	43°50'00.0"	
CNFG	/Shvr	REC DIST P1

REC coord.

North	12.3771	Battery: -30
East	101.9443	
Elev.	123.0334	
Pt.	2	
Target ht	0.0000 m	
Code	ABC	
		OK


- When recording data in the current JOB, press **[REC]**. Enter point number, target height and code, then press **[OK]**.

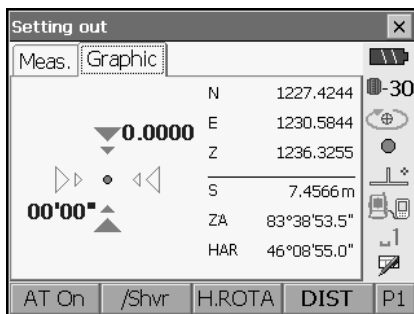

8. Press **{ESC}** to return to <Setting out>. Set the next setting out point to continue setting out measurement.

18.2 Coordinates Setting-out Measurement


After setting the coordinates for the point to be set out, the MS calculates the setting-out horizontal angle and horizontal distance. By selecting the horizontal angle and then the horizontal distance setting-out functions, the required coordinate location can be set out.

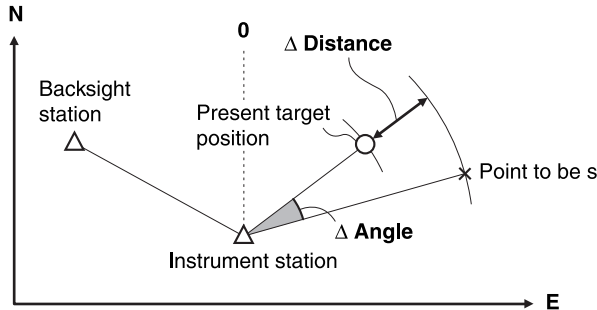

- Previously recorded setting-out points can be placed in order. Up to 30 points can be recorded.
- To find the Z coordinate, attach the target to a pole etc. with the same target height.

PROCEDURE

1. Select "Setting out" in <Menu> to display <Setting out>.
2. Select "Station setup" to display <Height setting>. If necessary, enter data for Backsight setup.
☞ "18.1 Distance Setting-out Measurement" steps 2 to 3

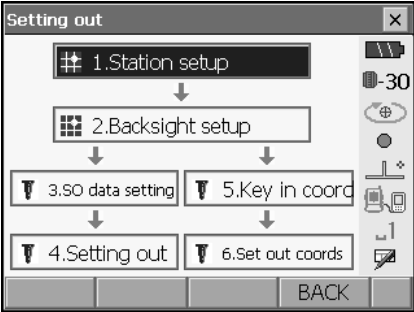

3. Select "Key in coord" in <Setting out>. Record all the setting-out points (includes setting-out points you will measure from now). Press **[READ]** to display recorded angle data or press **[ADD]** to record new data.
- "23.1 Instrument Station Settings"

- Press **[DEL]** in the second page to delete the selected setting out point.
- Press **[DELALL]** in the second page to delete all setting out points.

Key in coord

Pt.id Graphic

Pt. 01

N	1245.817.5
E	1233.844.5
Z	1234.512.5
S	11.8599m
ZA	94°46'44.5"
HAR	197°56'21.0"

READ ADD OK P1

Key in coord

Pt.id 1

North 1245.8177

East 1233.8444

Elev. 1234.5122

READ(F1) OK(F4) P1

4. Select a setting-out point in the first screen of step 3 and press **[OK]** to display <Set out Coords>. Press **[H.ROTAL]** to automatically rotate the MS until the angle of the setting out point reads 0°.

18. SETTING-OUT MEASUREMENT

- Position the target on the line of sight and press **[DIST]** to begin distance measurement. The distance and direction from the target to the setting out point is displayed on the MS. The sighting point measurement results (currently installed position of the target) are displayed.

- Switch between the tabs to display different sets of information.

The Graph 1 tab shows the current position of the mirror and the direction to the setting out point from this position.


The Graph 2 tab shows the position of the setting out point (square) and the current location of the mirror (circle).

Height difference direction

Position of poleman

Move the target to find the correct distance (0 is displayed) to the setting out point.

- Movement indicators: "18.1 Distance Setting-out Measurement" step 5

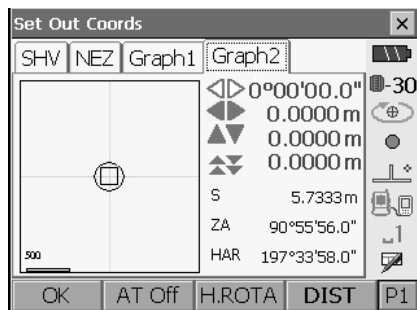

6. Press **{ESC}** to return to <Key in coord>. Set the next setting out point to continue setting out measurement.


18.3 REM Setting-out Measurement

To find a point where a target cannot be directly installed, perform REM setting-out measurement.

"14.4 REM Measurement"


PROCEDURE

1. Install a target directly below or directly above the point to be found. Then use a measuring tape etc. to measure the target height (height from the survey point to the target).
2. Select "Station setup" in <Setting out> to display <Station setup>. If necessary, enter data for Backsight setup.
 "18.1 Distance Setting-out Measurement" steps 2 to 3
3. Select "SO data setting" In <Setting out> to display <SO data setting>. Press **[/Shvr]** until the distance input mode is "Ht.". Input height from the survey point to the position to be set out in "SO.Height". If necessary, input the angle to the point to be set out.

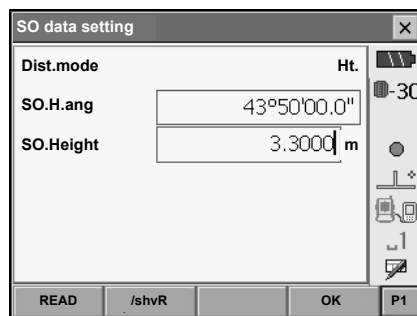


18. SETTING-OUT MEASUREMENT

- Enter values and press **[OK]** in step 3 to display the screen at right.
Press **[H.ROTA]** to automatically rotate the MS toward the horizontal angle set in step 3 and set the angle to the setting out point to 0°.

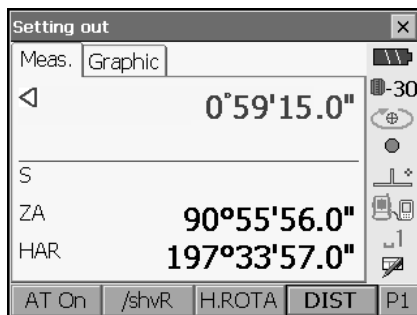

- Sight the target and press **[DIST]**. Measurement begins and the measurement results are displayed.

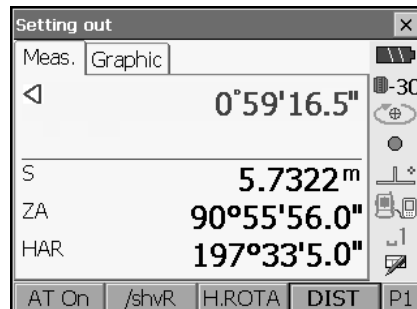


Arrows indicate direction to move

- Press **[REM]** in the second page to start REM measurement.
The distance (height difference) and direction to move the target until the sighting point and setting out point are located is displayed on the MS.

Press **[STOP]** to stop measuring.

Find the setting-out point by moving the telescope until the distance to the setting-out point reads 0m.

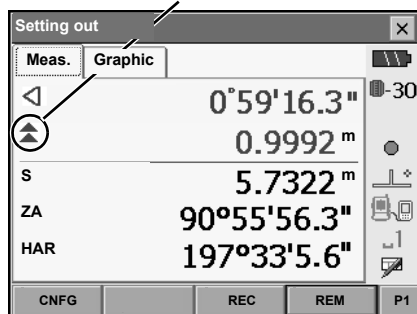


- Movement indicator (Red indicates that target position is correct)

▲ : Move the telescope near the zenith


▼ : Move the telescope near the nadir

▲▲ : Telescope direction is correct

☞ For details of other movement indicators:
"18.1 Distance Setting-out Measurement"
step 5

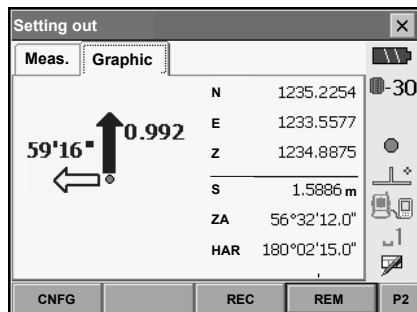

- When recording data in the current JOB, press **[REC]**. Enter point number, target height and code, then press **[OK]**.

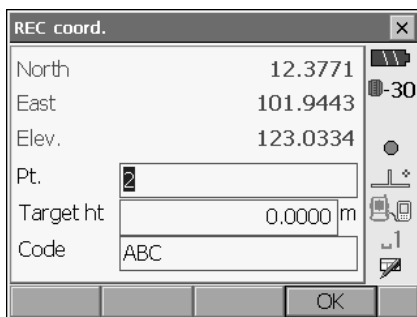


REC coord.

North	12.3771
East	101.9443
Elev.	123.0334
Pt.	2
Target ht	0.0000 m
Code	ABC

OK

- Press **[CNFG]** to set setting out accuracy. When the position of the target is within this range both arrows will be displayed to indicate that the target position is correct.

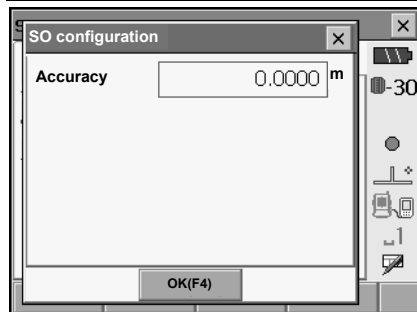

SO configuration


Accuracy	0.0000 m
----------	---------------------------------------

OK(F4)

- Press **{ESC}** to return to <SO data setting>.

19.POINT PROJECTION

Point projection is used for projecting a point onto the baseline. The point to project can be either measured or input. Displays the distances from the first point and point to project to the position at which a line extending from point to project intersects the baseline at right angles.

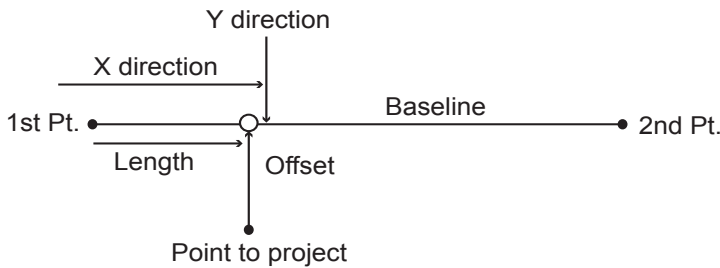

19.1 Defining Baseline

To perform point projection, first, define the baseline. The baseline can be defined by inputting the coordinates of the two points. The scale factor value is the difference between the input coordinates and the observed coordinates.

Scale (X, Y) = $\frac{\text{Hdist}'}{\text{Hdist}}$ (horizontal distance calculated from the measured value)
Hdist (horizontal distance calculated from the input coordinates)


- When not observing first or second points, scale factor is set to “1”.

►PROCEDURE

1. Select COGO tab.
2. Select "Point Projection" in the "COGO" tab of <Menu>.



3. Select "Define baseline" in <Point projection>.

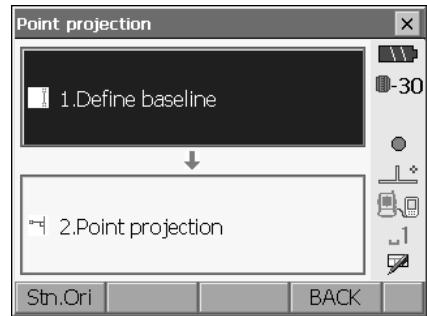


4. Press **[Stn.Ori]** and enter the instrument station data.
 ➡ "16.1 Entering Instrument Station Data"

5. Select "Define baseline" in <Point projection>.

6. Enter the first point data and the second point data.


- When **[READ]** on the first page is pressed, registered coordinates can be recalled and used.

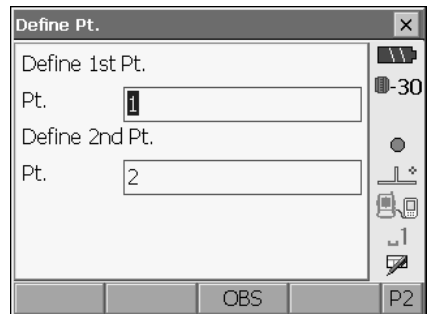

7. Sight the first point and press **[OBS]** on the second softkey page of the screen of step 5.


- When not observing the first point and the second point, press **[OK]** and go to step 12.

8. Press **[DIST]** to start measurement.

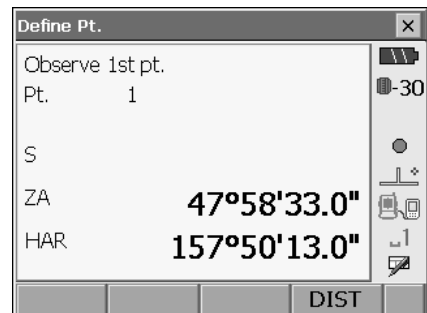


19. POINT PROJECTION


9. Press **[YES]** to use the measurement results of the first point.
- Press **[NO]** to observe the first point again.

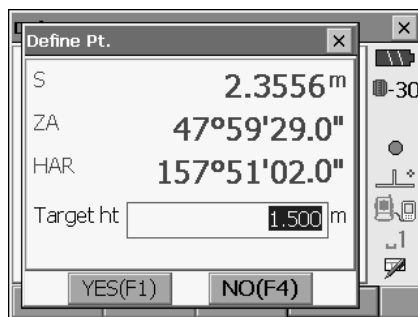

10. Sight the second point and press **[DIST]**.
11. Press **[YES]** to use the measurement results of the second point.

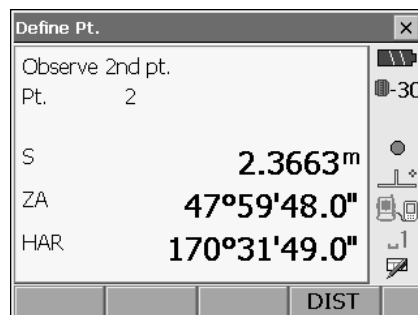

The distance between the two measured points, the distance calculated from inputting the coordinates of two points and the scale factors are displayed.

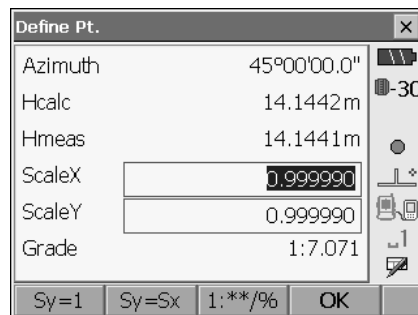

12. Press **[OK]** on the second screen of step 10 to define the baseline. Move to reference point setting.
-  "19.2 Point Projection"


- Press **[Sy=1]** to set scale factor y to "1".
- Press **[1 : **/%]** to switch the grade display mode between "1 : ** = elevation :horizontal distance" and %.

19.2 Point Projection


Before performing point projection, the baseline must be defined.

►PROCEDURE


1. Define the baseline.
 "19.1 Defining Baseline"
2. Select "Point projection" in <Point projection>.

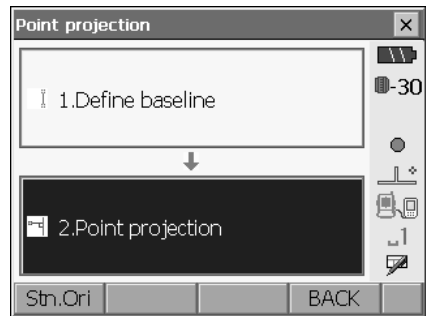

3. Input the point number of reference point.
 - Press **[OBS]** to observe the point to project.

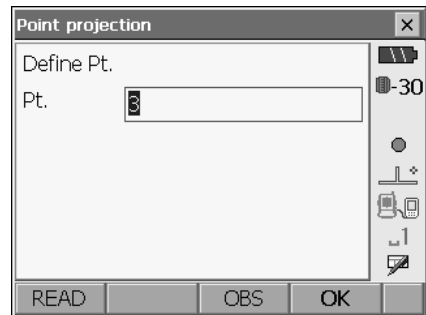

4. Press **[OK]** on the screen of step 3.
 The following items are calculated and displayed.
 - Length: Distance along the baseline from the first point to the projected point (X direction).
 - Offset: Distance from point to project to the position at which a line extending from point of project intersects the baseline at right angles. (Y direction).
 - D.Elev: Elevation between the baseline and the projected point.

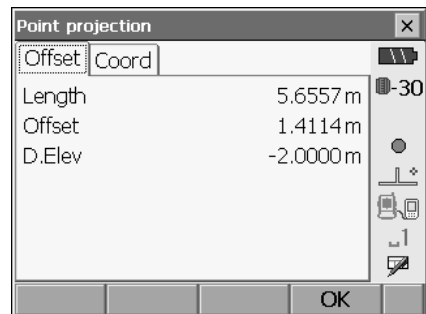

19. POINT PROJECTION

On the Coord tab, the coordinate values are displayed.


- **[REC]**: records the coordinate values as known point data.

 Recording method: "25.1 Registering Known Point Data"

- Press **[S-O]** to move to setting-out measurement of the projected point.

 "18. SETTING-OUT MEASUREMENT"

5. Press **[OK]**.

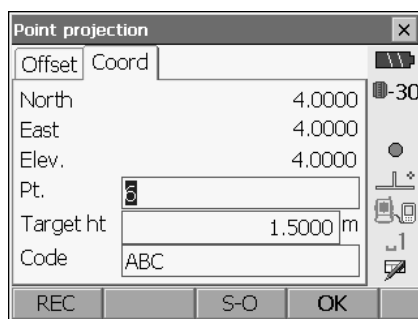

The image shows a 'Point projection' dialog box with a close button (X) in the top right corner. It has two tabs: 'Offset' and 'Coord', with 'Coord' currently selected. The dialog contains the following fields and values:

Field	Value
North	4.0000
East	4.0000
Elev.	4.0000
Pt.	5
Target ht	1.5000 m
Code	ABC

At the bottom, there are four buttons: 'REC', 'S-O', 'OK', and a fourth button with a small icon. On the right side of the dialog, there are several icons: a battery level indicator showing '30', a point cloud icon, a target icon, a printer icon, and a speech bubble icon.

20. OFFSET MEASUREMENT

Offset measurements are performed in order to find a point where a target cannot be installed directly or to find the distance and angle to a point which cannot be sighted.

- It is possible to find the distance and angle to a point you wish to measure (target point) by installing the target at a location (offset point) a little distance from the target point and measuring the distance and angle from the survey point to the offset point.
- The target point can be found in the three ways explained in this chapter.
- The instrument station and backsight must be set before the coordinates of an offset point can be found. Station and backsight setup can be performed in the Offset menu.


☞ Station setup: "16.1 Entering Instrument Station Data", Backsight setup: "16.2 Azimuth Angle Setting" .

- It is possible to allocate softkeys in measurement menus to suit various applications and the ways that different operators handle the instrument.

☞ "30.6 Allocating Key Functions"

20.1 Single-distance Offset Measurement

Finding it by entering the horizontal distance from the target point to the offset point.

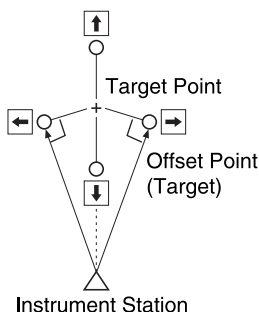

- When the offset point is positioned to the left or right of the target point, make sure the angle formed by lines connecting the offset point to the target point and to the instrument station is almost 90° .
- When the offset point is positioned in front of or behind the target point, install the offset point on a line linking the instrument station with the target point.

PROCEDURE

1. Set the offset point close to the target point and measure the distance between them, then set up a prism on the offset point.

20. OFFSET MEASUREMENT

2. Select "Offset" in the "SURV" tab of <Menu> to display <Offset>.

3. Select "Dist. offset".

Input the following items.

- (1) Direction of the offset point.
- (2) Horizontal distance from the target point to the offset point.

- Direction of offset point

- ← : On the left of the target point.
- : On the right of the target point.
- ↓ : Closer than the target point.
- ↑ : Beyond the target point.

4. Sight the offset point and press **[DIST]** in the screen of step 3 to start measurement. Press **[STOP]** to stop the measurement. The measurement results are displayed.

- Press **[HVD/nez]** to switch results for the target point between distance/angle values and coordinate/elevation values.

The image shows four screenshots of a surveying instrument's interface:

- Menu Screen:** The "SURV" tab is selected. The "3.Offset" option is highlighted. Other options include 1.Topography, 2.Coord., 4.REM, 5.MLM, and 6.Resection. Buttons at the bottom are VIEW, KEYIN, NOTE, and BACK.
- Offset Screen:** A flowchart shows the sequence: 1.Station setup → 2.Back sight setup → 3.Dist. offset (highlighted) and 4.Angle offset. A sub-option 5.2 Dist. offset is also shown. A BACK button is at the bottom right.
- Single-distance offset Screen (Initial):** Fields for S, ZA, and HAR are set to <Null>. The Direction is set to >. The Offset dist. is 2.0000 m. Buttons at the bottom are OK, HVD/nez, and DIST.
- Single-distance offset Screen (Results):** The same fields now show measurement results: S = 5.734 m, ZA = 90°11'21.3", HAR = 140°51'37.3". The Offset dist. remains 2.0000 m. Buttons at the bottom are OK, REC, HVD/nez, and DIST.

- When recording data in the current JOB, press **[REC]**. Enter point number, target height and code, then press **[OK]**.

The image shows a handheld device screen titled "REC measurement". It contains several data entry fields and a status bar on the right. The fields are as follows:


Field	Value
S	5.2900 m
ZA	73°06'25.5"
HAR	297°57'28.5"
Pt.	2
Target ht	0.0000 m
Code	ABC

On the right side of the screen, there is a vertical status bar with the following elements from top to bottom: a battery level icon, a signal strength icon, the number "30", a small circular icon, a plus sign icon, a printer icon, a magnifying glass icon, and the number "1". At the bottom of the screen, there is a navigation bar with an "OK" button.

5. Press **[OK]** in the second screen in step 4 to return to <Offset>.

20.2 Angle Offset Measurement

Sighting the direction of the target point to find it from the included angle.
Install offset points for the target point on the right and left sides of and as close as possible to the target point and measure the distance to the offset points and the horizontal angle of the target point.

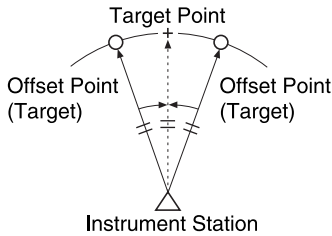


PROCEDURE

- 1. Set the offset points close to the target point (making sure the distance from the instrument station to the target point and the height of the offset points and the target point are the same), then use the offset points as the target.
- 2. Select "Offset" in the "SURV" tab of <Menu> to display <Offset>.

Select "Angle offset".

- 3. Sight the offset point and press [DIST] to start measurement.
Press [STOP] to stop the measurement.

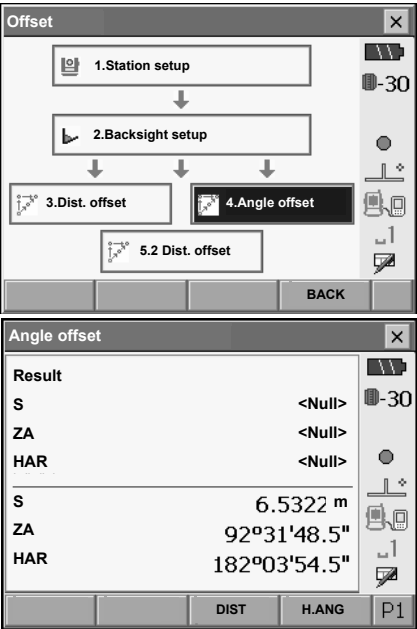

4. Sight the target point and press **[H.ANG]**.
 - Press **[HVD/nez]** on the second page to switch results for the target point between distance/angle values and coordinate/elevation values.
 - When recording data in the current JOB, press **[REC]**. Enter point number, target height and code, then press **[OK]**.

Results for offset point

Angle offset		X	
Result		30	
S	6.5322 m		
ZA	92°31'47.0"		
HAR	182°03'56.0"		
S	6.5322 m		
ZA	92°31'47.5"		
HAR	182°03'56.5"		
		1	
		P1	
		OK REC DIST H.ANG P1	

Results for target point

5. Press **[OK]** in the screen in step 4 to return to <Offset>.


20.3 Two-distance Offset Measurement

By measuring the distances between the target point and the two offset points.


Install two offset points (1st target and 2nd target) on a straight line from the target point, observe the 1st target and 2nd target, then enter the distance between the 2nd target and the target point to find the target point.

- It is possible to make this measurement easily using the optional equipment: the 2-point target (2RT310A). When using this 2-point target, be sure to set prism constant to 0.

 "34. TARGET SYSTEM"

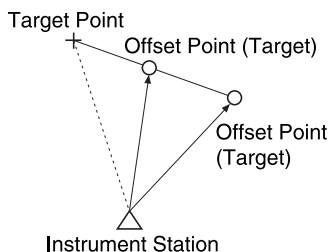

How to use 2-point target (2RT310A)

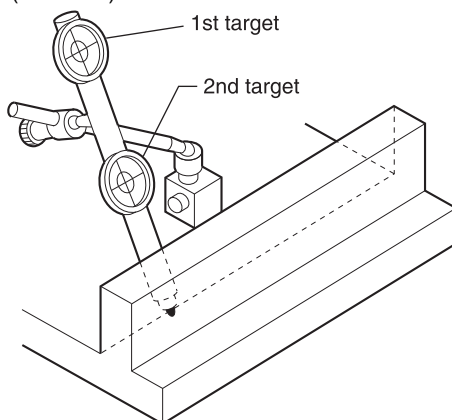

- Install the 2-point target with its tip at the target point.
- Face the targets toward the instrument.
- Measure the distance from the target point to the 2nd target.
- Set the prism constant to 0mm.

PROCEDURE




1. Install two offset points (1st target, 2nd target) on a straight line from the target point and use the offset points as the target.
2. Select "Offset" in the "SURV" tab of <Menu> to display <Offset>.

Select "2 Dist. offset".

3. Press **[CNFG]** and input the distance from the 2nd target to the target point in "Offset dist.". Set reflector settings and press **[OK]** to confirm.


- Press **[LIST]** to edit the prism constant and aperture in <Reflector setting>.

4. Sight the 1st target and press **[DIST]** to start measurement.
Press **[STOP]** to stop the measurement. The measurement results are displayed. Press **[YES]** to confirm.

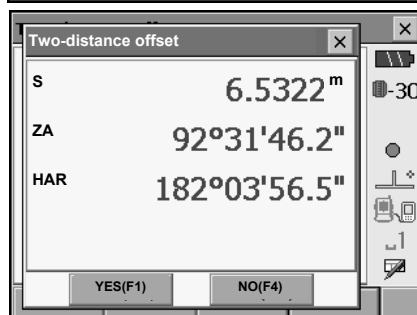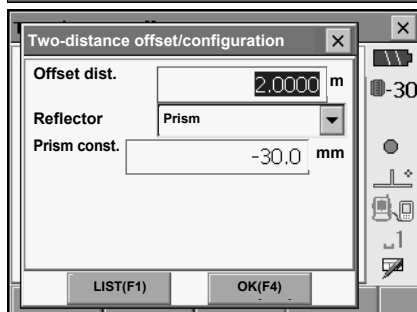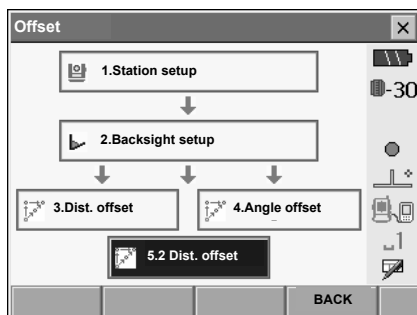


20. OFFSET MEASUREMENT

5. Sight the 2nd target and press **[DIST]** to start measurement.
Press **[STOP]** to stop the measurement. The measurement results are displayed.

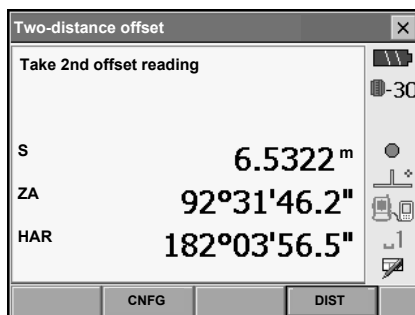

6. Press **[YES]** to display results for the target point.


- Press **[HVD/nez]** to switch results for the target point between distance/angle values and coordinate/elevation values.
- When recording data in the current JOB, press **[REC]**. Enter point number, target height and code, then press **[OK]**.

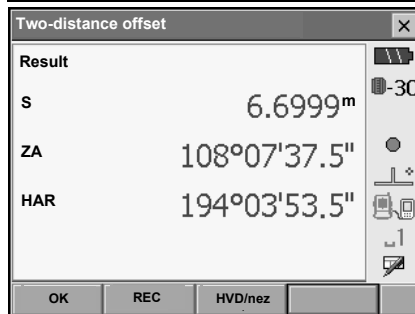

21. MISSING LINE MEASUREMENT

Missing line measurement is used to measure the slope distance, horizontal distance, and horizontal angle to a target from the target which is the reference (starting point) without moving the instrument.

- It is possible to change the last measured point to the next starting position.
- Measurement results can be displayed as the gradient between two points.

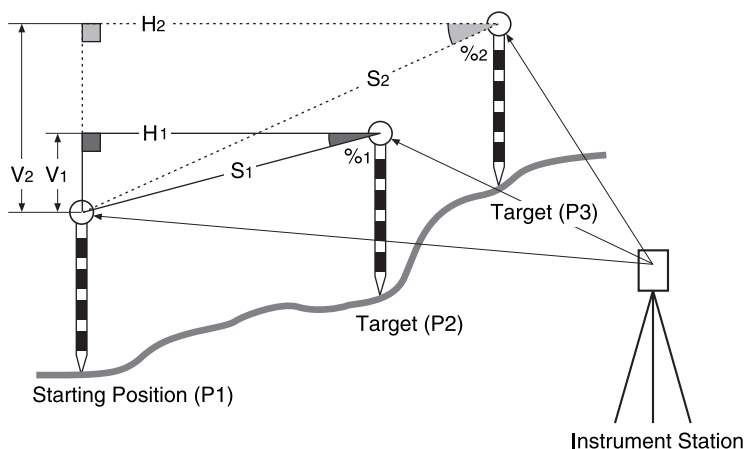


- It is possible to allocate softkeys in measurement menus to suit various applications and the ways that different operators handle the instrument.

☞ "30.6 Allocating Key Functions"

21.1 Measuring the Distance between 2 or more Points

PROCEDURE

1. Select "MLM" in the "SURV" tab of <Menu>.


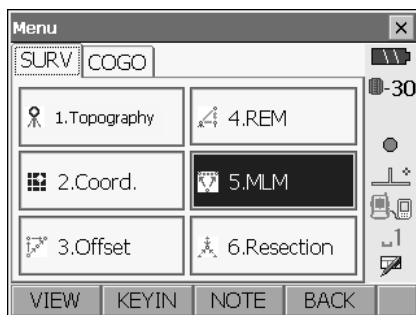


21. MISSING LINE MEASUREMENT

2. Sight the starting position, and press **[DIST]** to start measurement.




- When measurement data already exists the screen of step 3 is displayed and measurement starts.

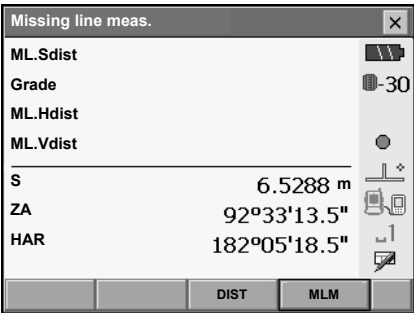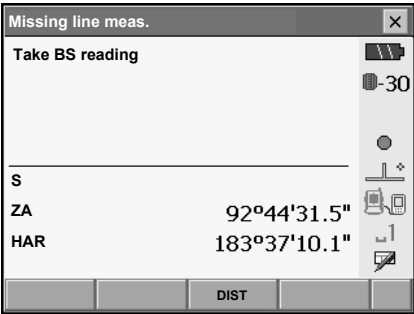

3. Sight the next target and press **[MLM]** to begin observation. Slope distance, Grade, horizontal distance and height difference between multiple points and the starting position can be measured this way.

- Press **[DIST]** to re-observe the starting position. Sight the starting position and press **[DIST]**.
- When **[MOVE]** is pressed, the last target measured becomes the new starting position to perform missing line measurement of the next target.

Results for measurement between starting position and second target

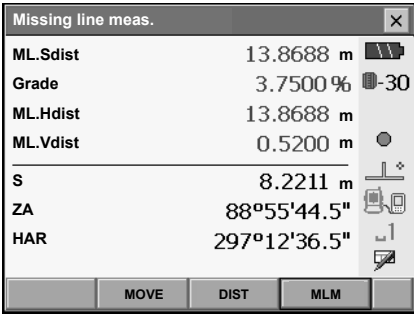


Results for current point

"21.2 Changing the Starting Point"

4. Press **{ESC}** or tap the cross in the top-right corner to end missing line measurement.

21.2 Changing the Starting Point

It is possible to change the last measured point to the next starting position.

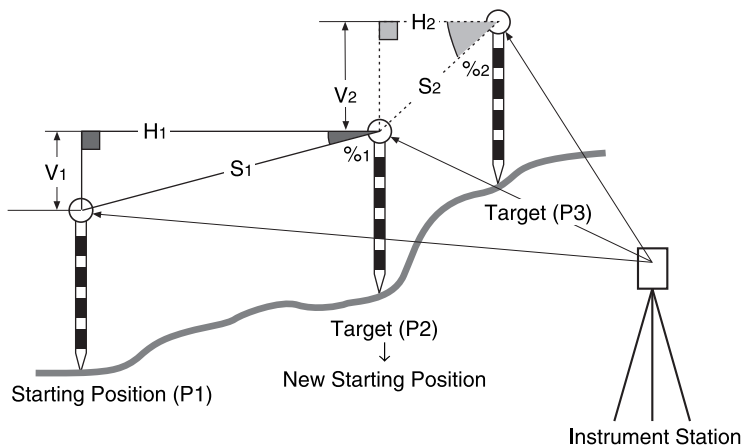

PROCEDURE


- 1. Observe the starting position and target following steps 1 to 3 in "21.1 Measuring the Distance between 2 or more Points".
- 2. After measuring the targets, press **[MOVE]**.

Missing line meas.	
ML.Sdist	13.8688 m
Grade	3.7500 %
ML.Hdist	13.8688 m
ML.Vdist	0.5200 m
S	8.2211 m
ZA	88°55'44.5"
HAR	297°12'36.5"
[MOVE] [DIST] [MLM]	

21. MISSING LINE MEASUREMENT

Press **[YES]** in the confirmation message window.

- Press **[NO]** to cancel measurement.

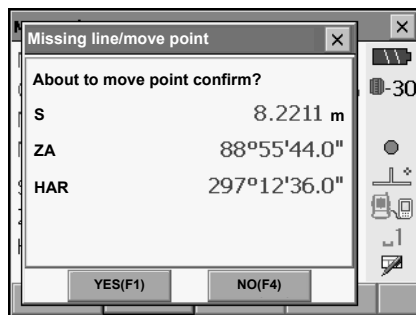

3. The last target measured is changed to the new starting position.
4. Perform missing line measurement following steps 3 to 4 in "21.1 Measuring the Distance between 2 or more Points".

22. SURFACE AREA CALCULATION

You can calculate the area of land (slope area and horizontal area) enclosed by three or more known points on a line by inputting the coordinates of the points

Input


Coordinates: P1 (N1, E1, Z1)

...

P5 (N5, E5, Z5)

Output

Surface area: S (horizontal area and slope area)

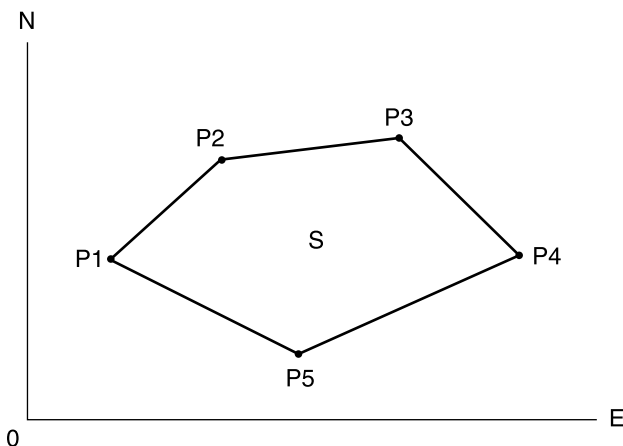

- Number of specified coordinate points: 3 or more, 30 or less
- Surface area is calculated by observing in order the points on a line enclosing an area or by reading in the previously registered coordinates and using it as known point data.
- It is possible to allocate softkeys in measurement menus to suit various applications and the ways that different operators handle the instrument.

 "30.6 Allocating Key Functions"



- An error will occur if only two points (or less) are entered (or recalled) when specifying an enclosed area.
- Be sure to observe (or recall) points on an enclosed area in a clockwise or counterclockwise direction. For example, the area specified by entering (or recalling) point numbers 1, 2, 3, 4, 5 or 5, 4, 3, 2, 1 implies the same shape. However, if points are not entered in numerical order, the surface area will not be calculated correctly.




Slope area


The first three points specified (measured/read-in) are used to create the surface of the slope area. Subsequent points are projected vertically onto this surface and the slope area calculated.

PROCEDURE Surface area calculation by measuring points


1. Select "Area calc." in the "COGO" tab of <Menu>.

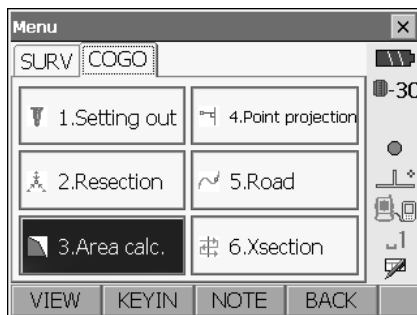



- When **[READ]** is pressed, registered coordinates can be recalled and used in subsequent measurements.
- [F]** "PROCEDURE Surface area calculation using registered coordinate data"

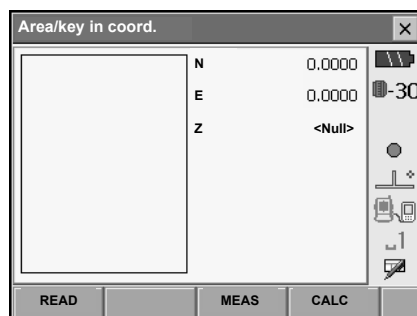


2. Press **[MEAS]** to display <Area calculation/measurement>. Sight the first point on the line enclosing the area, and press **[DIST]**. Measurement begins and the measured values are displayed. Press **[STOP]** to stop measuring.

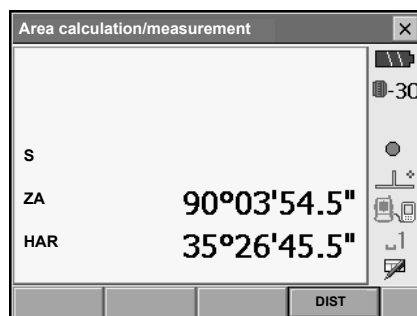

- The measurement results are displayed. Press **[YES]** to confirm. The value of point 1 is set in "01".

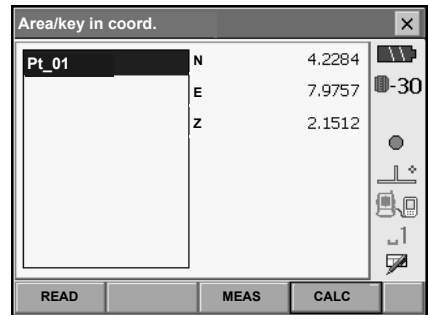
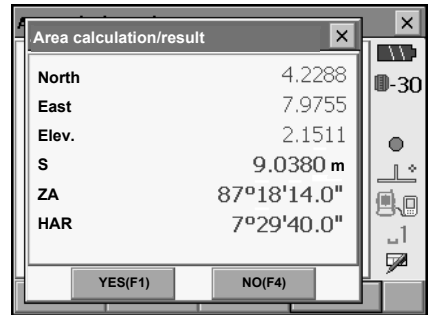


- Repeat steps 2 to 3 until all points have been measured. Points on an enclosed area are observed in a clockwise or counterclockwise direction. For example, the area specified by entering point numbers 1, 2, 3, 4, 5 or 5, 4, 3, 2, 1 implies the same shape.

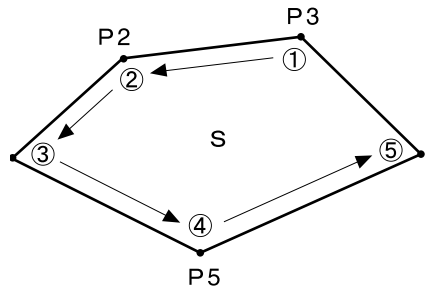

22. SURFACE AREA CALCULATION

5. Press [CALC] to display the calculated area.

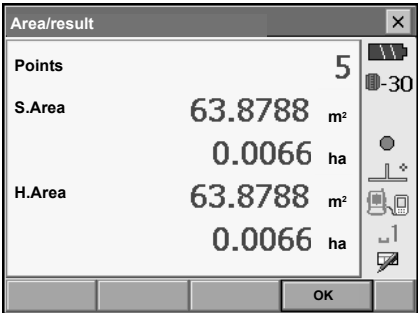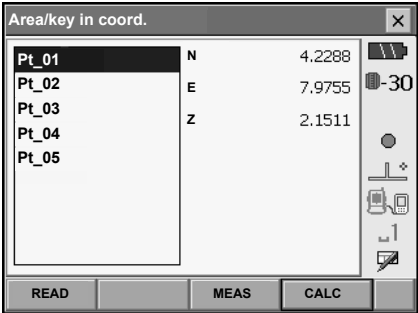


6. Press [OK] to return to <Area/key in coord.>. Press {ESC} or tap the cross in the top-right corner to quit area calculation.

PROCEDURE Surface area calculation using registered coordinate data

Coordinate data registered in Memory mode can be recalled and used for area calculations.

- 1. Select "Area calc." in the "COGO" tab of <Menu>.
- 2. Press [READ] to read in registered coordinate.

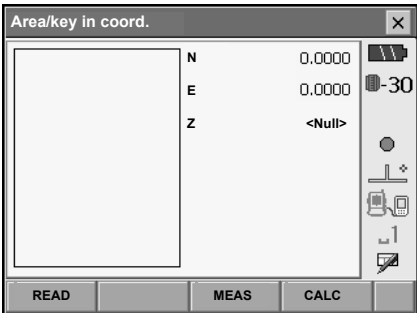


- Register the first point in the list and press **[OK]**.


 Reading in coordinate data from Menu mode: "16.4 Reading in Registered Coordinate Data"

- Read in coordinates of point 2 and onward
Repeat steps 2 to 3 until all points have been read in.
Points on an enclosed area are read in a clockwise or counterclockwise direction.

After all known points necessary to calculate the surface area have been observed, **[CALC]** is displayed.

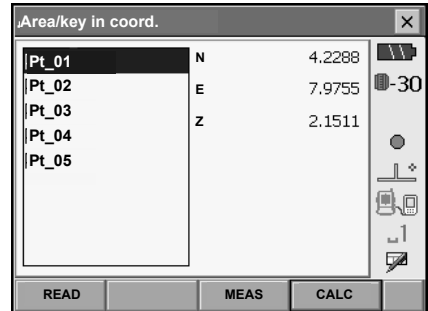

- Press **[CALC]** to display the calculated area.

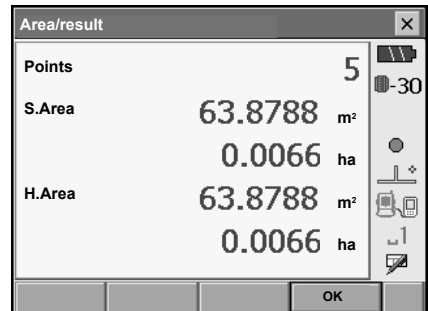

- Press **[OK]** to return to <Area/key in coord.>.
Press **{ESC}** or tap the cross in the top-right corner to quit area calculation.

23.ROUTE SURVEYING

This mode allows a variety of route surveying options widely used in civil engineering measurement. Each menu allows the operator to initiate a string of successive configuration/calculation/record/setting-out operations.


- The orientation of the instrument station and backsight station can be set as necessary.



- The Z-axis coordinate value in all route surveying work is always "Null" ("Null" is not the same as "0").



Symbols and terms used in Route Surveying

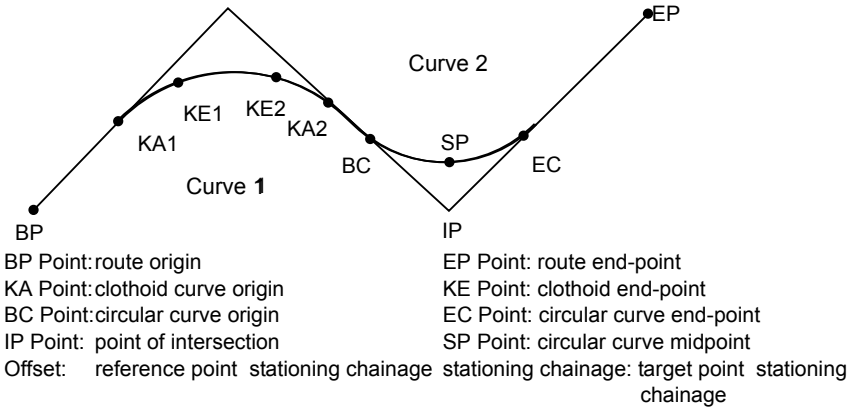

23.1 Instrument Station Settings

The instrument station to be used as the reference point is recorded, as necessary, prior to starting surveying.

► PROCEDURE

1. Select "Road" in the "COGO" tab of <Menu>.



2. Press **[Road Calc1]**.

- Press **[RESEC]** to perform resection measurement. It is possible to set a point found by specifying 2 known points as the instrument station.

☞ "17. RESECTION MEASUREMENT"



3. Select "Station setup" in <Stn. Orientation> and enter instrument station data.

☞ "15.1 Entering Instrument Station Data"




4. Select "Backsight setup" in <Stn. Orientation> and enter backsight station data.

☞ "15.2 Azimuth Angle Setting"

23.2 Straight Line Calculation

The coordinates of the center peg and width pegs for a straight line can be found from the coordinates of the reference point and IP point.

It is then possible to proceed with the setting-out of the center peg and width pegs.

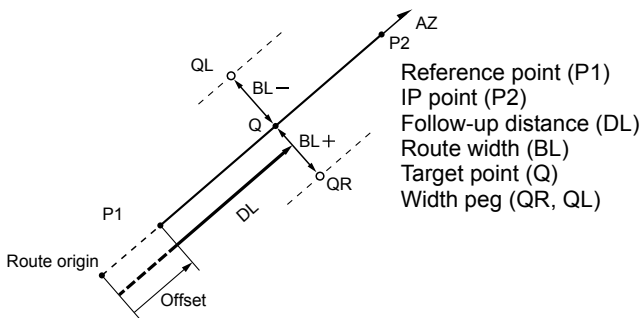

► PROCEDURE

1. Select "Road" in the "COGO" tab of <Menu>.

2. Select "Road Calc1" in <Road>.




3. Select "Straight" in "Element".

4. Input the point number of reference point.


- Press **[READ]** to read in the already registered coordinate data and set as the coordinates of the reference point.
- If the coordinate of the input point number is not registered, record screen is displayed.

☞ "16.4 Reading in Registered Coordinate Data"

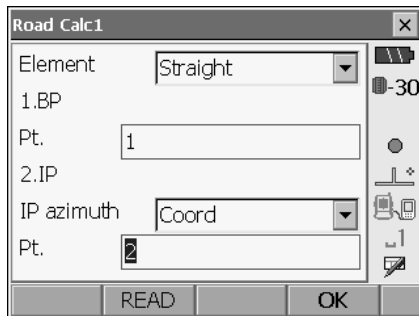


5. Input IP point number or azimuth angle. When inputting point number, select "Coord" in "IP azimuth". When inputting azimuth angle, select "Azimuth" in "IP azimuth". Press **[OK]**.

6. Input the reference point stationing, stationing chainage and offset for width peg.

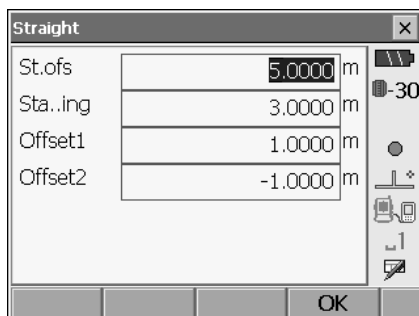

7. Press **[OK]** in the screen shown in step 6 to calculate the center peg and width peg coordinates and azimuth angle. The coordinates and azimuth angle are then displayed on the screen.

- Select the Graphic tab to display calculation results on a graph.
-  "25.3 Reviewing Data"

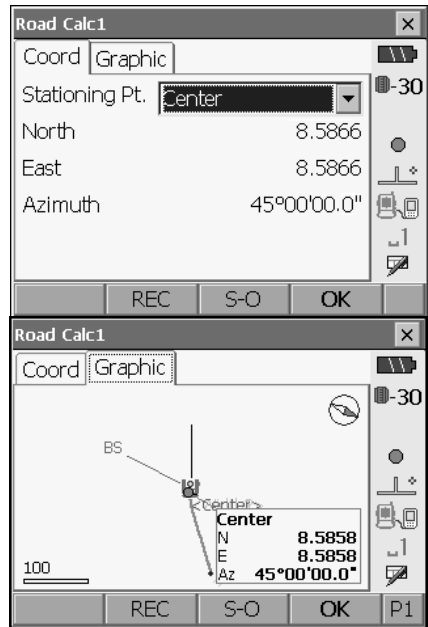


8. Press **{ESC}** twice to finish Straight Line calculation and return to <Road>.
- The center peg or width pegs can be stored as a known point in the current job by pressing **[REC]**.
 "25.1 Registering Known Point Data"
 - The center peg or width pegs can be set-out by pressing **[S-O]**.
 18. SETTING-OUT MEASUREMENT
 - Press **{ESC}** to return to the center peg setting screen.

Note

- When the azimuth angle is set after the point numbers have been input in step 4, if the coordinates are deleted the azimuth angle is given priority.
- Offset/Stationing chainage input range: 0.000 to 99999.999 (m)
- Route width input range: -999.999 to 999.999 (m)


23.3 Circular Curve Calculation

The coordinates of the center peg and width pegs on a circular curve can be found from the coordinates of the BC point and IP point.
It is then possible to proceed with the setting-out of the center peg and width pegs.

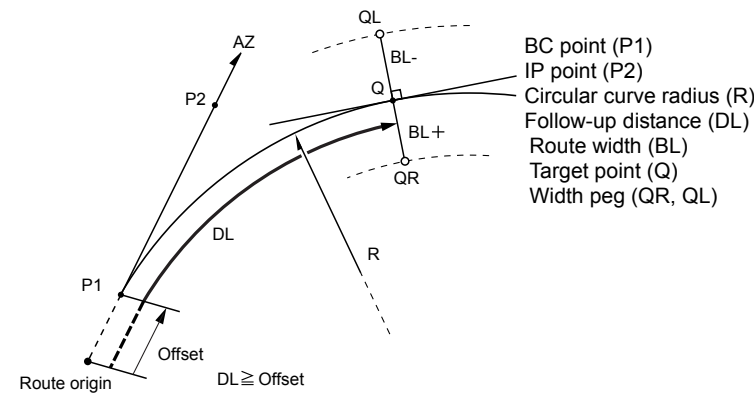

► PROCEDURE

1. Select "Road" in the "COGO" tab of <Menu>.
2. Select "Road Calc1" in <Road>.
3. Select "Arc" in "Element".
4. Input the point number of BC point.
5. Input IP point number or azimuth angle. When inputting point number, select "Coord" in "IP azimuth". When inputting azimuth angle, select "Azimuth" in "IP azimuth". Press [OK].

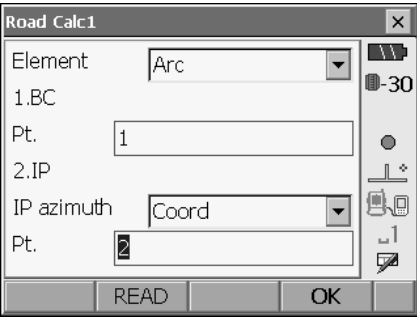

6. Select the curve direction, enter curve radius, station offset, and stationing chainage and offset for width peg.

Dircn	Right	m
Radius	4.0000	m
St.ofs	2.0000	m
Sta..ing	3.0000	m
Offset1	1.0000	m
Offset2	-1.0000	m

7. Press **[OK]** in the screen shown in step 6 to calculate the center peg and width peg coordinates and azimuth angle. The coordinates and azimuth angle are then displayed on the screen.

Coord	Graphic
Stationing Pt.	Center
North	8.5866
East	8.5866
Azimuth	45°00'00.0"

8. Press **{ESC}** twice to finish Circular Curve calculation and return to <Road>.



- Curve direction: right/left
- Radius input range: 0.0000 to 9999.9999 (m)

23.4 Clothoid Curve


The coordinates of the center peg and width pegs on a clothoid curve can be found from the coordinates of the reference point and curve properties.

It is then possible to proceed with the setting-out of the center peg and width pegs.


- Select a calculation menu depending on the section of the clothoid curve to be calculated.
Clothoid curve is calculated by the following formula.

$$A^2 = RL$$


Calculation using KA Point as reference: "KA-KE Calculation 1"

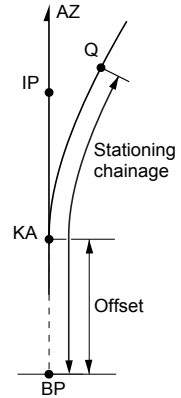

Calculation using arbitrary point between KA1 and KE1 as reference:
"KA-KE Calculation 2"

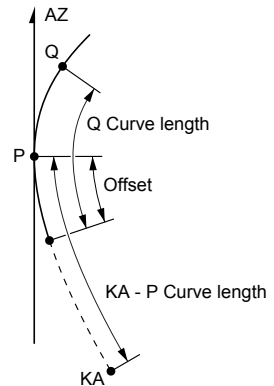

Calculation using KE2 as reference: "KE-KA Calculation"

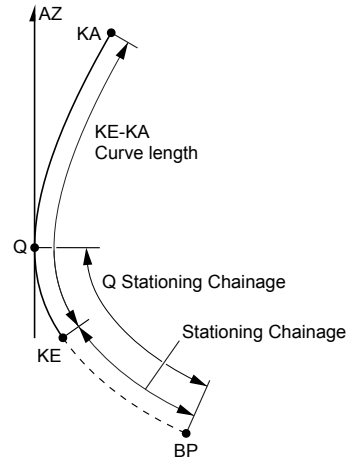

- If the following conditions are not met, coordinate calculation cannot be performed.

"KA-KE Calculation 1": $0 \leq \text{curve length} \leq 2A$
 "KA-KE Calculation 2": $0 \leq \text{KA - reference point curve length} \leq 3A$
 $0 \leq \text{KA - target point curve length} \leq 2A$
 "KE-KA Calculation": $0 \leq \text{KA - KE curve length} \leq 3A$
 $0 \leq \text{KA - target point curve length} \leq 2A$

►PROCEDURE Calculation using KA Point as reference

- Select "Road" in the "COGO" tab of <Menu>.
- Select "Road Calc1" in <Road>.
- Select "KA-KE1" in "Element".

- Input the point number of KA point.

23. ROUTE SURVEYING

5. Input IP point number or azimuth angle. When inputting point number, select "Coord" in "IP azimuth". When inputting azimuth angle, select "Azimuth" in "IP azimuth". Press **[OK]**.
6. Select the curve direction, enter parameter A, station offset, and stationing chainage and offset for width peg.

KA-KE1

Dirch	Right	
Para A	4.0000	m
St.ofs	2.0000	m
Sta..ing	3.0000	m
Offset1	1.0000	m
Offset2	-1.0000	m

OK

7. Press **[OK]** in the screen shown in step 6 to calculate the center peg and width peg coordinates and azimuth angle. The coordinates and azimuth angle are then displayed on the screen.

Road Calc1

Coord	Graphic	
Stationing Pt.	Center	
North	8.5866	
East	8.5866	
Azimuth	45°00'00.0"	

REC S-O OK

8. Press **{ESC}** repeatedly to finish Clothoid Curve calculation and return to <Road>.



- Curve direction: right/left
- Parameter A input range: 0.0000 to 9999.9999 (m)
- Station offset /Stationing chainage input range: 0.0000 to 99999.9999 (m)

► PROCEDURE Calculation using arbitrary point between KA1 and KE1 as reference

1. Select "Road" in the "COGO" tab of <Menu>.
2. Select "Road Calc1" in <Road>.

3. Select "KA-KE2" in "Element".

Road Calc1

Element: KA-KE2

1.Pt: 1

2.Direction: Coord

Pt.: 2

READ OK

4. Input the point number of P point (reference point).
5. Input the point number of the arbitrary point on the line tangential to the P point or azimuth angle. When inputting point number, select "Coord" in "IP azimuth". When inputting azimuth angle, select "Azimuth" in "IP azimuth". Press **[OK]**.
6. Select the curve direction, enter parameter A, KA-P length (length of curve from KA to P point), station offset, P-Q length (length of curve from P point to target point) and offset for width peg.

KA-KE2

Dirn: Right

Para A: 4.0000 m

KA-P Length: 3.0000 m

St.ofs: 2.0000 m

P-Q Length: 5.0000 m

Offset1: 1.0000 m

Offset2: -1.0000 m

OK

7. Press **[OK]** in the screen shown in step 6 to calculate the center peg and width peg coordinates and azimuth angle. The coordinates and azimuth angle are then displayed on the screen.

Road Calc1

Coord: Graphic

Stationing Pt.: Center

North: 8.5866

East: 8.5866

Azimuth: 45°00'00.0"

REC S-O OK

8. Press **{ESC}** repeatedly to finish Clothoid Curve calculation and return to <Road>.



- KA-P length input range: 0.0000 to 99999.9999 (m)
- P-Q length input range: -999.9999 to 999.9999 (m)

► PROCEDURE Calculation using KE2 Point as reference

1. Select "Road" in the "COGO" tab of <Menu>.
2. Select "Road Calc1" in <Road>.
3. Select "KE-KA" in "Element".

4. Input the point number of KE point (reference point).
5. Input the point number of the arbitrary point on the line tangential to the KE point or azimuth angle. When inputting point number, select "Coord" in "IP azimuth". When inputting azimuth angle, select "Azimuth" in "IP azimuth". Press **[OK]**.
6. Select the curve direction, enter parameter A, KE-KA curve length (length of curve from KE to KA), KE stationing chainage, target point stationing chainage and offset for width peg.

7. Press **[OK]** in the screen shown in step 6 to calculate the center peg and width peg coordinates and azimuth angle. The coordinates and azimuth angle are then displayed on the screen.

8. Press **{ESC}** repeatedly to finish Clothoid Curve calculation and return to <Road>.


Note

- KE-KA length (length of curve from KE to KA)/KE stationing chainage/Q stationing chainage (Set out pt sta) input range: 0.0000 to 99999.9999 (m)

23.5 3 Point Calculation

The coordinates of a cardinal point, an arbitrary center peg, and width pegs can be found from the coordinates of 3 IP points and curve properties.

It is then possible to proceed with the setting-out of the cardinal point, arbitrary center peg, and width pegs

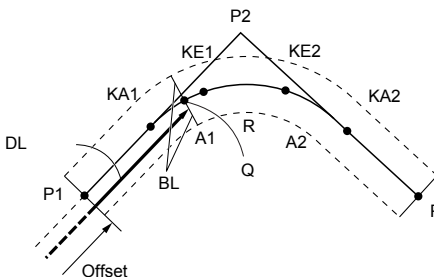

- BP point (P1)
- IP point (P2)
- EP Point (P3)
- Clothoid parameter (A1)
- Clothoid parameter (A2)
- Curve radius (R)
- Route width (BL)
- Arbitrary point follow-up distance (DL)

- When parameter A1, parameter A2 and radius R have all been input a clothoid is created and the KA1, KE1, KE2 and KA2 points can be found.
- When parameter A1 and parameter A2 have been input and radius R is "Null", a clothoid without a transition curve is created and the KA1, KE1, and KA2 points can be found.
- When parameter A1 and parameter A2 are both "Null" and only radius R has been input, a circular curve is created and the BC point and EC point can be found.


► PROCEDURE

1. Select "Road" in the "COGO" tab of <Menu>.

2. Select "Road Calc2" in <Road>.




3. Select "BP-IP-EP" in "Element".

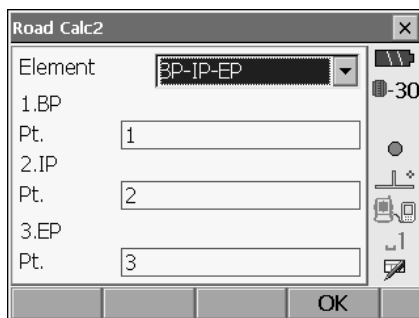

4. Input the point number of BP point (reference point), IP point and EP point then press **[OK]**

5. The IA angle (intersection angle), curve direction, BP-IP length, and IP-EP length are calculated from the coordinates of the three input points. The results are then displayed on the screen. Check the data, then press **[OK]**.

- Press **{ESC}** to return to the previous screen to make alterations to this data.

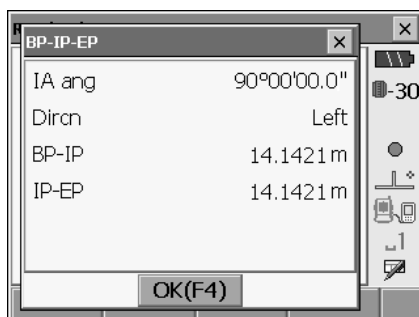

6. Input curve properties: parameter A1, parameter A2, curve radius R, and Station offset (offset from stationing chainage).

BP-IP-EP

A1	5.0000	m
A2	5.0000	m
Radius	4.0000	m
St. ofs	2.0000	m

OK

7. Press **[OK]** in the screen shown in step 6 to calculate the the coordinates and stationing chainage of the KA1 point, KE1 point, KE2 point and KA2 point. The results are then displayed on the screens

- Select the Graphic tab to display calculation results on a graph.

"25.3 Reviewing Data"

Road Calc2

List Graphic

- KA1
- KE1
- KE2
- KA2

KA1

N	142.0520
E	142.0520
Sta.,ing	59.4711 m

REC S-O OK

Road Calc2

List Graphic

50

KA1

N	145.6533
E	145.6533
Sta.,ing	64.5644 m

REC S-O OK P1

8. Press **[OK]** in the screen shown in step 7 to move to center peg settings.
9. Input stationing chainage and offset for width peg.

Road Calc2

Sta.,ing	3.6882	m
Offset1	1.0000	m
Offset2	-1.0000	m

OK

23. ROUTE SURVEYING

10. Press **[OK]** in the screen shown in step 9 to calculate the coordinates and stationing chainage of the center peg and width peg. The results are then displayed on the screen

Road Calc2	
List	Graphic
Stationing Pt.	Center
North	14.7255
East	14.7255
Staaling	8.6882m
REC S-O OK	

11. Press **[ESC]** repeatedly to finish 3 point calculation and return to <Road>.


Note

- In the case of a clothoid with no transition curve, the KA1 Point, KE Point, and KA2 Point can be found in step 7.
- In the case of a circular curve, the BC Point and EC Point can be found in step 7.

23.6 Intersection Angle/Azimuth Angle Calculation

The coordinates of a cardinal point, an arbitrary center peg, and width pegs can be found from an intersection angle, curve properties, and either the coordinates of BP point and 1 IP point of intersection or the azimuth angle from the BP Point to the IP point.

It is then possible to proceed with the setting-out of the cardinal point, arbitrary center peg, and width pegs

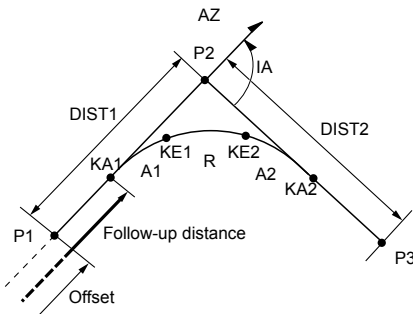

BP point (P1)
IP intersection point (P2)
EP point (P3)
BP to IP distance (DIST1)
IP to EP distance (DIST2)
Clothoid parameter (A1)
Clothoid parameter (A2)
Curve radius (R)

► PROCEDURE

1. Select "Road" in the "COGO" tab of <Menu>.
2. Select "Road Calc2" in <Road>.

3. Select "BP-IP and angle" in "Element".

Road Calc2

Element: BP-IP and angle

1.BP
Pt.: 1

2.IP
IP azimuth: Coord

Pt.: 2

READ OK

4. Input the point number of BP point (reference point).
5. Input the point number of the IP point or azimuth angle. When inputting point number, select "Coord" in "IP azimuth". When inputting azimuth angle, select "Azimuth" in "IP azimuth". Press **[OK]**
6. Input curve properties: curve direction, IA angle (intersection angle), BP-IP (distance between BP Point and IP Point), IP-EP (distance between IP Point and EP Point), parameter A1, parameter A2, curve radius, and station offset (BP Point stationing chainage).

BP-IP and angle

Dir: left

IA ang: 90°00'00.0"

BP-IP: 14.1422 m

IP-EP: 14.1422 m

A1: 5.0000 m

A2: 5.0000 m

Radius: 4.0000 m

St. ofs: 2.0000 m

OK

7. Press **[OK]** in the screen shown in step 6 to calculate the coordinates and stationing chainage of the KA1 point, KE1 point, KE2 point, KA2 point. The results are then displayed on the screens

Road Calc2

List: Graphic

◆ KA1 N 14.7255

◆ KE1 E 14.7255

◆ KE2 Sta.ing 8.6822 m

◆ KA2

REC S-O OK

8. Press **[OK]** in the screen shown in step 7 to move to center peg settings.

23. ROUTE SURVEYING

9. Input stationing chainage and offset for width peg.

The screenshot shows the 'Road Calc2' screen with the following data:

Field	Value	Unit
Sta..ing	8.6822	m
Offset1	1.0000	m
Offset2	-1.0000	m

On the right side of the screen, there are icons for a calculator, a printer, and a list. At the bottom, there are buttons for 'REC', 'S-O', and 'OK'.

10. Press **[OK]** in the screen shown in step 9 to calculate the coordinates and stationing chainage of the center peg and width peg. The results are then displayed on the screen.

The screenshot shows the 'Road Calc2' screen with the following data:

Field	Value	Unit
List	Graphic	
Stationing Pt.	Center	
North	14.7255	
East	14.7255	
Sta..ing	8.6822	m

On the right side of the screen, there are icons for a calculator, a printer, and a list. At the bottom, there are buttons for 'REC', 'S-O', and 'OK'.


11. Press **{ESC}** repeatedly to finish intersection angle/azimuth angle calculation and return to <Road>.

Note

- In the case of a clothoid with no transition curve, the KA1 Point, KE Point, and KA2 Point can be found in step 7.
- In the case of a circular curve, the BC Point and EC Point can be found in step 7.
- Intersection angle IA input range: $0^\circ < IA < 180^\circ$

23.7 Route Calculation

Route Calculation is used to find the center pegs and width pegs of a route which contains a series of curves. It is then possible to proceed with setting-out.

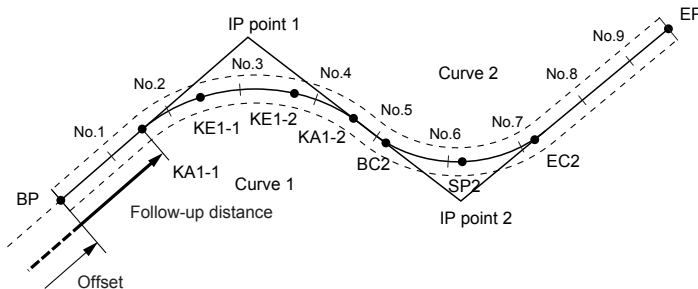

- Route Calculation includes the following:
Curve properties input, curve properties display, automatic calculation of cardinal points, arbitrary point calculation, and inverse width peg calculation.
- In the Route Calculation menu it is possible to set one route per JOB, each route containing a maximum of 16 curves.
- Up to 600 points, including all center pegs and width pegs, can be calculated using automatic calculation of cardinal points.
- Route data is retained even when the power has been cut off. However, the route data will be cleared if the JOB is deleted.
☞ Deleting a JOB: "26.2 Deleting a JOB"




- Curve data is not set when curve properties (parameter A1, parameter A2, radius R) are all set to "Null".
- Route Calculation is used to measure a series of successive curves. If a curve is not connected to the main series of curves, all data from the end of the last connected curve is void. Route surveying is not performed for this section.
- The rounding up of error values in curve calculation may create discrepancies (mm) in coordinates of peg No.

23.7.1 Inputting curve properties

- BP Point auto setting (step 10)
It is possible to preset which point to use as the BP Point of the next curve: the IP Point of the previous curve or the end-point (KA-2 or EC Point) of the previous curve.
☞ "23.7.6 Setting parameters"

23. ROUTE SURVEYING

- If curves overlap when the next curve has been calculated based on input curve properties (by pressing either **[NEXT]** or **[OK]**), the following screen is displayed.

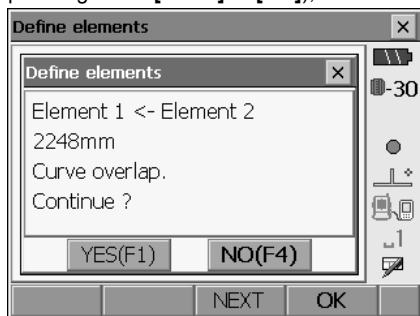

Press **[YES]** to ignore the overlapping and continue calculation.


Press **[NO]** to stop calculation and return to the curve properties input screen.

► PROCEDURE

1. Select "Road" in the "COGO" tab of <Menu>.
2. Select "Alignment" in <Road>.



3. Select "Define elem." in <Alignment>.

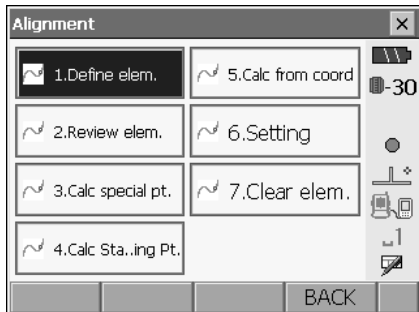

4. Input the desired curve number.
Press **[OK]** to set the selected number.

Define elements

Element num. [dropdown]

1.BP Pt. 1

2.IP Pt. 2

3.EP Pt. 3

OK

5. Input the point number of BP point, IP point and EP point then press **[OK]**.
6. The intersection angle, curve direction, BP-IP curve length, and IP-EP curve length are calculated from the coordinates of the three selected points. The results are then displayed in this screen.
Check the data, then press **[OK]**.

- Press **{ESC}** to return to the previous screen to make alterations to this data

Define elements

Element num. 1

IA ang 90°00'00.0"

Dircn Left

BP-IP 14.1422 m

IP-EP 14.1422 m

OK(F4)

7. Input curve properties: parameter A1, parameter A2, radius R, and Station offset (offset from stationing chainage).

Define elements

Element num. 1

A1 5.0000 m

A2 5.0000 m

Radius 6.0000 m

St ofs 1.0000 m

NEXT OK

23. ROUTE SURVEYING

8. Pressing **[NEXT]** in the screen shown in step 7 moves to the next curve number.
When "EC/KA2" is set in "23.7.6 Setting parameters", the end-point of the previous curve is displayed as the BP point of the next curve.

The 'Define elements' screen displays the following data:

Element num. 2	
1.BP	
Pt.	2
2.IP	
Pt.	3
3.EP	
Pt.	4

Buttons: OK

9. The EP Point of the previous curve is displayed as the IP Point coordinates of the next curve.
10. Input the point number of the EP point of the next curve, then press **[OK]**.
11. The intersection angle, curve direction, BP-IP curve length, and IP-EP curve length are calculated from the coordinates of the BP Point, IP Point and EP Point. The results are then displayed in this screen.
Check the data, then press **[OK]**.

12. Input curve properties for the next curve: parameter A1, parameter A2, and radius R. The offset value is set automatically.
- When "IP" is set in "23.7.6 Setting parameters", offset is not displayed.

The 'Define elements' screen displays the following data:

Element num. 2	
A1	5.0000 m
A2	5.0000 m
Radius	6.0000 m
St. ofs	16.9996 m

Buttons: NEXT, OK

13. Repeat steps 8 to 12 for the next curve until the curve properties have been input.
14. Press **[OK]** when all curve properties have been input.


23.7.2 Displaying curve properties

It is possible to check the curve properties set in "Inputting curve properties". To make alterations, follow the procedure described in "Inputting curve properties".

- The curve property data will be displayed in ascending order of curve number.

►PROCEDURE

1. Select "Road" in the "COGO" tab of <Menu>.
2. Select "Alignment" in <Road>.
3. Select "Review elements" in <Alignment>.
Details of the data selected on the left column is displayed on the right.

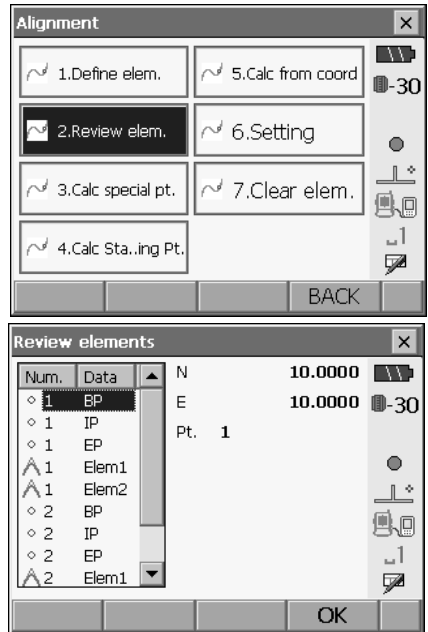

4. Press [OK] to return to <Alignment>.


23.7.3 Automatic calculation of cardinal points

Perform automatic calculation of cardinal points based on the curve properties set in "24.7.1 Inputting curve properties". Center pegs (peg No.) and width pegs set up at intervals can be calculated at once.


- Up to 600 points, including all center pegs and width pegs, can be calculated using automatic calculation of cardinal points.
- The cardinal point calculated depends on the type of curve involved.
Clothoid: KA-1 Point, KE-1 Point, KE-2 Point, KA-2 Point
Clothoid with no transition curve: KA-1 Point, KE Point, KA-2 Point
Circular curve: BC Point, SP Point, EC Point
- The width pegs can be set up on both sides of the route and the left and right route widths calculated separately.
- A point number is automatically assigned to peg No. that is calculated. The first part of the point number can be preset.
- The coordinates of calculated pegs are automatically stored in the current JOB. When a particular point number already exists in the current job the available options it is possible to select whether or not to overwrite. It is possible to preset which procedure is used in this situation.

► PROCEDURE


1. Select "Road" in the "COGO" tab of <Menu>.
2. Select "Alignment" in <Road>.
3. Select "Calc special pt." in <Alignment>.

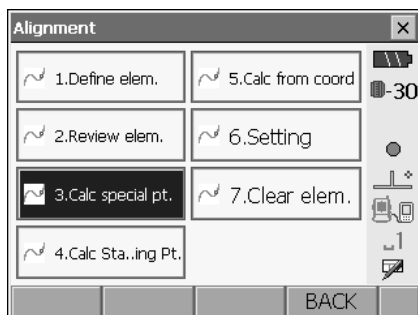

4. Set peg No. pitch (peg interval), Offset 1 (route width), Offset 2, Existing pt. (duplicate point number procedure when point number already exists in current JOB), and Auto pt. (peg No. name).

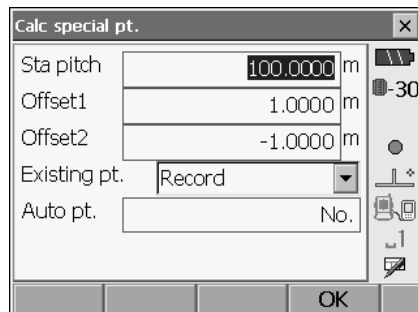

5. Press **[OK]** in the screen shown in step 4 to calculate the coordinates of the cardinal point, width pegs and peg No. Details of the data selected on the left column is displayed on the right.


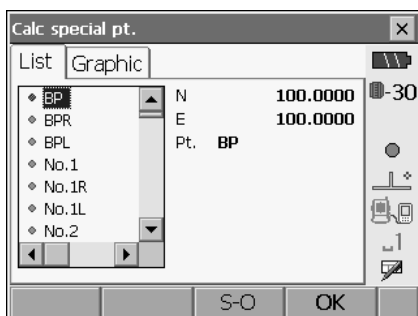


- Select the Graphic tab to display calculation results on a graph.

 "25.3 Reviewing Data"

- When "Existing pt." in step 4 has been set to "Skip" a point with a point number which already exists in the current JOB will not be automatically stored. These points are marked with a blue circle. At this stage of the process it is possible to store such a point under a new point number.

6. The screen at right is displayed, when the amount of set pegs exceeds 600 points. Press **[YES]** to continue using the initial 600 points. Press **[NO]** to return to the screen of step 4.

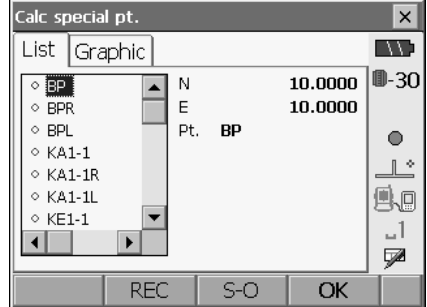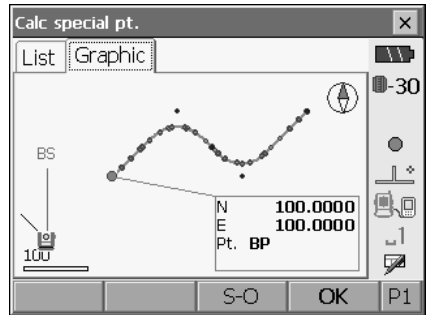

7. Press **[OK]** to return to <Alignment>.

Note

- Sta pitch input range: 0.0000 to 9999.9999 (10.000*) (m)
- Offset input range: -999.9999 to 999.9999 (Null *) (m)
- Existing pt. (Duplicate point number procedure): Record (record as separate point with same point number)*/Skip (no overwrite)
- Auto pt. length: 14 characters ("peg No.**")

23. ROUTE SURVEYING



Rules regarding the assigning of point numbers to automatically calculated pegs

- Clothoid curve cardinal point: the curve number is added at the end e.g. the KA1 Point of curve number 1 is written "KA1-1", and the KA1 Point of curve number 2 is written "KA2-1".
- Circular curve cardinal point: the curve number is added at the end e.g. the BC Point of curve number 1 is written "BC1", and the BC Point of curve number 2 is written "BC2".
- Width peg: "R" or "L" is added at the end of the center peg point number. "R" is added for positive (+) route widths (the route width from the center peg to the RIGHT width peg) and "L" is added for negative (-) route widths (route width from the center peg to the LEFT width peg). When both route widths are input as positive (+) "R" and "R2" are used. When both route widths are input as negative (-) "L" and "L2" are used.
- A blank space at the beginning and end of a point number will be ignored.

23.7.4 Arbitrary point calculation

The coordinates of arbitrary points on every calculated curve can be found using arbitrary point calculation.

► PROCEDURE

1. Select "Road" in the "COGO" tab of <Menu>.
2. Select "Alignment" in <Road>.
3. Select "Calc Sta...ing Pt." in <Alignment>.
4. Input the arbitrary point stationing chainage and offset for width peg.

The image shows two overlapping software windows. The top window is titled 'Alignment' and contains a grid of buttons: '1. Define elem.', '2. Review elem.', '3. Calc special pt.', '4. Calc Sta...ing Pt.' (which is highlighted with a dark background), '5. Calc from coord', '6. Setting', and '7. Clear elem.'. A 'BACK' button is at the bottom right. The bottom window is titled 'Calc Sta...ing Pt.' and contains three input fields: 'Sta...ing' with the value '10.0000 m', 'Offset1' with the value '1.0000 m', and 'Offset2' with the value '-1.0000 m'. An 'OK' button is at the bottom right. Both windows have a battery icon and a signal strength indicator in the top right corner.

- Press **[OK]** in the screen shown in step 4 to display the coordinates and point number of the arbitrary point.

- The center point can be stored as a known point in the current job by pressing **[REC]**.

- Select the Graphic tab to display calculation results on a graph.

☞ "25.3 Reviewing Data"

Calc Sta..ing Pt.

Coord **Graphic**

Stationing Pt. **Center**


North 16.4900

East 16.2233

Sta..ing 10.0000 m

Pt.id No.10

REC S-O OK

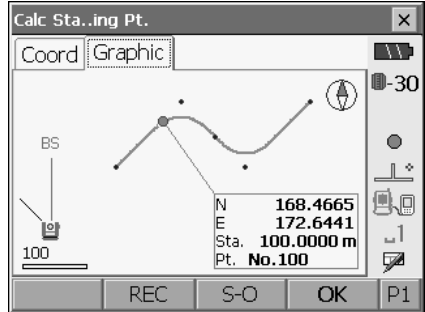

- Press **{ESC}** to return to <Alignment>.



Rules regarding the automatic assigning of point numbers to arbitrary points

- Arbitrary point: The distance to the arbitrary point is given in terms of the closest peg No. from the front of the curve. The distance from the peg No. is added at the end.

23.7.5 Inverse width peg

The route widths and coordinates for center pegs on every calculated curve can be found by using inverse width peg calculation.


- There are two methods for specifying arbitrary width peg coordinates: key entry and observation.

►PROCEDURE Using key entry to specify arbitrary width pegs


- Select "Road" in the "COGO" tab of <Menu>.
- Select "Alignment" in <Road>.

23. ROUTE SURVEYING


3. Select "Calc from coord" in <Alignment>.

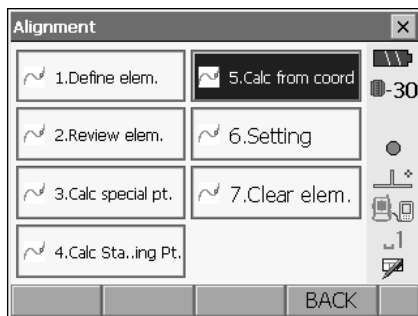

4. Input the point number of the arbitrary width peg.

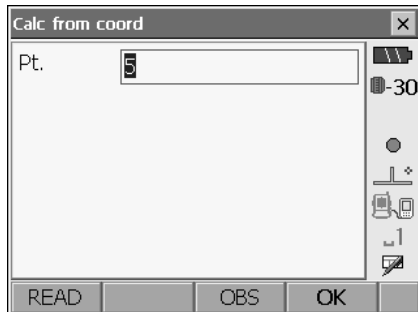


5. Press [OK] in the screen shown in step 4 to display the coordinates and point number of the center peg and width peg.

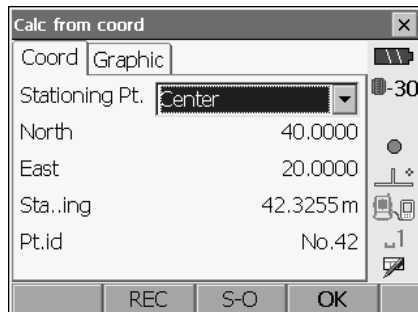

- Select the Graphic tab to display calculation results on a graph.


"25.3 Reviewing Data"

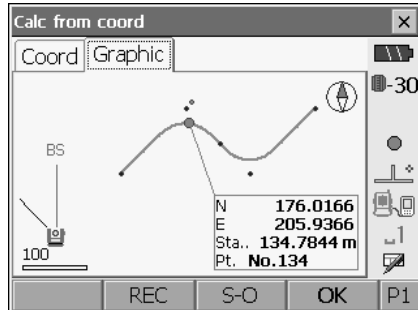

6. The next width peg can then be set by pressing [OK].

►PROCEDURE Using observation to specify arbitrary width pegs

1. Enter the Inverse Width Peg menu in the same manner as shown above.
 "PROCEDURE Using key entry to specify arbitrary width pegs" steps 1 to 3
2. Sight the width peg and press **[OBS]**.

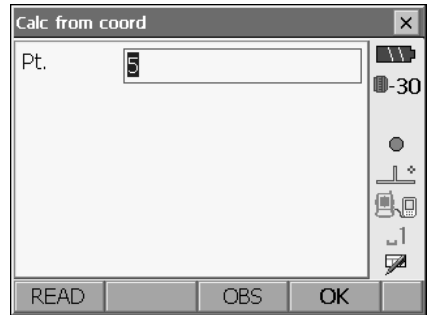


Calc from coord

Pt. 5

READ OBS OK

3. Press **[DIST]** to start measurement.
 - When recording data in the current JOB, press **[REC]**.

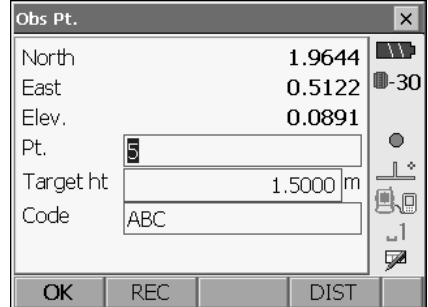

Obs Pt.

North 1.9644

East 0.5122

Elev. 0.0891


Pt. 5

Target ht 1.5000 m

Code ABC

OK REC DIST

4. Press **[OK]** in the screen shown in step 3 to display the coordinates and point number of the center peg and width peg.

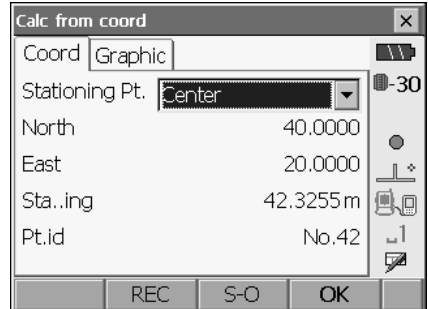

Calc from coord

Coord Graphic

Stationing Pt. Center

North 40.0000

East 20.0000

Sta.ing 42.3255 m

Pt.id No. 42

REC S-O OK

5. The next width peg can then be set by pressing **[OK]**.

Note

- The rules regarding the assigning of point numbers to width pegs and center pegs are the same as those for when calculating width pegs in automatic calculation of cardinal points.

23. ROUTE SURVEYING


- 📁 "23.7.3 Automatic calculation of cardinal points" 📁 Rules regarding the assigning of point numbers to automatically calculated pegs"
- The rules regarding the assigning of point numbers to center pegs are the same as those for when calculating arbitrary points.
- 📁 ""23.7.4 Arbitrary point calculation" 📁 Rules regarding the automatic assigning of point numbers to arbitrary points"

23.7.6 Setting parameters

When configuring curve properties in "Inputting curve properties", it is possible to preset which point to set as the BP Point of the next curve: the IP Point of the previous curve or the end-point (KA-2 or EC Point) of the previous curve.

► PROCEDURE

1. Select "Road" in the "COGO" tab of <Menu>.
2. Select "Alignment" in <Road>.
3. Select "Setting" in <Alignment>.
4. Select the automatic setting method for the BP Point of the next curve.

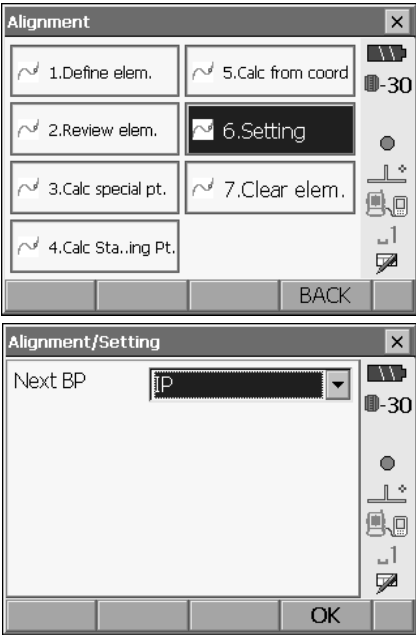

The automatic setting method can be selected from the following:


- (*: Factory setting)
- Next BP: "IP " (IP Point of the previous curve)*/"EC/KA2" (end-point of the previous curve (KA-2 or EC Point)).

23.7.7 Clearing route data


Route data set in "23.7.1 Inputting curve properties" can be cleared.

►PROCEDURE

1. Select "Road" in the "COGO" tab of <Menu>.
2. Select "Alignment" in <Road>.
3. Select "Clear elem." in <Alignment>.

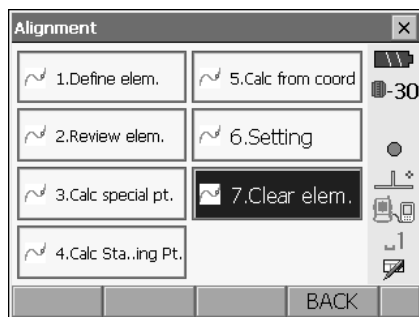


4. Press **[YES]** to clear the route data. <Alignment> is restored.

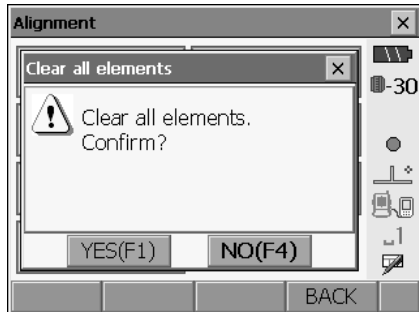

24. CROSS SECTION SURVEY

The purpose of this function is to measure and set out points along a cross-section of a road or linear feature already surveyed using the Route surveying function. Cross-sections can be surveyed in a variety of directions depending on your requirements.

 For terminology: "23. ROUTE SURVEYING"

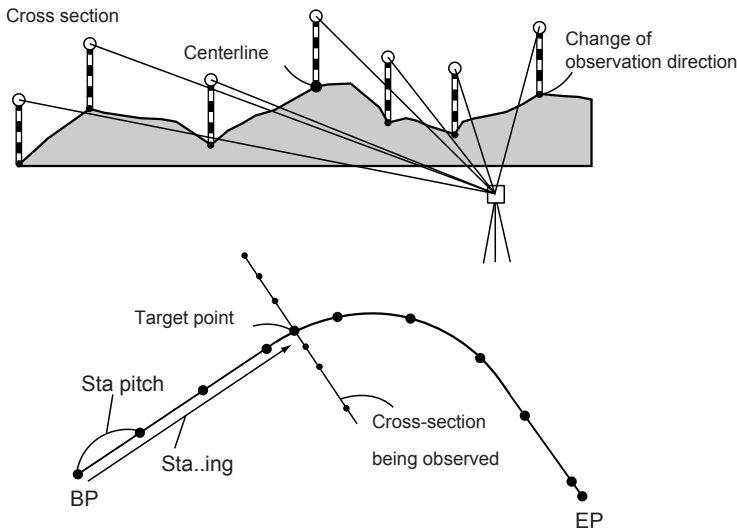


24.1 Instrument Station Settings


The instrument station to be used as the reference point is recorded, as necessary, prior to starting surveying.

► PROCEDURE

1. Select "Xsection" in the "COGO" tab of <Menu>

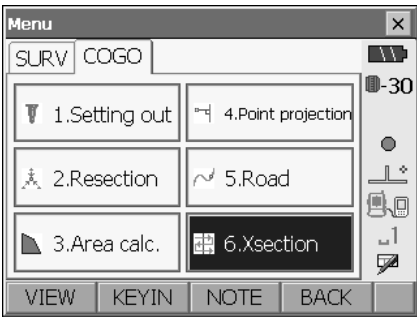

2. Select "Station setup" in <Xsection survey> and enter instrument station data
 "15.1 Entering Instrument Station Data"
 - Press **[RESEC]** to perform resection measurement. It is possible to set a point found by specifying 2 known points as the instrument station. "17. RESECTION MEASUREMENT"
3. Select "Backsight setup" in <Xsection survey> and enter backsight station data.
 "15.2 Azimuth Angle Setting"

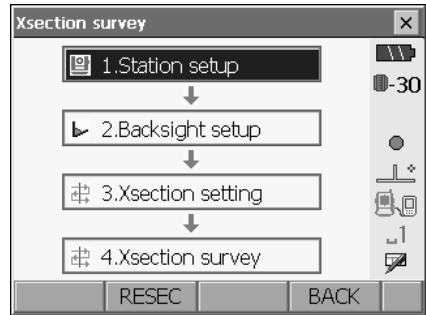

24.2 Cross Section Survey

The instrument station to be used as the reference point is recorded, as necessary, prior to starting surveying.

►PROCEDURE


1. Select "Xsection" in the "COGO" tab of <Menu>
2. Select "Xsection setting" in <Xsection survey>
3. Input road name for cross section survey, station pitch, station increment, stationing chainage and select direction. Then press **[OK]**.

- Press **[STA-]** / **[STA+]** to decrease/increase the pitch set in "Sta incr" from/to "Stationing chainage". Stationing chainage is displayed as "xx+xx.xx".



24. CROSS SECTION SURVEY

- In the event that stationing chainage was the same as the prior observation, cross-section survey is judged to have finished and a confirmation message window is displayed. Press **[YES]** to proceed to step 4. Press **[NO]** to set station pitch, station increment, and station chainage again.

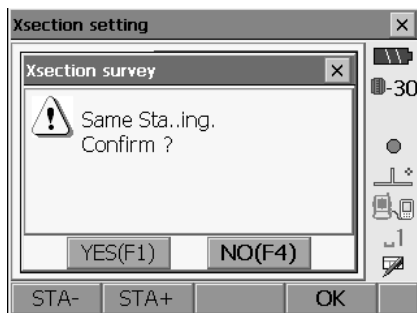


4. Sight the last point on the cross-section and press **[DIST]**.

"Direction"

- Press **[OFFSET]** on the second page to perform offset measurement for the last point.
- When observing the center point first, the center point needs to be set.


Step 8

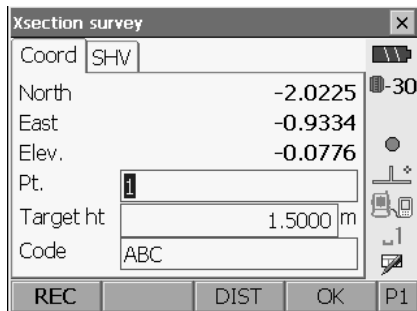

5. Enter point number, target height, and code, then press **[REC]** to record measurement data.

6. Repeat steps 4 to 5 for all points on the cross-section in the set observation direction until the centerline is reached.


7. Observe the center point. Then press **[OK]**.

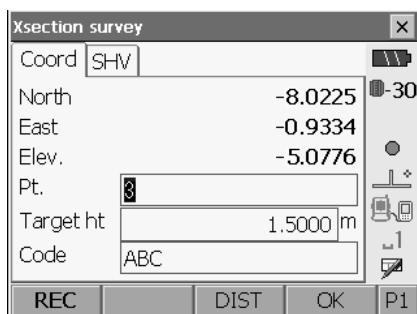

Enter center point name. Then press **[OK]**.


- When the center point is set as the instrument station, press **[READ]** to read in already registered coordinate data and set as the coordinates of the instrument station.

 "16.4 Reading in Registered Coordinate Data"

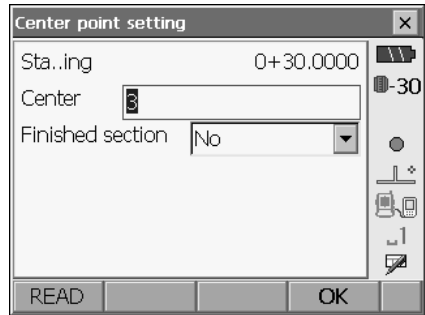


Center point setting dialog box. Fields: Sta..ing: 0+30.0000, Center: 3, Finished section: No. Buttons: READ, OK.

- Repeat steps 4 to 5 for all points on the cross-section occurring after the centerline.
- After observing the last changing point, check that "Finished section" is set to "Yes", then press **[OK]**.

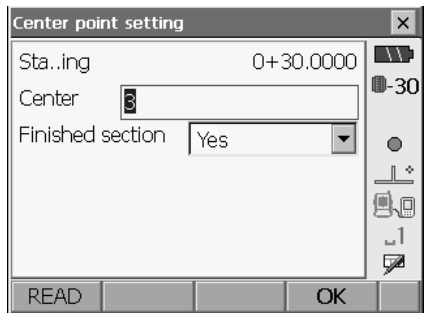

Center point setting dialog box. Fields: Sta..ing: 0+30.0000, Center: 3, Finished section: Yes. Buttons: READ, OK.

- Observation can be cancelled by pressing **{ESC}**. In this event, a confirmation message window is displayed. Press **[YES]** to discard measurement data observed up to that point and exit observation. Press **[NO]** to continue observation.

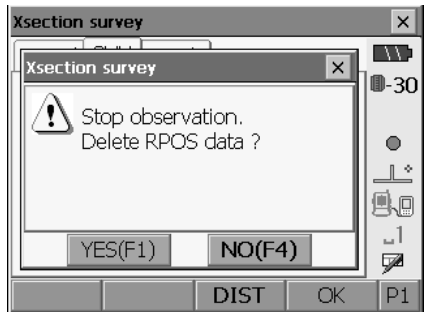

Xsection survey dialog box. Message: Stop observation. Delete RPOS data ?. Buttons: YES(F1), NO(F4), DIST, OK, P1.

- Proceed to observation of the next cross-section.

Note

- Road name: up to 16 characters
- Sta incr: 0.0000 to 9999.9999 (m)/0.00000 to 9999.99999 (m) (minimum display = 0.01mm)
- Sta..ing: -99999.9999 to 99999.9999 (m)/-99999.99999 to 99999.99999 (m) (minimum display = 0.01mm)
- Sta pitch: 0.0000 to 9999.9999 (m)/0.00000 to 9999.99999 (m) (minimum display = 0.01mm)
- Direction: Left->Right*/Right->Left/Left/Right



Direction


Cross-sections can be measured in the following directions depending on the setting selected in "Direction".

When "Left" or "Left -> Right" selected

Pattern 1: From left-most point to right-most point.

Pattern 2: Center point observed first. Then the point immediately to the left of the center point. Remaining points can then be observed in any order.

Pattern 3: Method using 2 prisms. Center point observed first followed by the point immediately to the left. Subsequent observations can be in whatever order is the most efficient for operation with 2 prisms. In the illustration below the points closest to the center point are observed first, followed by the outermost points (left first, then right).

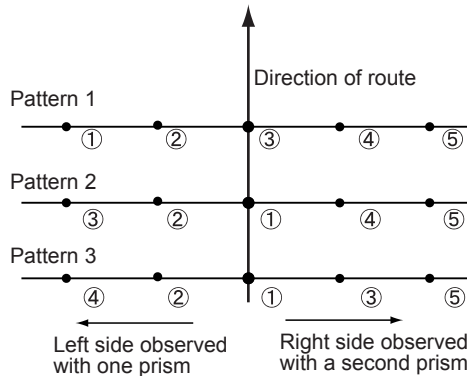


When "Right" or "Left -> Right" selected

Pattern 1: From right-most point to left-most point.

Pattern 2: Center point observed first. Then the point immediately to the right of the center point. Remaining points can then be observed in any order.

Pattern 3: Method using 2 prisms. Center point observed first followed by the point immediately to the right. Subsequent observations can be in whatever order is the most efficient for operation with 2 prisms.

When "Left -> Right" or "Right -> Left" selected, observation of a subsequent cross-section can be switched automatically to the opposite direction upon completion of the previous cross-section observation. This method minimizes the walking distance to the next starting point when measuring multiple cross-sections.

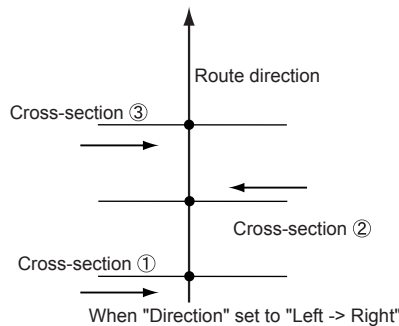



Cross survey data review

Cross-section data recorded in a JOB is displayed as shown at right. "Offset" represents the distance calculated from the center point coordinates and measurement point coordinates.

☞ Displaying JOB data: "25.3 Reviewing Data"

View			
List	Graphic		
▼ 1	Sta.ing	2+20.0000	30
ROAD	Offset	-1.5855 m	
▼ 2	Pt. 3		
▼ 3	f.h	1.5000 m	
▼ 4	N	2.0339	
▼ 5	E	-1.8441	
▼ 6	Z	0.0883	
	Cd. ABC		

Line TOP LAST SRCH P1

25. REGISTERING/REVIEWING DATA

25.1 Registering Known Point Data

It is possible to register coordinate data of the known points in the current JOB using the key entry method.

Registered coordinate data can be used when setting instrument station, backsight station, known point, and setting-out point coordinate data.


- It is possible to register 2000 items of coordinate data, including the data inside a JOB.




- When "inch" is selected as the distance unit, the value must be input in "feet" or US feet".

► PROCEDURE

1. Press **[KEYIN]** in <Menu>.

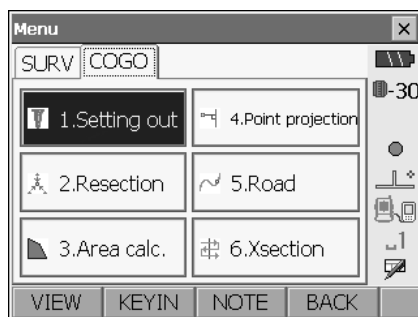

2. Input known point coordinates, point number and code. Press **[REC]** to record the data in the current JOB

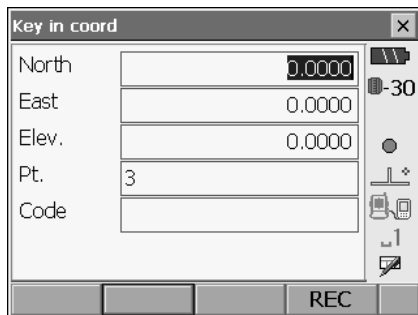


3. Continue to enter other known point coordinate data for other known points.
4. After all coordinate data has been registered, press **{ESC}** to restore <Menu>.

25.2 Registering Notes

This procedure explains how to register notes in the currently selected JOB.

►PROCEDURE

1. Press **[NOTE]** in <Menu>.
2. Input the note data, press **[REC]** to record the note in the current JOB. <Menu> is restored.

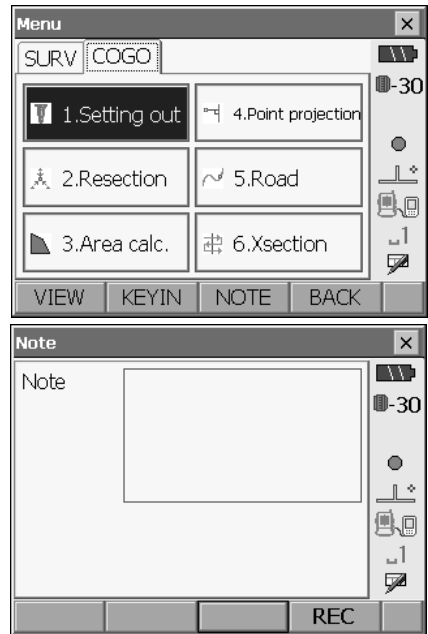

Maximum note length: 60 characters (alphanumeric)

25.3 Reviewing Data

It is possible to display all the data within the current JOB and the coordinate search JOB.

► PROCEDURE


1. Press **[VIEW]** in <Menu>.

- Current JOB name is displayed.

2. Select a data in the point number list to display details.

The list is displayed.


- Press **[Line]/[Page]** to switch the operation of {▲}/[▼] from page scroll to point scroll.
- Press **[TOP]** to select the first point in the list.
- Press **[LAST]** to select the last point in the list.
- Press **[SRCH]** to search for a point number. Up to 14 characters can be input.
- **[OBS/SAVE]/[RED/SAVE]/[COORD/SAVE]** on the second page are displayed only when observation data is displayed. When the above softkeys are pressed, the observation data is displayed or saved in the converted format.

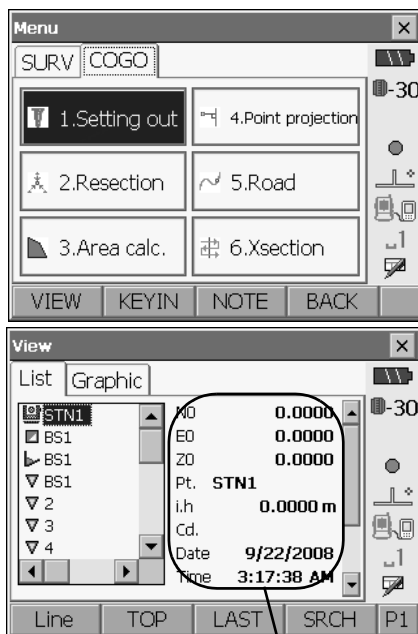

Details of the selected data


The List and Graphic tabs are linked so that when a particular point is selected in one tab, the same point is automatically selected in the other tab.

- Press **[DEF.]** to return to the default display format.

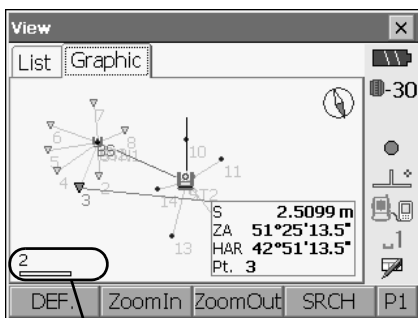

Scale bar

- Press **[CNFG]** on the second page to change the display setting. Press **[OK]** to confirm the settings.
Displayed JOB can be selected.

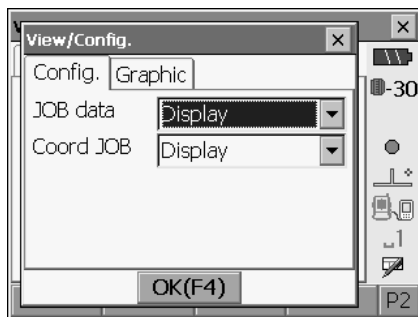

Settings:

Orientation of the display can be selected from telescope direction, north or south.

Center:


Center point for the display can be selected from instrument station or target point.

Pt.name:

Switch point name display on/off.

Line to pt:

Switch target line display on/off.

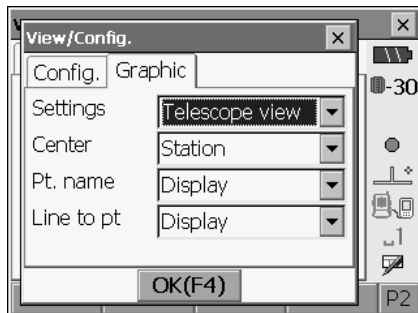

- Press **{ESC}** to return to <Menu>.

26. SELECTING / DELETING A JOB

26.1 Selecting a JOB

Select the current JOB and Coordinate Search JOB.

- A total of 10 JOBS have been prepared, and JOB1 was selected when your MS was shipped from the factory.
- The names of the JOBS has been preset as JOB1 to JOB10; you can change them to any names you wish.
- Scale factor can be set for each JOB.



Current JOB

Measurement results, instrument station data, known points data, notes and coordinate data are recorded in the current JOB.

 Registering known point data: "25.1 Registering Known Point Data"



Coordinate Search JOB

The registered coordinate data in the selected JOB can be read into coordinate measurement, resection measurement, setting-out measurement, etc.



Scale correction


MS calculates horizontal distance and coordinates of a point using measured slope distance. If scale factor has been set, scale correction is carried out during calculation.

Corrected horizontal distance (s) = Horizontal distance (S) × Scale factor (S.F.)

- When scale factor is set to "1.00000000", the horizontal distance is not corrected.

► PROCEDURE JOB selection

1. Select "JOB" in <Memory>.
<JOB List> is displayed.

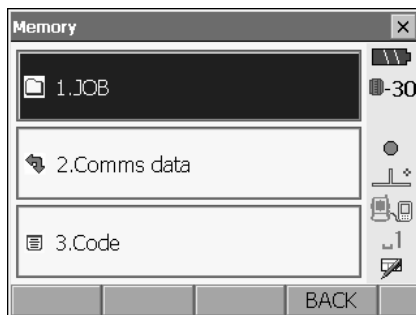

- Align the cursor with the desired current JOB and press **[JOB]** or **{←}**.
Red circle appears to the left of the JOB name.

- The numbers to the right represent the number of data items in each JOB.
- “●” means that the JOB has not been output to an external device yet.

JOB	Last update	Rec.
JOB1	9/13/2007	2000
JOB2	9/13/2007	2000
JOB3	9/13/2007	2000
JOB4	-	0
JOB5	9/14/2007	2000
JOB6	10/18/2007	10
JOB7	10/18/2007	31

- Align the cursor with the desired coordinate search JOB and press **[COORD-JOB]**.
Blue square appears to the left of the JOB name.
- Press **[OK]** to return to <Memory>.

►PROCEDURE Inputting a JOB name and scale factor setting

- Select “JOB” in <Memory>.
- Select in advance the JOB whose name you wish to change in <JOB List> and press **[SETTINGS]**.
“PROCEDURE JOB selection”
- Input the new JOB name and the scale factor for the JOB.
<JOB list> is restored.

- Scale factor can be set for each JOB.

JOB information is displayed

- Press **[OK]** to return to <Memory>.



- Maximum size of JOB name: 12 (alphanumeric)
- Scale factor input range : 0.50000000 to 2.00000000 (*1.00000000)
- “*” : Factory setting

26.2 Deleting a JOB

It is possible to clear the data within a designated JOB. After the data has been cleared, the JOB name returns to the name allocated when the MS was shipped.



- A JOB that has not been output to an auxiliary device (displayed with *) cannot be deleted.

► PROCEDURE

1. Select "JOB" in <Memory>.
2. Select the JOB to delete in <JOB List> and press **[DEL]**.
<JOB deletion> is displayed.

- The numbers to the right represent the number of data items in each JOB.



3. Press **[YES]**. The data within the selected JOB is deleted and <JOB List> is restored.

27. RECEIVING COORDINATE DATA

It is possible to read in coordinate data from a external device, CF card inserted to the MS, or the internal memory of the MS to the current JOB. Such coordinate data can be used when setting instrument station, backsight station, known point, and setting-out point coordinate data.

 External devices: "6. USING THE CF CARD SLOT" and "13. ANGLE MEASUREMENT"

Communication cables: "36. OPTIONAL ACCESSORIES"

Output format and command operations: "Interfacing with the SDR Electronic Field Book" and "Command Explanations" manuals.

- It is possible to register 2000 items of coordinate data, including the data inside a JOB.
- Coordinate data can be registered by key entry as well.

 Key entry: "25. REGISTERING/REVIEWING DATA"


- When entering known point data from an external device, MS does not check the repeated point number.



- When "inch" is selected as the distance unit, the value must be input in "feet" or US feet".

►PROCEDURE Receiving known point coordinate data from an external device via RS232C cable


1. Connect MS to the external device.
 "13. ANGLE MEASUREMENT"
2. Select "Comms data" in <Memory>.
3. Select the input format and select "No" in "File", then press **[RECV]**
 - Press **[SETUP]** to perform communication setup.
 "13. ANGLE MEASUREMENT"

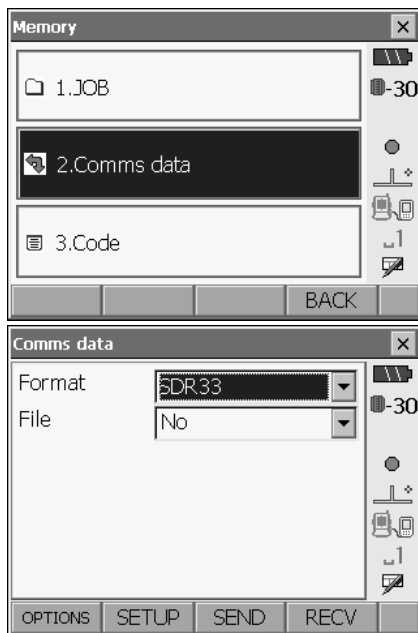


27. RECEIVING COORDINATE DATA

The coordinate data receiving stats.

- To stop data reception, press **[STOP]**.

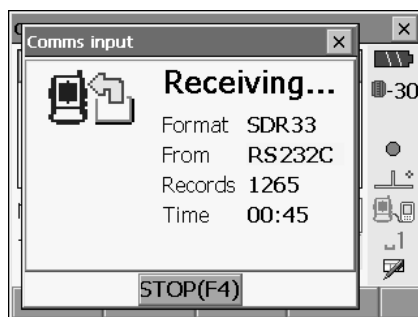


4. Press **[OK]** to return to <Comms data>.

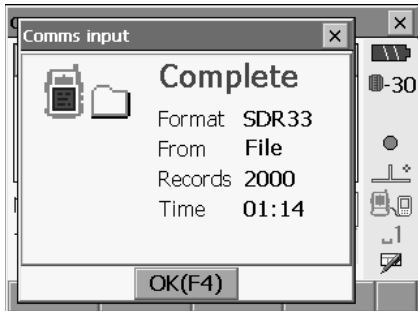


►PROCEDURE Receiving known point coordinate data file via USB port/CF card/internal memory of the MS


1. Connect MS to the USB device or insert a CF card to the CF card slot.
 📁 "6. USING THE CF CARD SLOT"/
 "13. ANGLE MEASUREMENT"
2. Select "Comms data" in <Memory>.
3. Select the input format and select "Yes" in "File", then press **[RECV]**

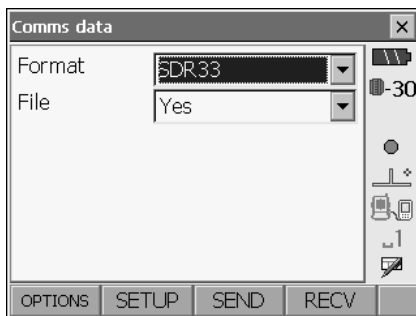


4. Select the file type to display on the list and select the file to read in.

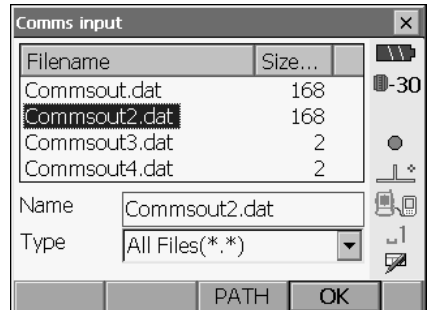


- Press **[PATH]** to specify the filepath.

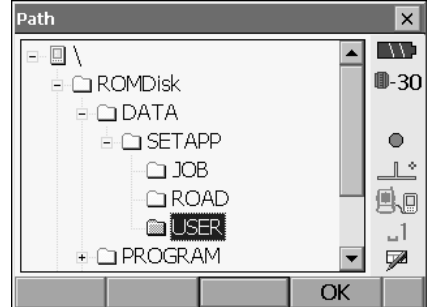

5. Press **[OK]** to start reception.
- To stop reception, press **[STOP]**.

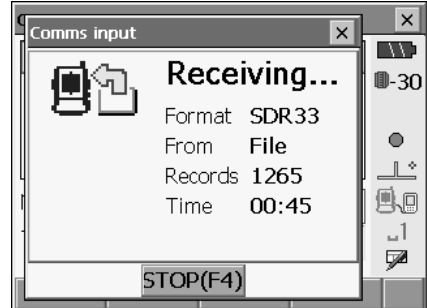

6. Press **[OK]** to return to <Comms data>.

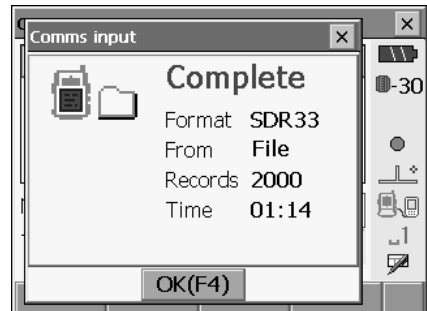

28. OUTPUTTING JOB DATA

It is possible to output JOB data to a external device, CF card inserted in the MS, or to save in the internal memory of the MS.

☞ External devices: "6. USING THE CF CARD SLOT" and "13. ANGLE MEASUREMENT"

Communication cables: "36. OPTIONAL ACCESSORIES"

Output format and command operations: "Interfacing with the SDR Electronic Field Book" and "Command Explanations" manuals.

- Measurement results, instrument station data, known point data, notes, and coordinate data in the JOB can be output.




- When "inch" is selected as the distance unit, data is output in "feet" or "US feet" depending on the feet unit selected.

►PROCEDURE Outputting JOB data to external device via RS232C cable

1. Connect MS to the external device.

☞ "13. ANGLE MEASUREMENT"

2. Select "Comms data" in <Memory>.

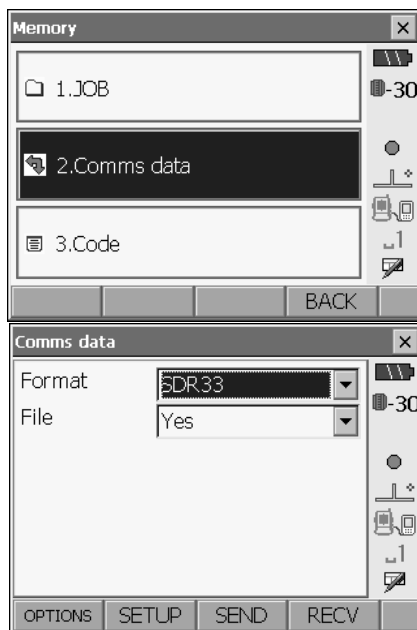

3. Select the output format and select "No" in "File", then press **[SEND]**

- Press **[SETUP]** to perform communication setup.

☞ "13. ANGLE MEASUREMENT"

- Press **[OPTIONS]** and set post-conversion format for observation data. Items to be configured are as follows.

Current view:

Select "Yes" when outputting data in original record format.

OBS view:


Select "Yes" when outputting converted data (horizontal angle, vertical angle and slope distance).

RED view:

Select "Yes" when outputting converted data (azimuth angle, horizontal distance and vertical distance).


POS view:

Select "Yes" when outputting converted data (coordinate).

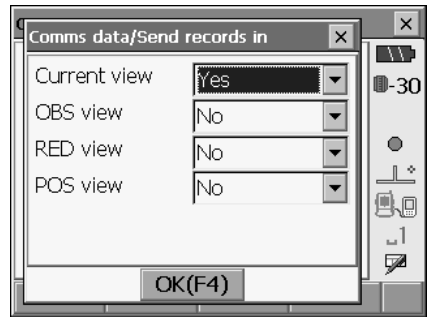

- Select the JOB to be output by pressing **[SELECT]** or **{←}**.
Green circle appears to the left of the selected JOB. You can select as many JOBS as you want.

- "•" means the JOB has not been output to an external device yet.

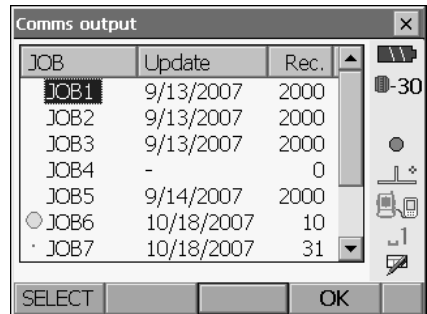


- Press **[OK]** to start output.

- To stop output, press **[STOP]**.




28. OUTPUTTING JOB DATA

6. Press **[OK]** to return to <Comms data>.
It is possible to proceed to output of the next JOB.

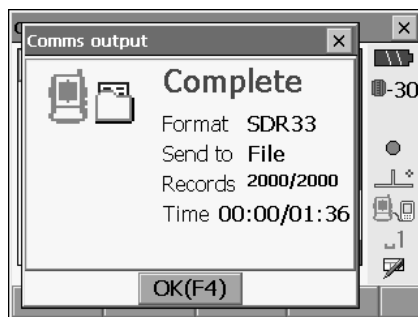


►PROCEDURE Outputting JOB data file to external device via USB port/CF card/internal memory of the MS

1. Connect MS to the USB device or insert a CF card to the CF card slot.
IDF "6. USING THE CF CARD SLOT"/
"13. ANGLE MEASUREMENT"
2. Select "Comms data" in <Memory>.
3. Select the output format and select "Yes" in "File", then press **[SEND]**

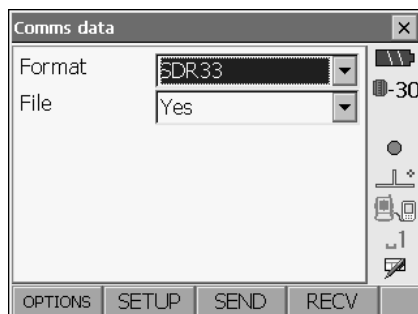


4. Select the JOB to be output by pressing **[SELECT]** or **{←→}**.
Green circle appears to the left of the JOB selected. You can select as many JOBS as you want.

- "●" means the JOB has not been output to an external device yet.

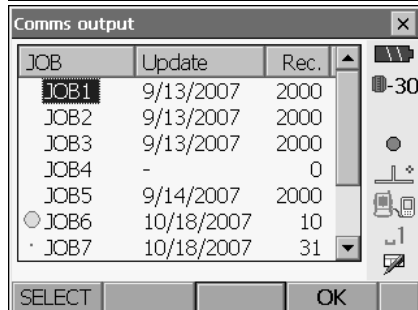


5. Press **[OK]**.



6. Input file name

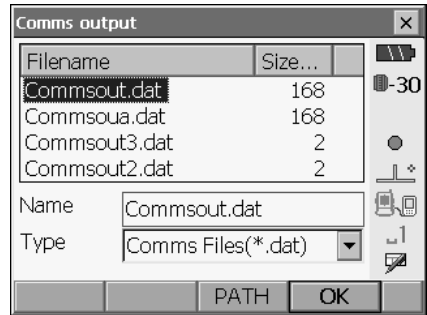

- Press **[PATH]** to specify the filepath. To create a new folder, press **[New Folder]**

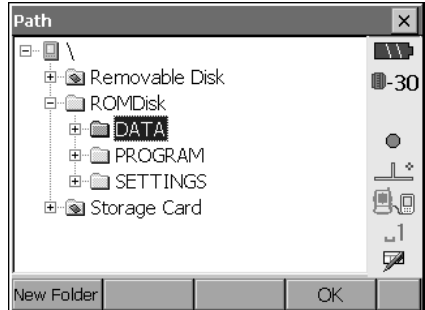7. Press **[OK]** in the screen of step 6 to start output.

- To stop output, press **[STOP]**.


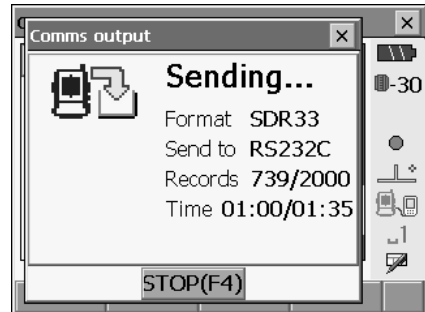
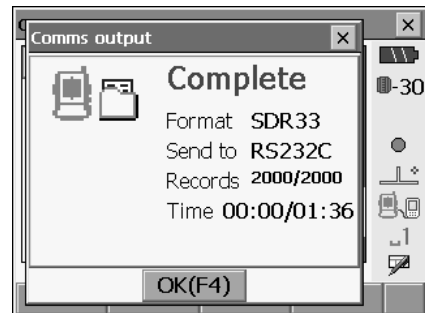
8. Press **[OK]** to return to <Comms data>. It is possible to proceed to output of the next JOB.

29. REGISTERING/DELETING CODE

It is possible to save codes in memory. You can also read in codes registered in memory when recording instrument station data or observation data.


►PROCEDURE Inputting Codes

1. Select "Code" in <Memory>.
Registered codes are displayed.
2. Press **[ADD]** on the second page.
 - Press **[Line]/[Page]** to switch the operation of **{▲}/[▼]** from page scroll to point scroll.
 - Press **[TOP]** to select the first point in the list.
 - Press **[LAST]** to select the last point in the list.
3. Enter the code and press **[OK]**. The code is registered and Code list is restored.

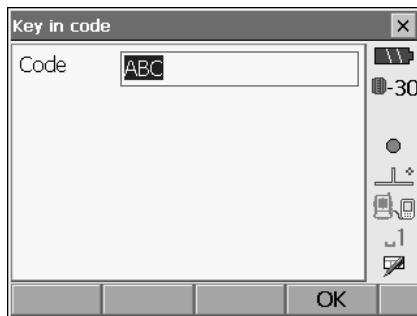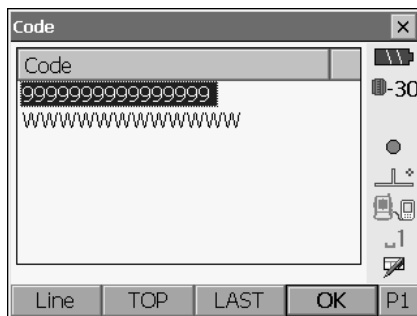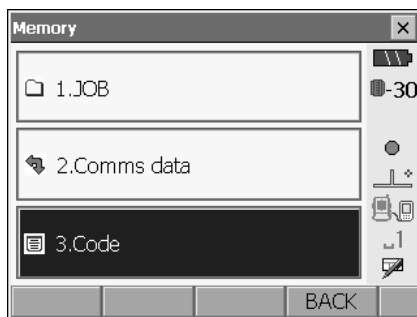

- Maximum code size: 16 (alphanumeric)
- Maximum number of codes registered: 60

- If the same code is input, the following screen is displayed.

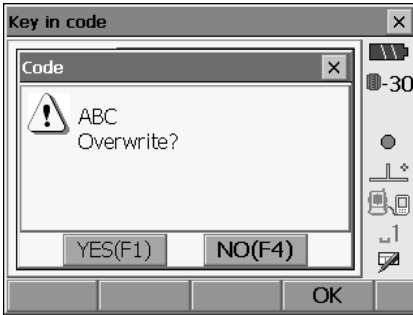


Press **[NO]** to input a new code.

Press **[YES]** to overwrite the present code.

►PROCEDURE Deleting codes

1. Select "Comms data" in <Memory>.
Registered codes are displayed.
2. Align the cursor with the code to be deleted and
press **[DEL]** on the second page.
The selected code is deleted.

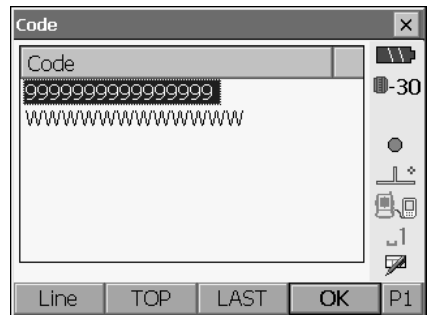

- Press **[DELALL]** on the second page then **[YES]** to delete all codes.




30. CHANGING THE SETTINGS

This section explains the contents of parameter settings in Basic mode and how to change these settings.

Each item can be changed to meet your measurement requirements.


<Configuration> can be accessed by pressing the "CONFIG" icon in <Top>.

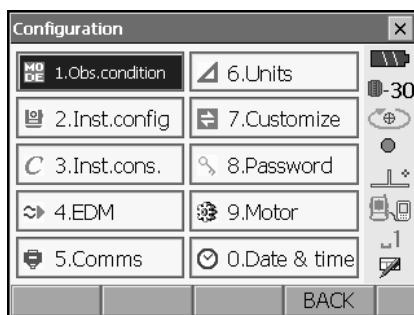

The following chapters provide details of items in Configuration mode.

- Communication settings "13. ANGLE MEASUREMENT"
- Instrument configurations "32.3 Tilt Sensor", "32.5 Reticle"

30.1 Observation Conditions

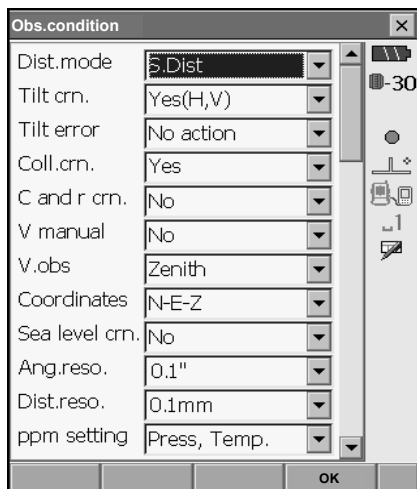

Items set and options (*: Factory setting)

Distance mode:	S.Distance (slope distance)*, H.Distance (horizontal distance), V.Distance (height difference)
Tilt crn (tilt correction)  :	Yes (H,V)*, Yes (V), No
Tilt error:	No action*/Go to Tilt screen
Coll.crn. (collimation correction)  :	No, Yes*
C and r crn.:	No*, K=0.142, K=0.20
V manual:	No*, Yes
V.obs (vertical angle display method)  :	Zenith*, Horiz., Horiz ±90°
Coordinates :	N-E-Z*, E-N-Z
Sea level crn. (Sea level correction)  :	Yes, No*
Ang.reso. (Angle resolution):	0.1", 0.5"
Dist.reso. (Distance resolution):	0.1mm*, 0.01mm
ppm setting:	Press, Temp.*, +Humidity

**Automatic tilt angle compensation mechanism**

The vertical and horizontal angles are automatically compensated for small tilt errors using the 2-axis tilt sensor.

- Read the automatically compensated angles when the display has stabilized.
- The horizontal angle error (vertical axis error) fluctuates according to the vertical axis, so when the instrument is not completely leveled, changing the vertical angle by rotating the telescope will cause the displayed horizontal angle value to change.
- Compensated horizontal angle = Measured horizontal angle + Tilt in angle/tan (Vertical angle)
- When the telescope is directed close to the zenith or nadir angle, tilt compensation is not applied to the horizontal angle.

**Collimation correction**

The MS has a collimation correction function that automatically corrects horizontal angle errors caused by horizontal axis and leveling axis errors.

**Sea level correction**

The MS calculates horizontal distance using slope distance values. As this horizontal distance does not take height above sea level into consideration, performing spherical correction is recommended when measuring at high altitudes. Spherical distance is calculated as follows.

Spherical distance

$$= \frac{R - H_a}{R} \times d_1$$


Where: R = radius of the spheroid (6372.000m)

H_a = averaged elevation of the instrument point and target point


d_1 = horizontal distance



V mode (vertical angle display method)

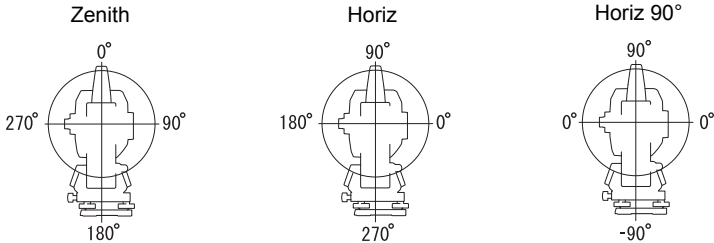

30.2 Instrument Configuration

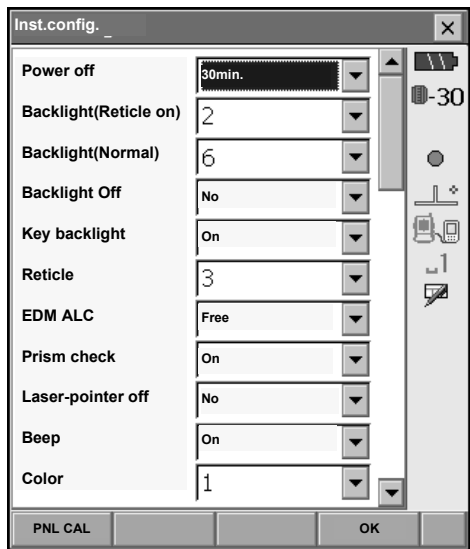

Items set and options (*: Factory setting)

- Power off : No/5min./10min./15min./30min.*
Power off (Remote) : No*/5min./10min./15min./30min.
Backlight (Reticle ON) : 0 to 8 (2*) (Brightness level on pressing {})
Backlight (Normal) : 0 to 8 (6*)
Backlight Off : No*/30sec/1min./5min./10min.
Key backlight : Off/On*
Reticle : 0 to 5 level (3*)
EDM ALC : Free*/Hold
Prism check : On*/Off
Laser-pointer off : No*/1min./5min./10min./30min.
Beep: On*/Off
Color: 1*/2 (monochrome)




- Press **[PNL CAL]** to display the touch panel calibration screen.
- ☞ "10.1 Configuring the Touch Panel"



Adjusting backlight brightness/turning the reticle illumination and key backlight ON/OFF

Pressing switches the brightness level of the backlight in conjunction with the ON/OFF status of the reticle illumination/key backlight.

When the MS is powered ON the brightness level is set to "Backlight (Normal)". "Backlight (Normal)" was set to a higher brightness level than "Backlight (Reticle ON)" when the MS was shipped but these values can be modified according to user preferences.

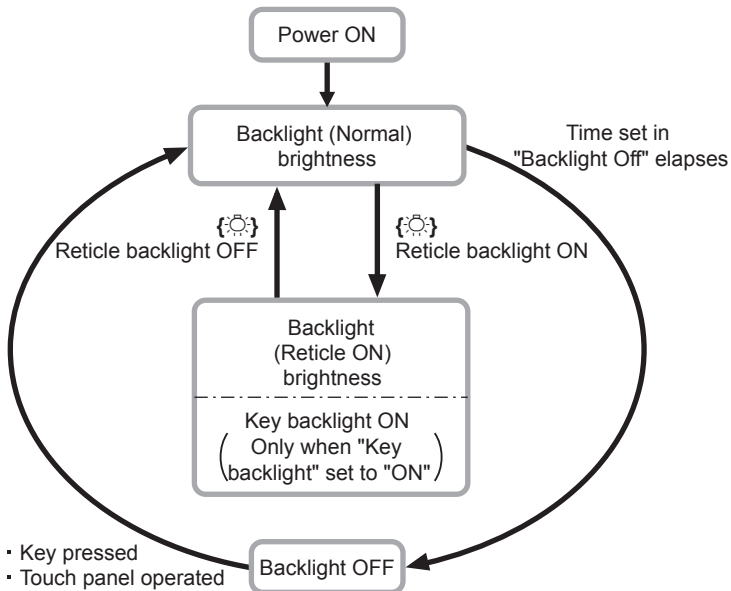

Key backlight

The key backlight can be set to "ON" or "OFF". When "ON" the keys will be illuminated when "Backlight (Bright)" is active.



Power-saving automatic cut-off/Backlight Off

To save power, power to the MS is automatically cut off if it is not operated for the set time. The backlight will similarly be turned off if the instrument is not operated for the selected time. However, the backlight will not be turned off when "Backlight" is set to "ON".



Power-saving automatic cut-off (Power on command)

When turned on using a Power on command, power to the MS is automatically cut off if it is not operated for the set time.



EDM ALC

Set the light receiving status of the EDM. While carrying out continuous measurement, set this item according to the measurement conditions.

- When EDM ALC is set to "Free," the instrument's ALC will be automatically adjusted if an error occurs as a result of the amount of light received. Set to "Free" when the target is moved during measurement or different targets are used.
- When "Hold" is set, the amount of light received will not be adjusted until continuous measurement is completed.
- If an obstacle intermittently obstructs the light beam during continuous measurement and the "Signal off" error occurs, each time the obstruction occurs it takes some time for the amount of light received to be adjusted and the measurement value displayed. Set to "Hold" when the light beam used for measurement is stable but is frequently obstructed by obstacles such as people, cars, or tree branches etc. preventing measurement from being performed.



- When the distance measurement mode is set to "Tracking" (target is moved during distance measurement) the EDM ALC will be adjusted regardless of the EDM ALC setting.



Laser-pointer off

To save power, the laser-pointer is automatically turned off after the set time has elapsed.



Prism check

When using a prism as the target, the user must then select whether or not to check prism conditions for greater accuracy.


When this option is set to "On", returned signal and ALC status are checked before distance measurement is performed. A sighting error occurs when these checks fail.

The default setting is "On".

When this option is set to "Off", returned signal and ALC status are not checked. This setting should be selected when performing distance measurement under conditions that would normally result in a sighting error such as when using a small prism. However, if the sighting axis strays from the center of the prism when set to "Off", accuracy is adversely affected. Always perform Auto Pointing when the prism check option is set to "No".

30.3 EDM Settings

• EDM tab

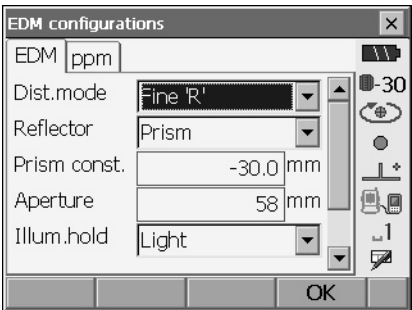

Items set, options, and input range (*: Factory setting)

Dist. mode (Distance measurement mode):	Fine "R"*, Fine AVG n= 2 (Setting: 2 to 9 times), Fine "S", Rapid "R", Rapid "S", Tracking
Reflector:	Prism*/360° Prism/Sheet/Reflectorless
Prism constant:	-99.0 to 99.0 mm ("Prism" is selected: -30.0*, "Sheet" is selected: 0.0)
Illum. hold (☞ function):	Laser-pointer/Light*
Light:	1 to 3 (3*)
Light pattern:	Blink*/On

- The setting for "Fine AVG" distance measurement mode can be increased/decreased using the [+]/[-] softkeys.
- Target information can be edited and recorded.
☞ "PROCEDURE Recording and editing target information"
- "Prism constant" will not be displayed when "Reflectorless" is selected in "Reflector".
- When "prism constant" values are changed and [OK] is pressed, these changes are reflected in the status bar target type display. This display will also change to reflect changes in target information settings made using a data collector. In both of the above cases, changes will not be recorded in <Reflector setting>. To remove added target information from the status bar, perform a cold boot.
☞ Status bar: "5.2 Display Functions", <Reflector setting>: "PROCEDURE Recording and editing target information", Cold boot: "10.2 Resolving Software Issues ☞ Cold boot"
- The Light brightness ("Light") and Light pattern items will not be displayed when "Illum. hold" is set to "Laser-pointer".




Prism constant correction

Reflective prisms each have their prism constant.

Set the prism constant correction value of the reflective prism you are using. When selecting "Reflectorless" in "Reflector", prism constant correction value is set to "0" automatically.

- The following are samples of the prism constant correction values of SOKKIA reflective prisms.

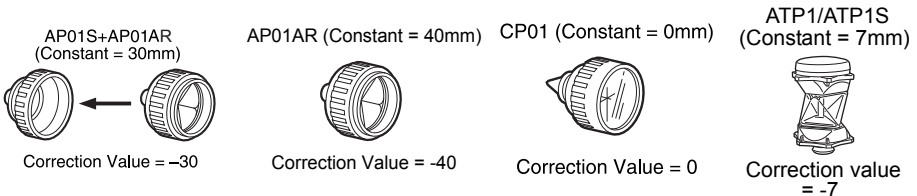

Prism constants and aperture settings can be set for each prism. The prism constant and aperture values displayed in the EDM tab will change to reflect the reflector type selected in "Reflector".

● ppm tab

EDM configurations

EDM ppm

Temperature 15.0 °C

Pressure 1013.0 hPa

Humidity 50.0 %

ppm 0.0

0ppm OK

- **[0ppm]**: Atmospheric correction factor returns to 0 and temperature and air pressure are set to the factory settings.
- Atmospheric correction factor is calculated and set using the entered values of the temperature and air pressure. Atmospheric correction factor can also be entered directly.

Items set, options, and input range (*: Factory setting)

Temperature:	-30.0 to 60.0°C (15.0*), -22.0 to 140.0°F (*)
Pressure:	500.0 to 1400.0hPa (1013.0*), 375.0 to 1050.0mmHg (760.0*), 14.80 to 41.30 inchHg (*)
Humidity:	0.0 to 100.0% (50.0*)
ppm (Atmospheric correction factor):	-499.9 to 499.9 (0.0*)

- The "Humidity" item is displayed only when the "ppm setting" in "Obs. condition" is set to "+Humidity".



Atmospheric correction factor

The velocity of the light beam used for measurement varies according atmospheric conditions such as temperature and air pressure. Set the atmospheric correction factor when you wish to take this influence into account when measuring.

- The MS is designed so that the correction factor is 0.0 ppm at an air pressure of 1013.0 hPa, a temperature of 15.0°C, and a humidity of 50.0%.
- By inputting the temperature, air pressure values and humidity, the atmospheric correction value is calculated using the following formula and set into the memory.

Atmospheric Correction Factor (ppm) =

$$282.324 - \frac{0.294362 \times p}{1 + 0.003661 \times t} + \frac{0.04127 \times e}{1 + 0.003661 \times t}$$

t : Air temperature (°C)

p : Pressure (hPa)

e : Water vapor pressure (hPa)

h : Relative humidity (%)

E : Saturated water vapor pressure

- e (water vapor pressure) can be calculated using the following formula.

$$e = h \times \frac{E}{100} \quad \frac{(7.5 \times t)}{(t + 237.3)}$$

$$E = 6.11 \times 10^{\frac{(7.5 \times t)}{(t + 237.3)}}$$

- The MS measures the distance with a beam of light, but the velocity of this light varies according to the index of refraction of light in the atmosphere. This index of refraction varies according to the temperature and pressure. Near normal temperature and pressure conditions:

With constant pressure, a temperature change of 1.0°C: an index change of 1.0 ppm.

With constant temperature, a pressure change of 3.6 hPa: an index change of 1.0 ppm.

To perform high accuracy measurements, it is necessary to find the atmospheric correction factor from even more accurate temperature and pressure measurements and perform an atmospheric correction.

It is recommended that extremely precise instruments be used to monitor the air temperature and pressure.

- Enter the average temperature, air pressure and humidity along the measurement beam route in "Temperature", "Pressure" and "Humidity".

Flat terrain: Use the temperature, pressure and humidity at the midpoint of the line.


Mountainous terrain: Use the temperature, pressure and humidity at the intermediate point (C).

If it is not possible to measure the temperature, pressure and humidity at the midpoint, take such measurements at the instrument station (A) and the target station (B), then calculate the average value.

Average air temperature: $(t_1 + t_2)/2$

Average air pressure: $(p_1 + p_2)/2$


Average humidity: $(h_1 + h_2)/2$

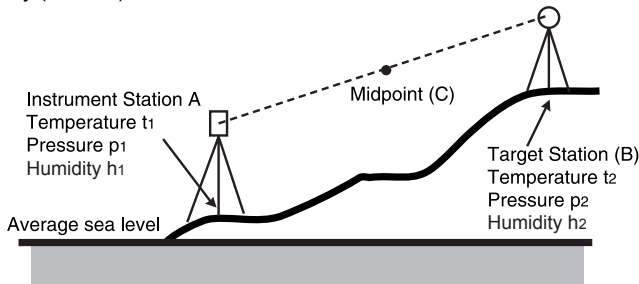

- If the weather correction is not required, set the ppm value to 0.


PROCEDURE Recording and editing target information

The **[LIST]** softkey is displayed when either "Reflector" or "Prism const." is selected in the EDM tab of <EDM configurations>.

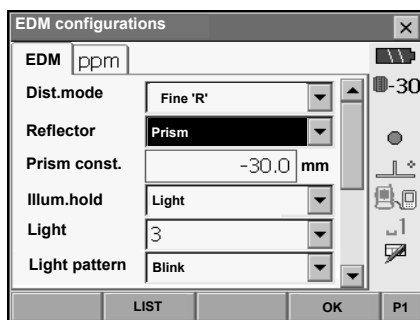

1. Press **[LIST]** to display a list of all recorded targets.


- **[ADD]**: Displays <Reflector list>. Select the desired target from this list and press **[OK]** to register in the list in <Reflector setting>. Up to a maximum of 6 targets can be recorded.
- **[DEL]**: Deletes the selected target.

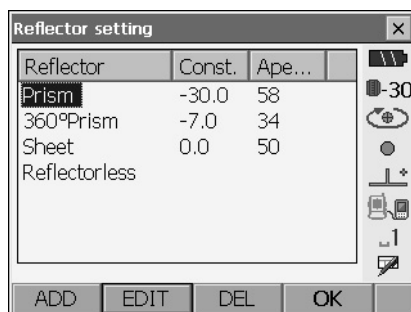

2. To edit a target, select the desired target and press **[EDIT]**. <Reflector/edit> is displayed. Select/input relevant information for the target.

Reflector: Prism/360° Prism/Sheet/
Reflectorless
Const.: -99.0 to 99.0 mm

- When selecting "Reflectorless" in "Reflector", prism constant correction values are set to "0" automatically.

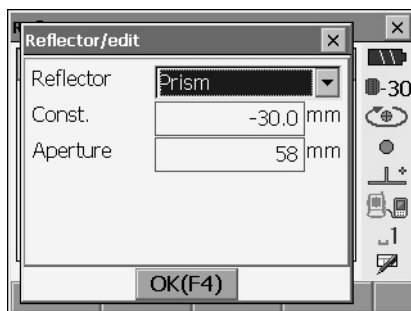

3. Press **[OK]** in the screen of step 2 to save edited information and return to <Reflector setting>. Press **[OK]** to return to <EDM configurations>.

30.4 Allocating User-defined Tabs

It is possible to allocate tabs in Meas mode and Menu mode to suit the measurement conditions. It is possible to operate the MS efficiently because unique tab allocations can be preset to suit various applications and the ways that different operators handle the instrument.

- The current tab allocations are retained until they are revised again, even when the power is cut off.
- Press **[CLEAR]** in <Customize/Select screen> to return all customized configurations including screen controls and softkey allocations to their previous settings.
- One screen can contain a maximum of 5 tabs.



- When tab allocations are recorded and registered, the previously recorded tab settings are cleared.

● Tab allocations

The following are tabs allocated when the MS was shipped and tabs that can be defined by the user.

- Basic measurement

Factory settings	User-definable tabs
SHV	SHV
SHVdist	SHVdist
Graphic	SHV + Coord.

- Setting out


Factory settings	User-definable tabs
Meas.	Meas.
Graphic	

- Setting out Coord.


Factory settings	User-definable tabs
SHV	SHV
NEZ	NEZ
Graph1	
Graph2	

PROCEDURE Allocating tabs

1. Select "Customize" to display <Customize/Select screen>.
Select the measurement mode in which you want to allocate a tab.

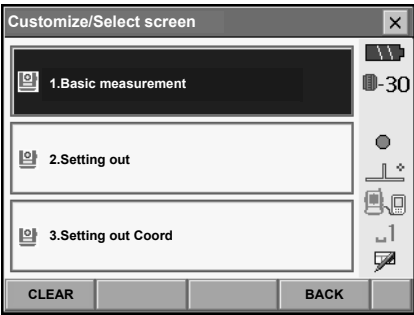


Select "Tab page".

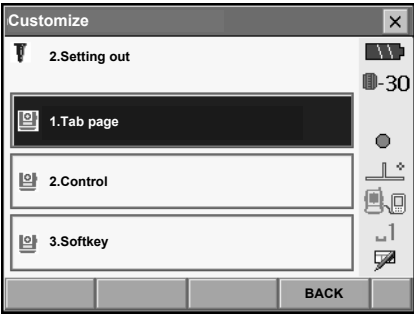

2. Use the softkeys ([ADD], [DEL] etc.) in <Customize tab page> to allocate the desired tab page layout.
- Press **[ADD]** to add the selected tab at the right-hand side of the screen.
 - Press **[INS]** in the second page to insert the selected tab in front of the current tab.
 - Press **[CNFG]** in the second page to replace the current tab with the selected tab.
 - Press **[DEL]** to delete the current tab.



• Tabs, once deleted, cannot be retrieved.

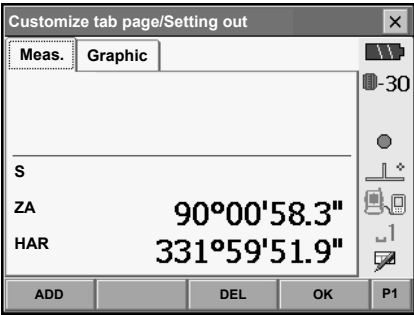

Select a tab type from the "Type" drop-down list.



3. Repeat step 2 to perform further tab allocations.
4. Press **[OK]** to finish allocating tabs. The allocated tabs are stored in memory and <Customize> is displayed. The newly allocated tabs appear in the relevant measurement screen.

30.5 Customizing Screen Controls

It is possible to customize screen controls in Meas mode to suit the measurement conditions and the different methods employed by different operators.


- The current screen control settings are retained until they are revised again, even when the power is cut off.
- Press **[CLEAR]** in <Customize/Select screen> to return all customized configurations including tab pages and softkey allocations to their previous settings.
- Screen controls cannot be set for the Graphic tab.



- When screen control settings are recorded and registered, the previously recorded settings are cleared.

PROCEDURE Customizing screen controls

1. Select "Customize" to display <Customize/Select screen>. Select the measurement mode in which you want to customize screen controls.

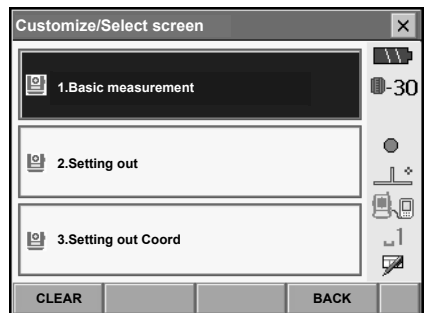

30. CHANGING THE SETTINGS

Select "Control".

- 2. Press **[ADD]** to add a control drop-down list.
 - Press **[DEL]** to delete the selected control.





- Controls, once deleted, cannot be retrieved.

- 3. Select a screen control from the list.

- 4. Press **[CNFG]** to set the size, thickness, color and spacing of the font.

- 5. Repeat steps 2 to 4 to customize more screen controls.

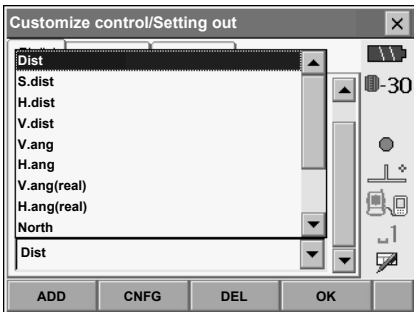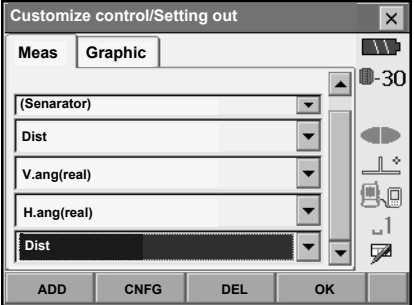

6. Press **[OK]** to finish customizing screen controls.
The modifications are stored in memory and
<Customize> is displayed. The modifications are
reflected in the relevant screens.

30.6 Allocating Key Functions

It is possible to allocate the softkeys in Meas mode to suit the measurement conditions. It is possible to operate the MS efficiently because unique softkey allocations can be preset to suit various applications and the ways that different operators handle the instrument.

- The current softkey allocations are retained until they are revised again, even when the MS is powered OFF.
- Press **[CLEAR]** in <Customize/Select screen> to return all customized configurations including tab pages and screen controls to their previous settings.



- When softkey allocations are recorded and registered, the previously recorded key settings are cleared.
- Softkeys cannot be allocated to Graphic tabs.

● The following are the screens that can be customized and softkey allocations when the MS was shipped.

1. SHV and SHVdist tabs of <Basic measurement>

Page 1 **[AT On]** **[MOTOR]** **[0SET]** **[DIST]**

Page 2 **[SRCH]** **[EDM]** **[H.ANG]** **[COORD]**

Page 3 **[OFFSET]** **[RESEC]** **[REM]** **[S-O]**

2. Meas. tab of <Setting out>

Page 1 **[AT On]** **[shvR]** **[H.ROTA]** **[DIST]**

Page 2 **[CNFG]** **[---]** **[---]** **[REM]**

Page 3 **[---]** **[---]** **[---]** **[---]**

3. SHV and NEZ tabs of <Set out Coords>

Page 1 **[OK]** **[AT On]** **[H.ROTA]** **[DIST]**

Page 2 **[---]** **[---]** **[---]** **[---]**

Page 3 **[---]** **[---]** **[---]** **[---]**

● The following functions can be allocated to the softkeys.

[---] : No functions set

[DIST] : Distance and angle measurement

[H.ROTA] : Rotate MS to the entered horizontal angle. Rotate horizontally to the angle for the setting out point when performing setting out.

[CNFG] : Set setting out accuracy (can only be allocated to 2 above)

[SHV] : Switch Distance input mode between slope distance (S)/horizontal distance (H)/height difference (V). The capitalized letter in the softkey indicates the currently selected mode.


30. CHANGING THE SETTINGS

[/SHVR]	: Switch distance mode between slope distance (S)/horizontal distance (H)/height difference (V)/REM (R) in setting out screens. The capitalized letter in the softkey indicates the currently selected mode (can only be allocated to 2 above).
[OK]	: Terminate setting out measurement for the selected setting out point and return to <Key in coord>. This setting out point will be removed from the list (can only be allocated to 3 above).
[0SET]	: Set horizontal angle to 0°
[H.ANG]	: Set required horizontal angle
[R/L]	: Select horizontal angle right/left. The capitalized letter in the softkey indicates the currently selected mode.
[ZA / %]	: Switch between zenith angle/slope in %. The capitalized letter in the softkey indicates the currently selected mode.
[HOLD]	: Hold horizontal angle/release horizontal angle
[RCL]	: Display final measurement data
[HV out]	: Output angle measurement results to an external device
[HVD out]	: Output distance and angle measurement results to an external device
[ft/M]	: Switch distance units between meters/feet
[HT]	: Set the instrument station, coordinates, instrument height and target height
[AIM]	: Return signal
[TILT]	: Display tilt angle
[MOTOR]	: SETTINGS mode Motor tab
[TURN]	: Rotates MS 180°
[SRCH]	: Automatically sights the center of the target
[RC]	: Rotate in the direction specified by the On-demand Remote Control System
[<-RC]	: Rotate in a counterclockwise direction (from the point of view of the RC-Controller)
[RC->]	: Rotate in a clockwise direction (from the point of view of the RC-Controller)
[RC Cont]	: Nullify the current measurement position and continue Turning operation
[Fix Vel]	: Fixed velocity rotation around vertical and horizontal axes
[AT On]	: Start Auto Tracking ([AT Off] during Auto Tracking)
[EDM]	: EDM settings
[MENU]	: Display <Menu> (coordinate measurement, setting out measurement, offset measurement, REM measurement, missing line measurement, Resection, area calculation)
[COORD]	: Coordinates measurement
[S-O]	: Setting-out measurement
[OFFSET]	: Offset measurement
[A-OFS]	: Angle offset menu
[D-OFS]	: Distance offset menu
[2D-OFS]	: Offset/2D menu
[MLM]	: Missing line measurement
[REM]	: REM measurement
[RESEC]	: Resection measurement
[AREA]	: Surface area measurement


PROCEDURE Allocating a softkey

1. Select "Customize" to display <Customize/Select screen>.


Select the measurement mode in which you want to allocate a softkey.

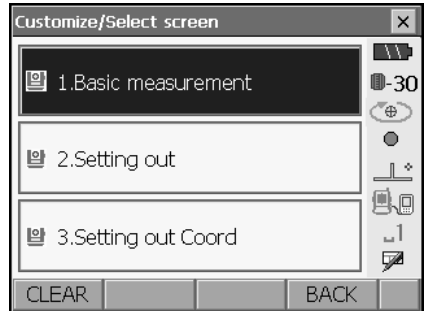

Select "Softkey".

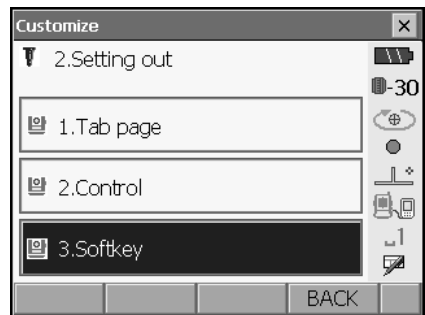

2. Select the desired tab. All softkeys currently allocated to each page of that tab are displayed.

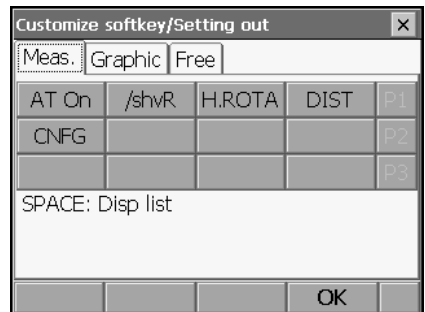


30. CHANGING THE SETTINGS

3. Select the softkey whose allocation you want to change. Tapping a softkey, or pressing **{SPACE}** when the cursor is aligned with a softkey, will display <Softkey list>.



4. Select the desired softkey from <Softkey list> to allocate to the position specified in step 3.
5. Repeat steps 2 to 3 to perform further key allocations.
6. Press **[OK]** to finish allocating keys. The allocated keys are stored in memory and <Customize> is displayed. The newly allocated keys appear in the relevant measurement screen.

30.7 Units

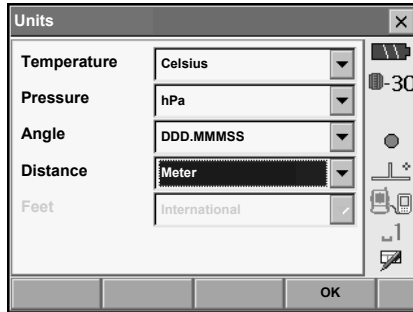

Items set and options (*: Factory setting)

Temperature:	Celsius*/Fahrenheit
Pressure:	hPa*/mmHg/InchHg
Angle:	Degree (DDD.MMMSS)*/Gon/Mil
Distance:	Meter*/Feet/Inch
Feet (only displayed when "Feet" or "Inch" selected above):	International*/US



Inch (Fraction of an inch)

"Fraction of an inch" is the unit used in the United States and expressed like the following example.

10.875 feet → 10-10-1/2 inch



- ① 10.000 feet
- ② 0.875 feet x 12=10.5 inch
- ③ 0.5 inch=1/2 inch



- Even if "inch" is selected in this setting, all the data including the result of area calculation are output in "feet" and all the distance values must be input in "feet". In addition, when the "inch" display exceeds the range, it is displayed in "feet".

30.8 Changing Password

Setting a password allows you to protect important information such as measurement data and e-mail addresses.

No password was set when the MS was shipped. When setting a password for the first time, leave the "Old password" box blank.

When a password has been set, the password screen will appear when the MS is powered ON. Input the password to continue.

Items set

Old password:	Input current password
New password:	Input the new password
New password again:	Input the new password again


- Password can be up to 16 characters in length. Input characters will be displayed as asterisks.
- To deactivate the password function, perform the new password setting procedure but enter a "space" in the "New password" box.



- The password function will not be canceled when a cold boot is performed.
- The password must be input after powering ON the MS from an external device when a password has been set.

"10.3 Powering the MS ON/OFF from an External Instrument"

30.9 Date and Time

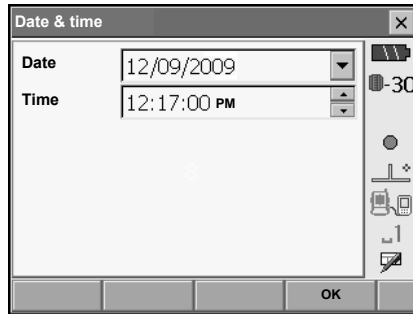

Items set

- Date: Manually input date or select from the drop-down calendar by tapping ▼.
- Time: Manually input time or set using ▲/▼. Pressing {SPACE} will increment the selected section by 1.



Date and Time

The MS includes a clock/calendar function.

30.10 Restoring Default Settings

Perform a cold boot to return all items to factory settings. A cold boot will not erase surveying data in Memory mode. However, if the data in the memory is important, **BE SURE TO TRANSFER IT TO A PERSONAL COMPUTER BEFORE PERFORMING A COLD BOOT.**

To perform a cold boot, while holding {F3}, {F1}, and {BACKSPACE}, press {⏻}. The following message appears.

"All Settings will be cleared. Are you sure?"

Press [YES] to continue. Press {ESC} to cancel.

After [YES] is pressed the instrument powers ON and the screen for configuring the touch panel is displayed. Configure the touch panel to continue.

☞ "10.1 Configuring the Touch Panel"



- The password function will not be canceled.

31. WARNING AND ERROR MESSAGES

The following is a list of the error messages displayed by the MS and the meaning of each message. If the same error message is repeated or if any message not shown below appears, the instrument has malfunctioned. Contact your local dealer.

A new folder cannot be made in this folder !!

A new folder cannot be created in the selected folder. Select a different location.

Backsight Z coord is Null !!

Cannot compute. Backsight Z coord is set to "Null".

Input the coordinate.

Backup battery dead. Clock display may no longer be correct.

The voltage supplied by the lithium battery either declines or is completely discharged. Ask your local dealer to replace the battery for you.

Bad condition

The air is shimmering a lot, etc., measuring conditions are poor.

The center of the target cannot be sighted.

Resight the target.

Unsuitable distance measurement conditions when reflectorless measurement is set. When reflectorless measurement is set, distance cannot be measured because the laser beam is striking at least two surfaces at the same time.

Choose a single surface target for distance measurement.

Bad letter !!

A file name containing special characters such as "*" and "?" is invalid.

Calculation error

During resection measurement the same point is registered multiple times. Set another known point so that the known point coordinates do not coincide.

Coordinates identical to the known point coordinates observed during resection exist.

During route surveying, requirements for the calculation are not met.

During surface area calculation, conditions necessary for calculations are not met. Check conditions and try again.

An error occurred during calculation.

Checksum error !!

A sending/repetition error has occurred between the total station and external equipment.

Send/receive the data again.

Code error !!

Cannot read/write code file.

Coord not found

During cross section survey, the dedicated point number cannot be found.

Data not found !!

No data found corresponding to input point number.

Error: Read Build Info.**Error: Read sysflg****Error: Self check****Error: Read OS Parameter****Error: Write sysflg**

Press **[OK]** to cancel the message. If this error message appears frequently, contact your local dealer.

File does not exist !!

No file exists with the input filename.

Folder already exists !!

The folder name input already exists.

Folder creation error !!

Folder creation failed.

Incorrect password.

Input password does not match set password. Input correct password.

Input over 3 letters !

The input password consists of less than 3 characters. Input a password at least 3 characters in length.

Invalid: Same coords !!

During route surveying, coordinates have not been defined correctly.

During point projection measurement, baseline has not been defined correctly.

It is not possible to save in this folder !!

Data cannot be saved in the selected folder. Select a different save location.

Job data is not developed. Or job may have broken.

Memory mode JOB data lost or cannot be read in. Create JOB data again.

JOB record full !!

No more records can be recorded in the current JOB. Record in a different JOB.

Light detected too strong!!

Sighting has been canceled due to sunlight or extremely strong light entering the telescope along the sighting direction. Avoid such light when performing measurement.

Motor error EXXX

A problem has occurred with the motor drive and operation stops.

Power the MS OFF then ON to correct the problem.

If this error message appears frequently, contact your local dealer.

31. WARNING AND ERROR MESSAGES

Linear !!

The three input points form a straight line.

Load alignment file error !!

Cannot load route data.

Need base pt. obs

During REM measurement, the observation of the target was not completed normally.
Reset and sight the prism and perform measurement again.

Need element !!

During route surveying, parameters are all null, or A1 or A2 is null.

Need 1st obs

During missing line measurement, the observation of the starting position was not completed normally.
Sight the starting position accurately and press **[OBS]** to perform the measurement again.

New password Diff.

During new password setting, the passwords input twice are different. Input new password twice correctly.

No data

When searching for or reading in coordinate data or searching for code data, the search stopped either because the item in question does not exist or the data volume is large.

North/East is null

Coordinates cannot be read in when either the northing or easting value is set to "Null".

No solution

The calculation of the instrument station coordinates during resection does not converge.
Access the results and if necessary, perform the observations again.

Not exist point

When reading in coordinate values during instrument station registration etc., there is no coordinates data registered in the memory and in the selected JOB. Register coordinate data first.

Not define baseline !!

Baseline has not been defined in point projection measurement.

Out of range

During gradient % display, the display range (less than $\pm 1000\%$) has been exceeded.
During REM measurement, either the vertical angle has exceeded horizontal $\pm 89^\circ$ or the measured distance is greater than 9999.999m.
Install the instrument station far from the target.

The instrument station coordinates calculated during resection are too high.
Perform the observation again.

During area calculation, results exceeded the display range.

During point projection, scale factor is less than 0.100000 or exceeds 9.999999.

Please define element !!

No route defined when calculating route in route surveying.

Reflectorless not supported !!

Auto Tracking cannot be performed in reflectorless mode.

Use the prism to carry out automatic sighting.

Receive error !!

Reception failed.

Receive format error !!

Check the received data.

Record error !!

Data cannot be recorded to JOB.

Remote Control communication err !!

Communication between the On-demand Remote Control System RC-Controller and the MS failed. Check the status (communications setup, power supply, cable connections etc.) of the RC-Controller, wireless modem and cables.

Save alignment file error !!

Cannot save route data.

Send error !!

Send failed.

Sheet not supported !!

Auto Tracking cannot be performed with the sheet.

Use the prism to carry out automatic sighting.

Signal off

The reflected light is not observed when distance measurement begins. Or, during measurement, the reflected light has weakened or is blocked.

Either sight the target again or, when using a reflective prism, increase the number of reflective prisms.

Target not found !!

The prism cannot be found within the Search area range.

Reset and sight the prism and perform measurement again.

Temp Rnge OUT

MS is outside useable temperature range and accurate measurement cannot be performed.

Repeat measurement within the appropriate temperature range.

Tilt over range !!

The tilt angle exceeds the tilt angle compensation range of the sensor.

Sight again within $\pm 1'$.

Time out !!

Measurement is not carried out in the allotted time.

Reset and sight the prism and perform measurement again.

When designating the angle of rotation or automatically sighting the prism, there is a problem with the positioning of the prism or the operation of the instrument and measurement is not obtained within the fixed time.

Check the positioning of the instrument and prism and perform measurement again.

If observation is still not possible, sight the target manually.

When the telescope turns to zenith/nadir, it is not possible to search !!

The MS cannot perform a search during Auto Pointing or Auto Tracking when the telescope is directed to the zenith or nadir angle. Set the telescope position within the range 70° (elevation angle) to 40° (depression angle) and perform the operation again.

32. CHECKS AND ADJUSTMENTS

MS is a precision instrument that requires fine adjustments. It must be inspected and adjusted before use so that it always performs accurate measurements.


- Always perform checking and adjustment in the proper sequence beginning from "32.1 Plate Level" to "32.7 Additive Distance Constant".
- In addition, the instrument should be inspected with special care after it has been stored a long time, transported, or when it may have been damaged by a strong shock.
- Make sure the instrument is securely set up and stable before performing checks and adjustments.

32.1 Plate Level

The bubble tube is made of glass, so it is sensitive to temperature changes or to shock. Check and adjust it as outlined below.

PROCEDURE Checking and adjusting

1. Level the instrument and check the position of the bubble of the plate level.
☞ "9.2 Levelling", steps 3 to 5
2. Turn the upper part of the MS through 180° and check the bubble position.
If the bubble is still centered, no adjustment is necessary.
If the bubble is off-center, adjust as follows.
3. Correct half of the bubble displacement using levelling foot screw C.
4. Correct the remaining half of the displacement by using the adjustment pin to rotate the plate level adjustment screw.
When the plate level adjustment screw is turned in the counterclockwise direction, the bubble moves in the same direction.
5. Rotate the top of the instrument and continue adjustments until the bubble remains centered for any position of the upper part.
If the bubble does not move to the center even when the adjustment has been repeated, ask your local dealer to adjust it.

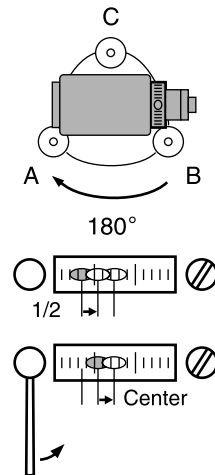

32.2 Circular Level

Check and adjust it as outlined below.



- Be careful that the tightening tension is identical for all the adjusting screws.
- Also, do not over-tighten the adjusting screws as this may damage the circular level.


PROCEDURE Checking and adjusting

1. Perform the plate level inspection and adjustment or carefully use the plate level to level the instrument.
☞ "9.2 Levelling", steps 1 to 2

2. Check the position of the bubble of the circular level.
If the bubble is not off-center, no adjustment is necessary.
If the bubble is off-center, perform the following adjustment.

3. First confirm the off-center direction.
Use the adjusting pin to loosen the circular level adjustment screw on the side opposite to the direction the bubble is displaced to move the bubble to the center.

Circular level
adjusting screws

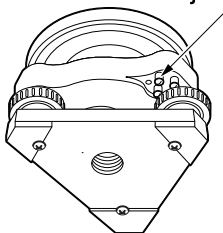


4. Adjust the adjusting screws until the tightening tension of the three screws is the same to align the bubble in the middle of the circle.

32.3 Tilt Sensor

If the tilt angle shown on the display shifts from tilt angle 0° (zero point), the instrument is not correctly levelled. This will adversely affect angle measurement.
Perform the following procedure to cancel the tilt zero point error.

PROCEDURE Checking and adjusting


1. Carefully level the MS. If necessary, repeat the procedures to check and adjust the bubble levels.
2. Select "Inst. cons." in <Configuration>

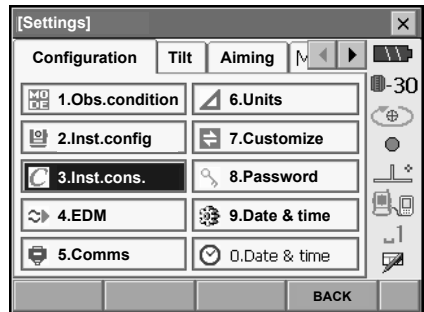

3. Select "Tilt offset".
module


correction constant
in the X (horizontal)
direction

correction constant
in the Y (vertical)
direction

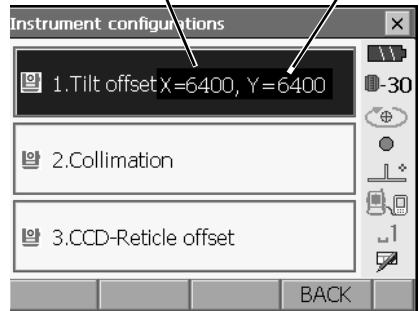

32. CHECKS AND ADJUSTMENTS


4. Level the instrument until the X/Y tilt angles are $\pm 1'$. Wait a few seconds for the display to stabilize, then read the current tilt angle in the X (sighting) direction and Y (horizontal axis) direction.

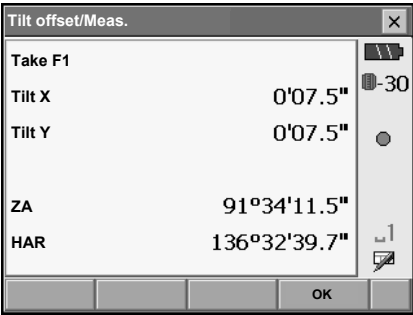

5. Press **[OK]** and rotate the top of the instrument and telescope 180° from the current position.
6. Wait a few seconds for the screen to stabilize, then read the automatically compensated angles X2 and Y2.

7. In this state, calculate the following offset values (tilt zero point error).
 $Xoffset = (X1+X2)/2$
 $Yoffset = (Y1+Y2)/2$


If one of the offset values (Xoffset, Yoffset) exceeds $\pm 10''$, adjust the value using the following procedure.
When the offset value falls within the range $\pm 10''$, adjustment is not necessary.
Press **{ESC}** to return to <Instr. const>.

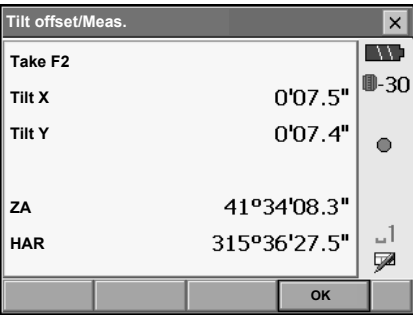

8. Press **[OK]** and rotate the top of the instrument and telescope through 180°.

9. Confirm that the values are in the adjustment range.
If both correction constants are within the range 6400 ± 1440 , select **[YES]** to renew the correction angle. <Instrument configurations> is restored. Continue to step 11.
If the values exceed the adjustment range, select **[NO]** to cancel the adjustment and restore <Instrument configurations>. Contact your local dealer to perform the adjustment.

Results for target point

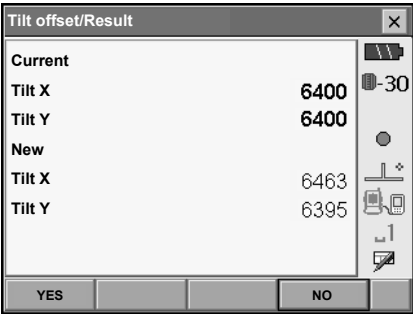

Results for offset point

PROCEDURE Recheck

10. Select "Tilt offset".
11. Wait a few seconds for the display to stabilize, then read the automatically compensated angles X3 and Y3.
12. Press **[OK]** and rotate the top of the instrument and telescope through 180°.
13. Wait a few seconds for the display to stabilize, then read the automatically compensated angles X4 and Y4.
14. In this state, the following offset values (tilt zero point error) are calculated.
 $X_{\text{offset}} = (X3 + X4) / 2$
 $Y_{\text{offset}} = (Y3 + Y4) / 2$
When both offset values fall within the range $\pm 10''$, adjustment is completed.
Press **{ESC}** to return to <Instr. const>.

If one of the offset values (X_{offset} , Y_{offset}) exceeds $\pm 10''$, repeat the check and adjustment procedures from the beginning. If the difference continues to exceed $\pm 10''$ after repeating the check 2 or 3 times, have your local dealer perform the adjustment.

32.4 Collimation

With this option you can measure collimation error in your instrument so that the MS can correct subsequent single face observations. To measure the error, make angular observations using both faces.

PROCEDURE


- 1. Select "Inst. cons." in <Configuration>.
- 2. Select "Collimation".

- 3. Sight the reference point in Face 1 and press [OK]. Telescope rotates and vertical circle is indexed.




- Do not look through the telescope eyepiece while the motor drive is in operation. An eye could be struck by the telescope and cause injury.

- 4. Sight the reference point in Face 2 and press [OK].

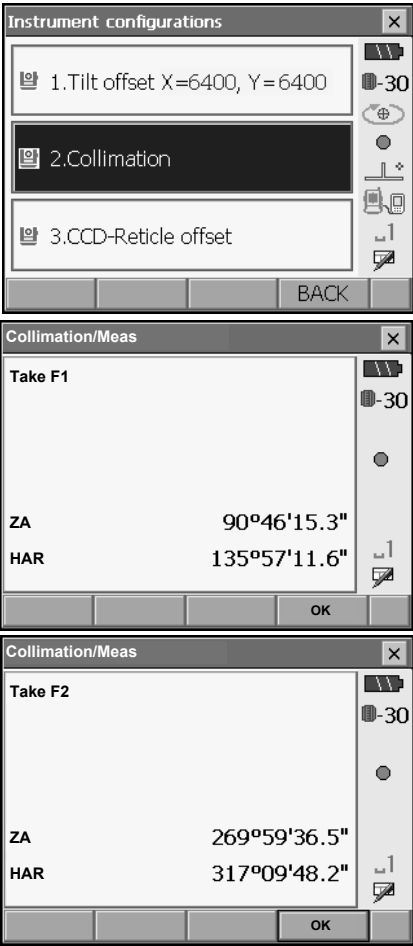

5. Press **[YES]** to set the constant.
- Press **[NO]** to discard the data and return to <Instrument configurations>.

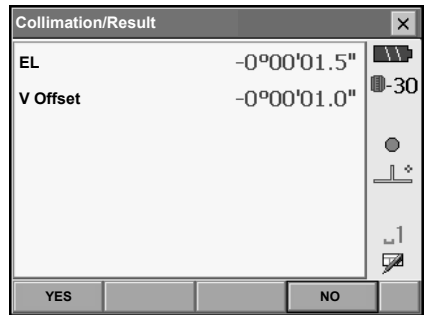

32.5

Reticle


With this option you can check the perpendicularity of the reticle and the horizontal/vertical positions of reticle lines.



- Check the telescope reticle by sighting the target.

PROCEDURE Check 1: Perpendicularity of the reticle to the horizontal axis

1. Carefully level the instrument.
2. Align a clearly visible target (the edge of a roof for example) on point A of the reticle line.
3. Use the fine motion screws to align the target to point B on a vertical line.
If the target moves parallel to the vertical line, adjustment is unnecessary. If its movement deviates from the vertical line, have our service representative adjust it.

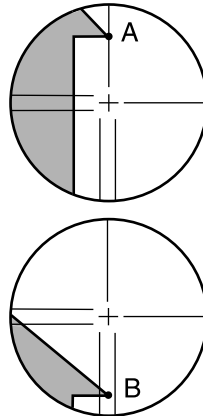

PROCEDURE Check 2: Vertical and horizontal reticle line positions

1. Carefully level the instrument.
2. Install a target at a point about 100m in the horizontal direction from the MS.
3. While the Meas mode screen is displayed and the telescope is in face left, sight the center of the target and read out the horizontal angle A1 and the vertical angle B1.
Example:
Horizontal angle A1 = 18° 34' 00"
Vertical angle B1 = 90° 30' 20"



4. While the telescope is in face right, sight the center of the target and read out the horizontal angle A2 and the vertical angle B2.

Example:

Horizontal angle A2 = $198^{\circ} 34' 20''$

Vertical angle B2 = $269^{\circ} 30' 00''$

5. Do the calculations: A2-A1 and B2+B1

If A2-A1 is within $180^{\circ} \pm 20''$ and B2+B1 is within $360^{\circ} \pm 20''$, adjustment is unnecessary.

Example: A2-A1 (Horizontal angle)

$$= 198^{\circ} 34' 20'' - 18^{\circ} 34' 00''$$

$$= 180^{\circ} 00' 20''$$

B2+B1 (Vertical angle)

$$= 269^{\circ} 30' 00'' + 90^{\circ} 30' 20''$$

$$= 360^{\circ} 00' 20''$$

If the difference is large even after repeating the check 2 or 3 times, have our service representative perform the adjustment.


32.6 Optical Plummet



- Be careful that the tightening tension is identical for all the adjusting screws.
- Also, do not over-tighten the adjusting screws as this may damage the circular level.


PROCEDURE Checking

1. Carefully level the MS and center a survey point precisely in the reticle of the optical plummet.
2. Turn the upper part through 180° and check the position of the survey point in the reticle.
If the survey point is still centered, no adjustment is necessary.
If the survey point is no longer centered in the optical plummet, perform the following adjustment.

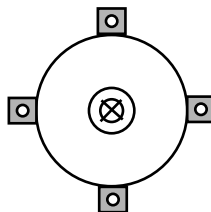

PROCEDURE Adjustment

3. Correct half the deviation with the levelling foot screw.

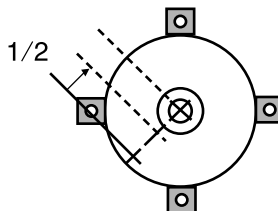


4. Remove the optical plummet reticle cover.


5. Use the 4 adjusting screws of the optical plummet to adjust the remaining half of the deviation as shown below.

When the survey point is on the lower (upper) part of the illustration:

Loosen the upper (lower) adjusting screw slightly, and tighten the upper (lower) adjusting screw the same amount to move the survey point to a point directly under the center of the optical plummet. (It will move to the line in the figure on the right.)

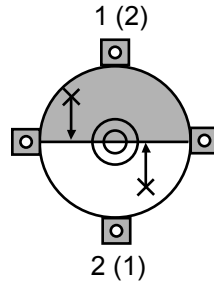

If the survey point is on the solid line (dotted line):
Loosen the right (left) adjusting screw slightly and, tighten the left (right) adjusting screw by the same amount to move the survey point to a point in the center of the optical plummet.

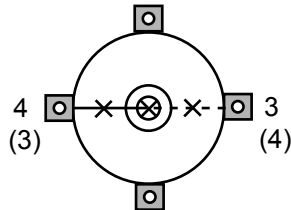

6. Check to make sure that the survey point remains centered on the reticle even if the upper part of the instrument is rotated.
If necessary, perform the adjustment again.
7. Replace the optical plummet reticle cover.

32.7 Additive Distance Constant


The additive distance constant K of the MS is adjusted to 0 before delivery. Although it almost never deviates, use a baseline with a known distance precision to check that the additive distance constant K is close to 0 several times a year and whenever the values measured by the instrument begin to deviate by a consistent amount. Perform these checks as follows.




- Errors in setting up the instrument and reflective prism or in sighting the target will influence the additive distance constant. Be extremely careful to prevent such errors when performing these procedures.
- Set up so that the instrument height and the target height are identical. If a flat place is not available, use an automatic level to make sure the heights are identical.

PROCEDURE Check

1. Find an area of flat ground where two points 100m apart can be selected.
Set up the Instrument at point A and the reflective prism at point B. Establish a point C half way between points A and B.

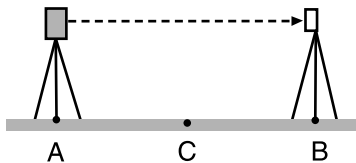

2. Precisely measure the horizontal distance between point A and point B 10 times and calculate the average value.
3. Place the MS at point C directly between points A and B and set up the reflective prism at point A.

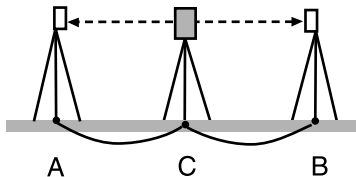

4. Precisely measure the horizontal distances CA and CB 10 times each and calculate the average value for each distance.
5. Calculate the additive distance constant K as follows.
$$K = AB - (CA + CB)$$
6. Repeat steps 1 to 5 two or three times.
If the additive distance constant K is within $\pm 3\text{mm}$ even once, adjustment is unnecessary.
If it always exceeds this range, have our service representative perform an adjustment.

33. POWER SUPPLY SYSTEM


Operate your MS with the following combinations of power equipment.




- When using BDC60, BDC61 and EDC117, mount the BDC58 in place to maintain the balance of the instrument.
- Never use any combination other than those indicated below. If you do, the MS could be damaged.

Those indicated by * are standard accessories. Others are optional accessories (sold separately).


● Battery

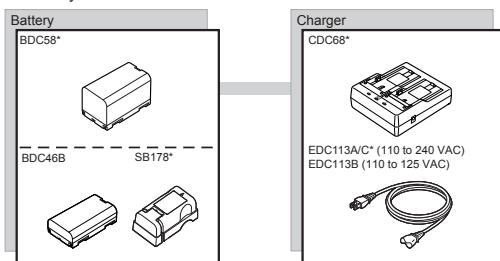

● External battery

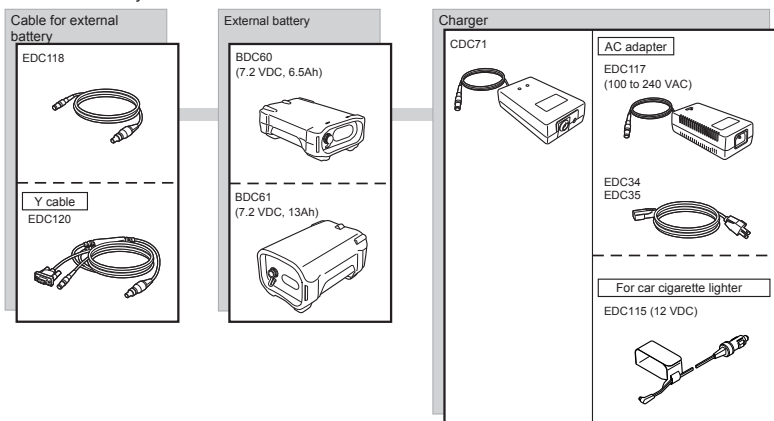

● AC adapter

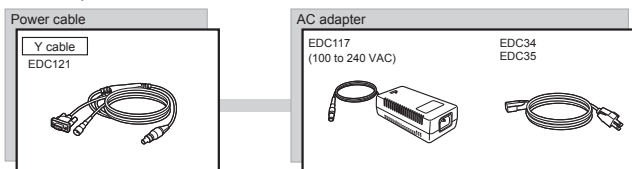

- By using the Y cable the MS can perform RS232C communication (D-sub 9-pin) at the same time as connecting to an external power source.

34. TARGET SYSTEM

- Because all TOPCON reflecting prisms and accessories have standardized screws, it is possible to combine these prisms, accessories, etc. according to your objectives.
- The following are all special accessories (sold separately).

 


- Face the targets towards the MS.

● Reflective sheet target


Prism constant correction value = 0

Plain



RS00-R


Line thickness 0.5mm

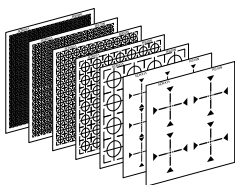

Measuring range


RS10N-R / RS10N-K
RS15N-R / RS15N-K
RS20N-R / RS20N-K
RS30N-R / RS30N-K
RS50N-R / RS50N-K
RS70N-R / RS70N-K
RS90N-R / RS90N-K

Line thickness 0.3mm

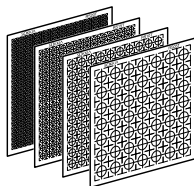

RS10T-R
RS15T-R
RS20T-R
RS30T-R

Line thickness 0.5mm (Half)

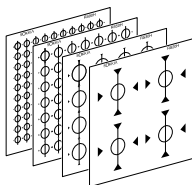


RS20H-R: 2 to 30m
RS30H-R: 2 to 50m
RS50H-R: 2 to 70m
RS90H-R: 2 to 80m

●Rotary targets

Prism constant correction value = 0



 RT50M



RT90M

 
●Anchor grip-type targets

Prism constant correction value = 0



RT30G10


RT50G10



RT90G10


●Two-point targets (2RT310A)

 Prism constant correction value = 0




●High-precision target (RT1A)

 Prism constant correction value = 0



●High-precision reflecting prism (CPS12)

 Prism constant correction value = -27



34. TARGET SYSTEM

● Reflective target (RT90C-K)

Prism constant correction value = 0

Use to Combine AP41, WA series, AP61 and AP61L.

● Rotary target (RT50M)

Prism constant correction value = 0


● Rotary target (RT90M)

Prism constant correction value = 0

● Corner half target plate (TK1)

Prism constant correction value = 0


The half target RS50H-R is attached to the face of the TK1. The TK1 is placed in the corner of the measured objects by using the KUS1.

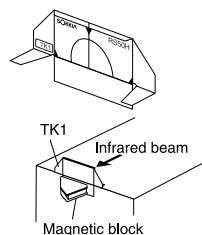

● Half target plate (TK2)

Prism constant correction value = 0

The half target RS50H-R is attached to the face of the TK2. The TK2 is placed on the face of the measured objects by using the KUS1.

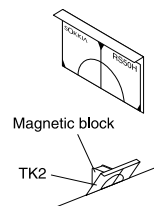


● Magnetic block set (KUS1)

Prism constant correction value = 0

Used to fasten the TK1 or TK2.

 
Shaped at various angles and magnetized on every side, KUS1 makes the target face the instrument almost perpendicular in all conditions.



● Tripod stopper (KUS2)

Prism constant correction value = 0

The tripod can be set up even on the iron plate thanks to the KUS2 as it is fixed to the plate by the use of a magnetic base.

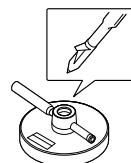


● Reflective prisms

- Because these targets (*2) are coated with fluorescent paint, they reflect when there is little light.




- Each reflective prism (*1) has its own prism constant value. When changing prisms, be sure to change the prism constant correction value.
- To use the triple prism assembly AP31 or AP32 as a single prism for short distance measurements, mount the single reflective prism AP01AR in the center mounting hole of the prism holder.

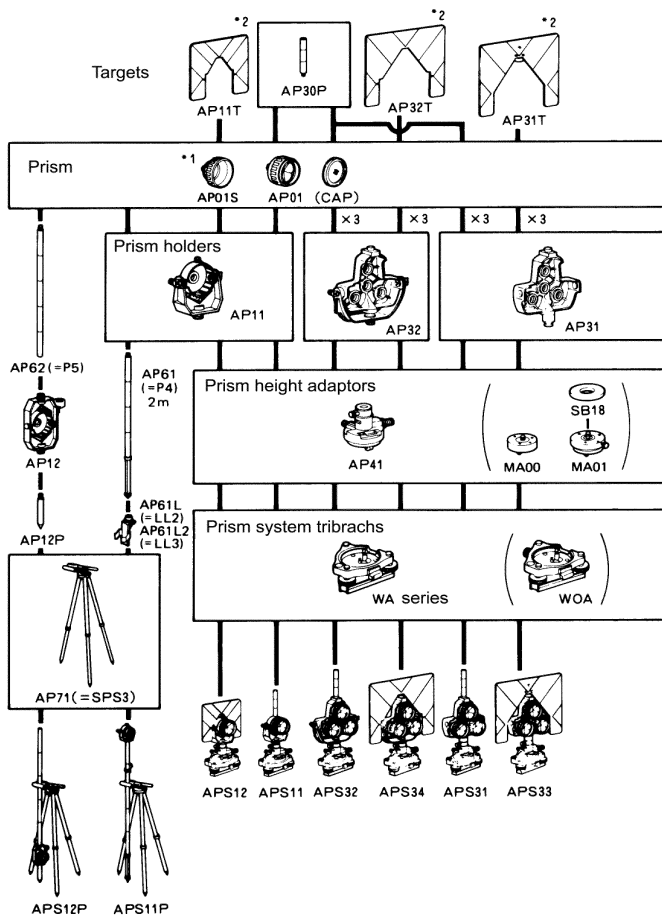

● 2-point target (2RT500-K)

This target is used for two-distance offset measurement.

Prism constant: 0

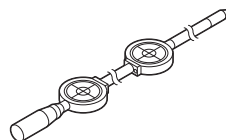

● Instrument height adaptor (AP41)


This device is used to adjust the height of the target.

- When used with the MS, make sure that the instrument height "236" (mm) is displayed in the instrument height adjustment window. For details, see the AP Series operator's manual.
- Adjust the level of the AP41 instrument height adaptor following the checking and adjustment methods of plate level.

🔧 "32.1 Plate Level"

- Adjust the optical plummet of the AP41 instrument height adaptor following the checking and adjustment methods of optical plummet.


🔧 "32.6 Optical Plummet"

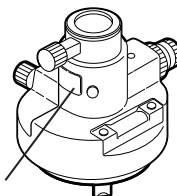

Height
adjustment
window

35. STANDARD EQUIPMENT


Please verify that all equipment is included.

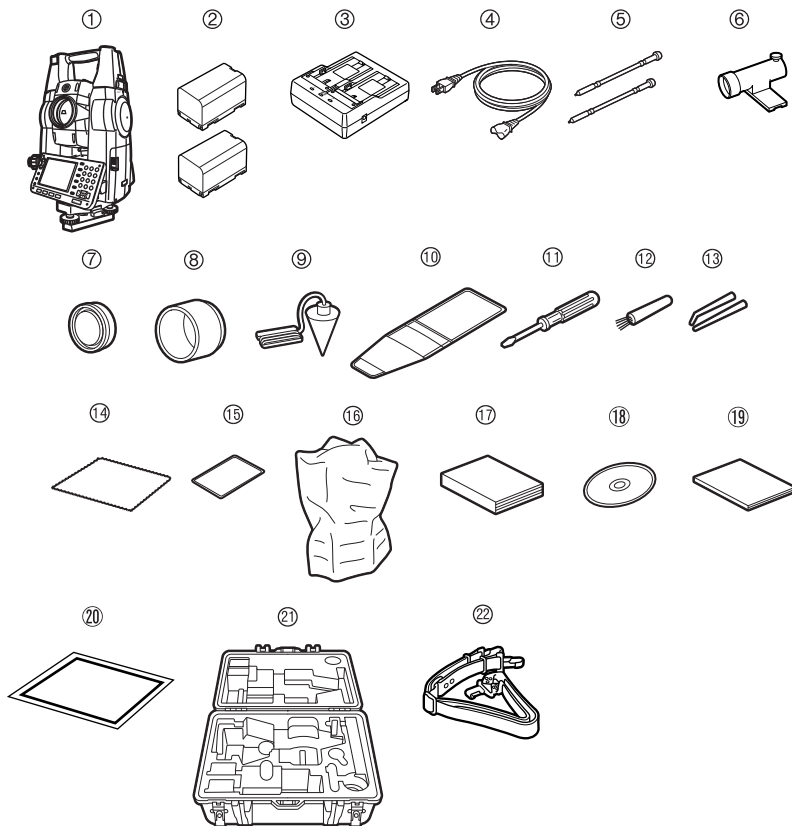

1	MS main unit	1	14	Cleaning cloth	1
2	Battery (BDC58)	2	15	Protective film	1
3	Battery charger (CDC68)	1		(Instrument with optional Face 2 display)	
4	Power cable (EDC113A/113B/113C)	1			2
5	Stylus pen	2	16	Vinyl cover	1
6	Tubular compass (CP9)	1	17	Operator's manual	1
7	Lens cap	1	18	CD-ROM	1
8	Lens hood	1		(operator's manuals)	
9	Plumb bob	1	19	Quick Start Guide (MS05A/MS1A)	1
10	Tool pouch	1	20	Laser caution sign-board (MS1A only)	1
11	Screwdriver	1	21	Carrying case (SC219)	1
12	Lens brush	1	22	Carrying strap	1
13	Adjusting pin	1			

● Tubular compass (CP9)


Slide the tubular compass into the tubular compass slot, loosen the clamp screw, then rotate the top part of the instrument until the compass needle bisects the index lines. The telescope's face 1 sighting direction in this position will indicate magnetic north. After use, tighten the clamp and remove the compass from the slot.

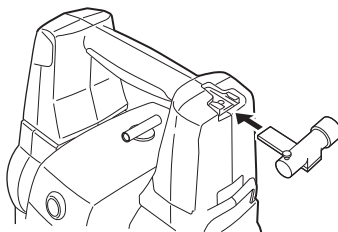

- The tubular compass is susceptible to the influence of nearby magnets or metal. Such influence could cause it to fail to accurately indicate magnetic north. Do not use magnetic north as indicated by this compass for base line surveying.

● Plumb bob

The plumb bob can be used to set up and center the instrument on days when there is little wind. To use the plumb bob, unwind its cord, pass it through the cord grip piece as shown in the figure to adjust its length, then suspend it from the hook attached to the centering screw.

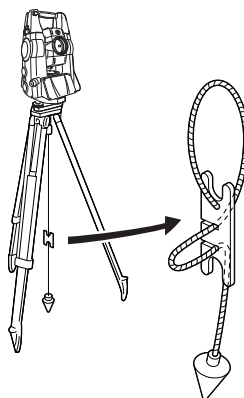

● Protective film (PF1)

PF1 is a protective film for the 3.5 inch (55 x 72.6mm) LCD screen of your surveying instrument. Once applied to the display this film is designed to protect against damage, such as scratching with the stylus pen, during operation. The film will need to be replaced when it becomes scratched or damaged. No residue is left when the protective film is removed.


Applying the film

1. Wipe the display clean of any dust or dirt with the wiping cloth for your surveying instrument. Particles on the display create air bubbles under the film preventing the film sticking properly.

2. Peel off the backing sheet and carefully apply the adhesive side of the film to the display. Make sure no air bubbles are created under the film. In the event that air bubbles enter under the film, peel the film off and start again.



- Make sure the film does not enter the slight clearance gap between the casing and the display. Intrusion of the film into this part of the instrument may cause softkeys to malfunction.
3. When the film has been applied to the display, wipe firmly with the wiping cloth, carefully pushing out any trapped air bubbles.

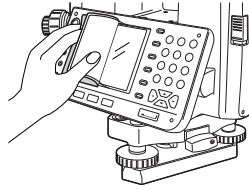

36. OPTIONAL ACCESSORIES

The following are optional accessories which are sold separately from the MS.

 Power supply and target optional accessories: "33. POWER SUPPLY SYSTEM", "34. TARGET SYSTEM".

● Handle

Your MS will come equipped with one of the following handle types upon purchase.


 Removing/attaching the handle; *Bluetooth* antenna; Beam detector for On-Demand Remote Control System: "4.2 Parts of the Instrument"



- Software settings may need to be reconfigured when changing from one handle type to another. Consult your local dealer when changing handles.


- **RC Handle with *Bluetooth* (RC-TS3)**

Incorporates both On-demand Remote Control System/*Bluetooth* functionality

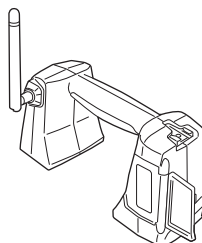


- **Basic Handle (H-BC1)**

Incorporates neither of the functions mentioned above

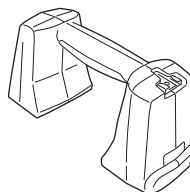


- **RC Handle (RC-TS3A)**

Incorporates On-demand Remote Control System functionality only

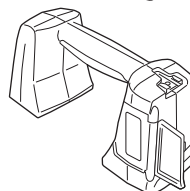

- ***Bluetooth* Handle (H-BT1)**

Incorporates *Bluetooth* functionality only

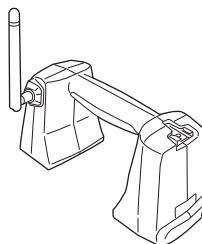

● Telescope eyepiece lens (EL7)

Magnification: 40X


Field of view: 1° 20'

● Diagonal eyepiece (DE27)

The diagonal eyepiece is convenient for observations near the nadir and in narrow spaces.
Magnification: 30X

After removing the handle from the MS loosen the attachment screw to remove the telescope eyepiece. Then screw the diagonal lens into place.


 Handle removal method: "4.2 Removing the handle "

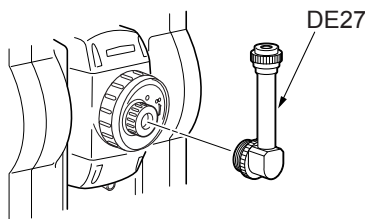

- Do not perform automatic vertical rotation of the telescope when using the diagonal eyepiece. The diagonal eyepiece may strike the MS causing damage.

● Solar filter (OF3A)

When sighting targets where glare is present, solar observations for example, attach it to the objective lens of the MS to protect its interior and the eyes of its operator. The filter part can be flipped up without being removed.

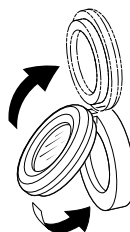

- Do not perform automatic vertical rotation of the telescope when using the solar filter. The solar filter may strike the MS causing damage.

● Diaphragm (DPM1)

A diaphragm must be attached in order to maintain sighting accuracy when measuring with a 38 mm (1.5 inch) Spherically Mounted Retroreflector (SMR). The diaphragm is screwed onto the objective lens. Remove the diaphragm when measuring with a target other than SMR.



- Do not drop the diaphragm when attaching/detaching. Attach/detach with the telescope turned to the zenith.



- SMR measurement with the MS is an optional function. For details contact your local dealer.

● **Interface cable**

Connect the MS to a host computer using the following cables.

Cable	Notes
EDC120 (Y cable)	Pin number and signal level : RS232C compatible
EDC121 (Y cable)	D-Sub connector : 9 pins (female)
DOC129	



- By using the Y cable the MS can perform RS232C communication (D-sub 9-pin) at the same time as connecting to an external power source.
- DOC25/26/27/1 are necessary when connecting EDC120/121 or DOC129 to DOC128.

 
● **On-demand Remote Control System**

This system points the MS in the direction of the prism with speed and precision.

 On-demand Remote Control System Manual



- This system cannot be used with MS instruments incorporating either the H-BC1 or H-BT1 handle.



37. SPECIFICATIONS

Except where stated, the following specifications apply to MS.

Telescope

Length:	173mm
Aperture:	45mm (1.8 inch) (EDM/Auto Tracking :48mm (1.9 inch))
Magnification	30X
Image:	Erect
Resolving power	2.5"
Field of view	1°30' (26m/1,000m)
Minimum focus:	1.3m (4.3ft)
Focussing screw:	1 speed
Reticle illumination:	5 brightness levels

Angle measurement

Horizontal and Vertical circles type:	Rotary absolute encoder scanning
IACS (Independent Angle Calibration System)	Yes
Angle units:	Degree/Gon/Mil (selectable)
Minimum display:	0.1"(0.00002gon/0.0005mil)/0.5" (0.0001gon/0.002mil) (selectable)
Accuracy (ISO 17123-3 : 2001):	MS05A: 0.5" (0.00015gon/0.0025mil) MS1A: 1" (0.0003gon/0.005mil)
Collimation compensation:	On/Off (selectable)
Measuring mode:	
Horizontal angle:	Right/Left (selectable)
Vertical angle:	Zenith/Horizontal/Horizontal $\pm 90^\circ$ /% (selectable)

Tilt angle compensation

Type:	Liquid 2-axis tilt sensor
Minimum display	Same as setting for angle measurement
Range of compensation	$\pm 4'$ (± 0.0741 gon)
Automatic compensator	ON (V & H/V)/OFF (selectable)
Compensation constant	Can be changed

Distance measurement

Measuring method:	Coaxial phase-contrast measuring system
Signal source:	Red laser diode 690nm
	MS05A: Class 2
	MS1A: Class 3R
	(IEC60825-1 Amd. 2: 2001/FDA CDRH 21CFR Part1040.10 and 1040.11 (Complies with FDA performance standards for laser products except for deviations pursuant to Laser Notice No.50, dated July 26, 2001.))
	(When the prism, reflective sheet, or SMR is selected in Config mode as target, the output is equivalent to Class 1).
Measuring range:	(Using SOKKIA reflective prism/reflective sheet target under good atmospheric conditions *1)
MS05A:	
Compact prism CP01AR	1.3 to 800 m (2,625ft)
Reflective sheet RS50N-R	1.3 to 200 m (656.2ft)
Standard prism AP01AR X1	1.3 to 3,500 m (11,483ft)

37. SPECIFICATIONS

Reflectorless (White)* ²	0.3 to 40m (131.2ft)
MS1A:	
Compact prism CP01AR	1.3 to 1,000 m (3,281ft)
Reflective sheet RS50N-R	1.3 to 300 m (984.2ft)
Standard prism AP01AR X1	1.3 to 3,500 m (11,483ft)
Reflectorless (White)* ³	0.3 to 200m (656ft)
Reflectorless (Gray)* ⁴	0.3 to 100m (328.1ft)
Minimum display	
MS05A:	
Fine/Rapid measurement: 0.00001 m (0.0001ft/ 1/64 inch)/0.0001 m (0.001ft/ 1/16 inch) (selectable)	
Tracking measurement: 0.0001 m (0.001ft/ 1/16 inch)	
MS1A:	
Fine/Rapid measurement: 0.0001 m (0.001ft/ 1/16 inch)/0.001 m (0.01ft/ 1/8 inch) (selectable)	
Tracking measurement: 0.001 m (0.01ft/ 1/8 inch)	
Maximum slope distance display:	19,200.0000 m (using prism, reflective sheet target or SMR), 800.0000 m (reflectorless measurement)
Distance unit:	m/ft/US ft/inch (selectable)
Accuracy:	(ISO 17123-4 : 2001, Fine measurement)
MS05A:	
Using prism (AP/CP/SMR)* ⁵ :	(0.8 + 1 ppm X D) mm
Using reflective sheet target RT1A (when facing the target):	(0.5 + 1 ppm X D) mm
Reflectorless* ² (when facing the target):	(1 + 1 ppm X D) mm
MS1A:	
Using prism (AP/CP):	(1 + 1 ppm X D) mm
Using reflective sheet target RT1A (when facing the target):	(1 + 1 ppm X D) mm
Reflectorless* ³ :	(3 + 1 ppm X D) mm
(D: measurement distance; Unit: mm; Under good atmospheric conditions* ¹)	
Measurement mode:	Fine measurement (single/repeat/average)/Rapid measurement (single/repeat)/Tracking (selectable)
Measuring time (fastest time under good atmospheric conditions* ¹ , no compensation, EDM ALC at appropriate setting, slope distance):	
Fine measurement	2.4 sec or less + every 0.9 sec or less
Rapid measurement	2.0 sec or less + every 0.6 sec or less
Tracking measurement	1.3 sec or less + every 0.4 sec or less
Atmospheric correction Temperature, pressure, humidity input/ppm input (selectable):	
Earth curvature and refraction correction:	No/Yes K=0.14/Yes K=0.20 (selectable)

*¹: No haze, visibility about 40 km, overcast, no scintillation.

*²: Figures when using Kodak Gray Card White side (reflection factor 90%) and brightness level is less than 5000 lx.

*³: Figures when using Kodak Gray Card White side (reflection factor 90%) and brightness level is less than 30000 lx (a little cloudy).

*⁴: Figures when using Kodak Gray Card Gray side (reflection factor 18%) and brightness level is less than 30000 lx (a little cloudy).

*⁵: Figures when using an SMR with aperture of 38 mm (1.5 inch), and optional accessory Diaphragm (DPM1) attached to the objective lens.

Auto Tracking

Measuring method	Pulse laser transmitter and CCD detector with co-axial optics
Signal source (emitted beam)	infrared laser diode (830nm)
	Class 1 (IEC60825-1 Amd. 2: 2001/FDA CDRH 21 CFR Part 1040.10 and 1040.11 (Complies with FDA performance standards for laser products except for deviations pursuant to Laser Notice No.50, dated July 26, 2001.))
Viewing angle:	± 45°
Measuring range:	H: 360° (full transit) V: Elevation angle 70°, Depression angle 40°
Maximum Auto Tracking measurement range* ⁶ :	360° Prism ATP1/ATP1S* ⁹ : 500m (1,640 ft) Mini pole prism OR1PA: 400 m (1,312 ft) Compact prism CP01AR: 600 m (1,969 ft) Standard prism AP01AR: 800m (2,625 ft)
Auto Tracking speed* ⁶	14°/sec (Prism moving at 5m/sec. at 20m distance)

Auto Pointing

Measuring method	Pulse laser transmitter and CCD detector with co-axial optics
Signal source (emitted beam)	infrared laser diode (830nm)
	Class 1 (IEC60825-1 Amd. 2: 2001/FDA CDRH 21 CFR Part 1040.10 and 1040.11 (Complies with FDA performance standards for laser products except for deviations pursuant to Laser Notice No.50, dated July 26, 2001.))
Measuring range:	H: 360° (full transit) V: Elevation angle 70°, Depression angle 40°
Auto Pointing measurement range* ⁶ :	360° Prism ATP1/ATP1S* ⁹ : 600m (1,969 ft) Mini pole prism OR1PA: 500 m (1,640 ft) Compact prism CP01AR: 700 m (2,297 ft) Standard prism AP01AR: 1,000 m (3,281 ft) Reflective sheet RS50N-R* ⁷ , * ⁸ : 50m (164 ft)
Minimum Auto Pointing measurement range:	Mini pole prism OR1PA/Compact prism CP01AR: 1.3 m Standard prism AP01AR/360° Prism ATP1/ATP1S* ⁹ : 2 m Reflective sheet RS50N-R* ⁷ : 5 m
Time to completed Auto Pointing* ⁶	(When prism or SMR in field-of-view, at 100m distance. When reflective sheet target (RS50N-R) in field-of-view, at 50m distance) When "Standard" is selected in Centering mode and "Fine" or "Rapid" is selected in Accu. Search. 4 to 10 sec. When "Advanced" is selected in Centering mode and "Rapid" is selected in Accu. Search. 4 to 11 sec.

37. SPECIFICATIONS

	When "Advanced" is selected in Centering mode and "Fine" or "Rapid" is selected in Accu. Search.
	4 to 16 sec.
Sighting accuracy (standard deviation)*6	(When "Standard" is selected in Centering mode and "Fine" is selected in Accu. Search)
Prism/SMR*5 *10:	1.5 mm or less (to 100 m), 3" or less (100 m and over) (e.g.:1.5mm at 100m distance)
360° Prism ATP1/ATP1S:*9:	2 mm or less (to 100 m), 3" or less (100 m and over)
Reflective sheet RS50N-R*7 *8:	2 mm (to 50 m)
	(When "Advanced" is selected in Centering mode and "Fine" is selected in Accu. Search)
Prism/SMR*5 *10:	1.0 mm or less (to 100 m), 2" or less (100 m and over)

- *6: No haze, visibility over 20 km, slightly overcast (less than 30000 lx), no scintillation.
- *7: Figures when the Auto Pointing beam strikes within 15° of the reflective sheet target and when contrast exists between the reflective sheet target and its background during indoor operation.
- *8: When using a reflective sheet for Auto Pointing, the size of sheet (10 to 50 mm) must be selected to correspond to the distance being measured. Use smaller reflective sheets for shorter distances.
- *9: Figures when both the elevation and depression angles of the laser beam are within 15° and the MS is facing the 360° Prism.
- *10: When using SMR: Figures when the distance measurement/Auto Pointing beam strikes within 10° of the square alignment position.

Motor

Type	DC motor drive
Motion range	360°(Vertical and horizontal)
Rotation speed	45°/sec (at 20°C) (Rotating time (when rotating 180°, tilt compensation off, at 20°C) MS05A: about 12 sec. (when 0.1" is selected), about 10 sec. (when 0.5" is selected) MS1A: about 10 sec. (when 0.5" is selected), about 12 sec. (when 0.1" is selected))
Fine motion	Jog dials
Setting accuracy (after rotation to specified angle)	± 5" (no tilt compensation, no vibration, wind, or influence of other external factors)
Overcurrent detection function	Yes

Light

Light source:	LED (white) Class 1 (IEC60825-1 Amd. 2: 2001/FDA CDRH 21 CFR Part 1040.10 and 1040.11 (Complies with FDA performance standards for laser products except for deviations pursuant to Laser Notice No.50, dated July 26, 2001.))
---------------	--

Visible range:	Right and Left/Upward and Downward: ± 45° or more
Brightness:	3 levels (bright/normal/dim)
Light pattern	Blink/On (selectable)
Collimation axis offset	46.3 mm

Laser-guide (LSP1) (option)

Signal source (emitted beam):	Red laser diode (635nm) Class 3R (IEC60825-1 Amd. 2: 2001)
Visible range:	400m (in daylight), 700m (at night)
Beam diameter (not including interference fringes)	About ø30mm at 200m About ø50mm at 300m About ø60mm at 400m About ø80mm at 700m
Collimation axis offset:	71.3mm
Brightness:	10 levels

Internal memory

Capacity	64 MB (including a minimum of 1MB for data storage)
----------	---

External memory

CF card (up to 4 GB, 3.3V type only)
USB flash memory (up to 4 GB)

Data transfer

Data input/output	Asynchronous serial, RS232C compatible
USB	USB Ver. 1.1, Host (Type A) and Client (Type miniB)
Card slot	Compact Flash Type II-compatible
SFX Dial-Up function	Yes

Handle

On-demand Remote Control System Beam Detector (RC-TS3/RC-TS3A handles)

Operable range (Slope distance when using RC-PR4 under normal atmospheric conditions^{*11})

Standard mode	2 ^{*12} to 100 m ^{*13}
Far mode	2 ^{*12} to 250 m ^{*14} 2 ^{*12} to 300 m ^{*13}

Maximum detecting area (vertical angle)
-40° to +30° (on the basis of horizontal direction)

- ^{*11}: Slight haze, visibility about 20km, sunny periods, weak scintillation
- ^{*12}: When there is almost no vertical interval between instrument height and the target height, MS instrument height is 1.5 m, target height is 0.10 m at a horizontal distance of 1.8 m
- ^{*13}: When the vertical interval between MS and the beam emitter of RC-PR4 is no more than 20m
- ^{*14}: When the vertical interval between MS and the beam emitter of RC-PR4 is no more than 40m

37. SPECIFICATIONS

On-demand Remote Control System Turning operation time (RC-TS3/RC-TS3A handles)
Less than 15 sec (until completion of rapid (single) measurement when "Accu. search" set to "Rapid")

Bluetooth wireless communication (RC-TS3/H-BT1 handles)
BT Qualification ID B03489
Transmission method: FHSS (*Bluetooth* Specification Ver.1.2 compatible, Telec-approved)
Modulation: GFSK
Frequency band: 2.402 to 2.48GHz
Bluetooth profile SPP, DUN
Power class Class 1
Usable range to 300m (When using SWT9)
(No obstacles, few vehicles or sources of radio emissions/interference in the near vicinity of the instrument, no rain)
Authentication Yes/No (selectable)

Power Supply
Power source: Rechargeable Li-ion battery BDC58
Working duration at 20 °C (Fine distance measurement (single) using Auto Pointing, repeated every 30 sec in both Face 1 and Face 2):
BDC58: about 3 hours
BDC60 (external battery, optional accessory): about 4.5 hours
BDC61 (external battery, optional accessory): about 9 hours
Battery state indicator 4 levels
Auto power-off: 5 levels (5/10/15/30 min/Not set) (selectable)
Remote PWR-On function Yes (Via serial or *Bluetooth* connection (when RC-TS3/H-BT1 attached). (*Bluetooth* connection: up to 30 min only))
External power source: 7.2 to 12V
Required power 36 W (power ON)

Battery (BDC58)
Nominal voltage 7.2V
Capacity 4300mAh
Dimensions 38 (W) x 70 (D) x 40 (H) mm
Weight about 195g

Charger (CDC68)
Input voltage: AC100 to 240V
Charging time per battery (at 25°C):
BDC58: about 4 hours
(Charging can take longer than the times stated above when temperatures are either especially high or low.)
Charging temperature range: 0 to 40°C
Storage temperature range: -20 to 65°C
Size: 94 (W) X 102 (D) X 36 (H) mm
Weight: about 170g


General
Operating system Windows CE Ver. 5.0
Display: 3.5 inch Transflective TFT QVGA color LCD
Backlight LED: 0 to 8 (6*) (selectable)

Touch panel	Resistance-sensitive analog type
Keyboard	32 keys (power, edit, direct, cursor, numeric, soft function, operations, power on, light)
Key backlight	Yes
Trigger key	Yes (right side)
Sensitivity of levels	
Plate level	20"/2 mm
Circular level	10"/2 mm
Optical plummet	
Image	Erect
Magnification	7X
Minimum focus	0.3 m
Calendar/clock function	Yes
Laser-pointer function	ON/OFF (selectable)
Laser radiation warning indicator	Yes (lit continuously while laser emitted)
Operating temperature	-10 to 50°C (no condensation)
Storage temperature range	-30 to 70°C (no condensation)
Dust and water resistance	IP64 (IEC 60529:2001)
Instrument height	236 mm from tribrach bottom
Instrument size	201 (W) X 202 (D) X 375 (H) mm (display on Face1 only, handle attached, excluding protruding sections) 201 (W) X 220 (D) X 375 (H) mm (display on each face, handle attached, excluding protruding sections)
Handle size (RC-TS3/H-BC1/RC-TS3A/H-BT1)	180 (W) X 68 (D) X 86 (H) mm
Instrument weight (with battery and RC-TS3)	
Display on one side	7.7 kg (17.0 lb) 8.0 kg (17.6 lb) (with LSP1)
Display on both sides	7.8 kg (17.2 lb) 8.2 kg (18.1 lb) (with LSP1)
(with battery and H-BC1)	
Display on one side	7.6 kg (16.8 lb)
Display on both sides	7.7 kg (17.1 lb)
Handle weight	
RC-TS3	550g (1.2 lb)
H-BC1	447g (1.0 lb)
RC-TS3A	504g (1.1 lb)
H-BT1	478g (1.1 lb)


38. EXPLANATION

38.1 High Accuracy with the 360° Prism

Sighting can be more accurately performed by facing the 360° Prism toward the MS. The 360° Prism should be set up so that a pair of diametrically-opposed hexagonal points on its rubber flanges are aligned with the sighting direction of the MS (see the diagram below).

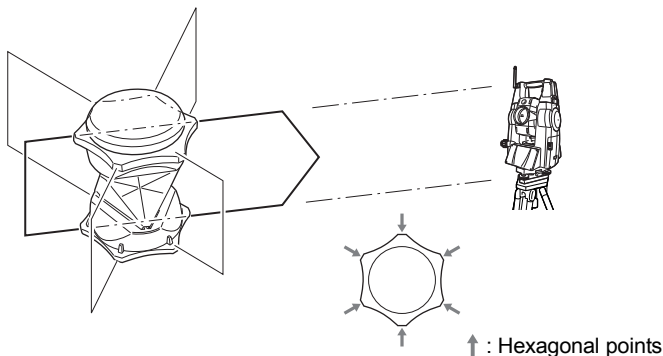

When using the ATP1S, the 360° Prism should be set up so that a pair of diametrically-opposed marks on top of the prism are aligned with the sighting direction of the MS.

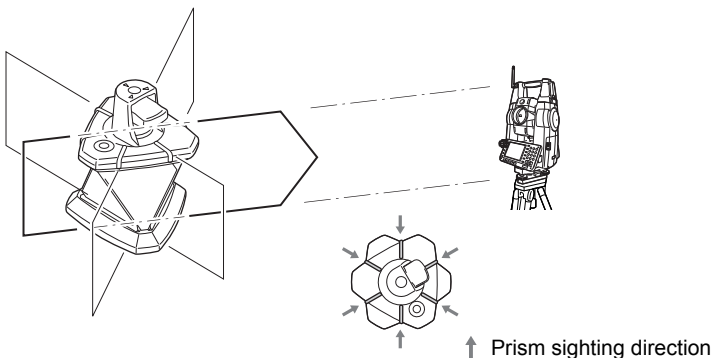

38.2 Manually Indexing the Vertical Circle by Face Left, Face Right Measurement

The 0 index of the vertical circle of your MS is almost 100% accurate, but when it is necessary to perform particularly high precision angle measurements, you can eliminate any inaccuracy of the 0 index as follows.




- If the power is cut off, the vertical circle indexing is ineffective. Do it again every time the power is turned on.
- When indexing the vertical circle, sight the target manually.


PROCEDURE

1. Select "Obs.condition" in <Configuration>. Set "V manual" (vertical circle indexing method) to "Yes".
 "30.1 Observation Conditions"

<V manual 0 set> is displayed.

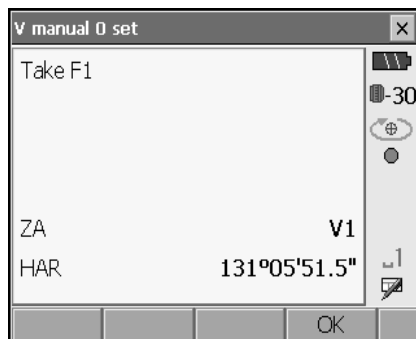

2. Carefully level the instrument.
3. Accurately sight a clear target with a distance of about 30m in the horizontal direction with the telescope in face left.
Press **[OK]**. The MS rotates 180°.
4. Accurately sight the same target and press **[OK]** to rotate the MS 180°. The vertical angle is displayed.
This concludes the vertical circle indexing procedure.

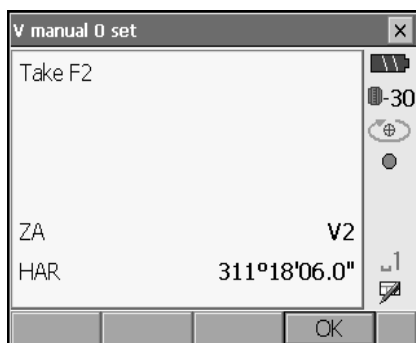

39. REGULATIONS

Users must ensure that their instrument is compliant with the relevant regulations and legal restrictions in place in the country of use.

For users in the US

WARNING: Changes or modifications to this unit not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

NOTE: This equipment has been tested and found to comply with the limits for a Class A digital device pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.

This transmitter must not be co-located or operated in conjunction with any other antenna or transmitter.

This equipment complies with FCC radiation exposure limits set forth for uncontrolled equipment and meets the FCC radio frequency (RF) Exposure Guidelines in Supplement C to OET65. This equipment has very low levels of RF energy that is deemed to comply without maximum permissive exposure evaluation (MPE). But it is desirable that it should be installed and operated with at least 20cm and more between the radiator and person's body (excluding extremities: hands, wrists, feet and ankles).

For users in Canada

This Class A digital apparatus meets all requirements of Canadian Interference-Causing Equipment Regulations.

Cet appareil numérique de la Class A respecte toutes les exigences du Règlement sur le matériel brouilleur du Canada.

This class A digital apparatus complies with Canadian ICES-003.

Cet appareil numérique de la classe A est conforme à la norme NMB-003 du Canada.

Operation is subject to the following two conditions: (1) this device may not cause interference, and (2) this device must accept any interference, including interference that may cause undesired operation of this device.

This equipment complies with IC radiation exposure limits set forth for uncontrolled equipment and meets RSS-102 of the IC radio frequency (RF) Exposure rules. This equipment has very low levels of RF energy that is deemed to comply without maximum permissive exposure evaluation (MPE). But it is desirable that it should be installed and operated with at least 20cm and more between the radiator and person's body (excluding extremities: hands, wrists, feet and ankles).

For users in the European Economic Area (EEA)



EMC NOTICE
In industrial locations or in proximity to industrial power installations, this instrument might be affected by electromagnetic noise. Under such conditions, please test the instrument performance before use.

A

Adjusting backlight brightness/turning the
reticle illumination and key backlight ON/OFF
..... 185
Atmospheric correction factor 188
Automatic tilt angle compensation mechanism 183

B

Bluetooth connections 35
Bluetooth Device Address..... 38

C

Cold boot 48
Collimation correction 183
Coordinate search JOB 170
Cross Survey data review 165
Current JOB 170

D

Date and Time 201
Direction..... 164

E

EDM ALC 186
Eliminating parallax 55

H

Horizontal angle settings 75, 82, 90

I

Inch (Fraction of an inch) 199
Instrument height mark 12

K

Key backlight..... 185

L

Laser-pointer function..... 12
Laser-pointer off 186
Laser radiation warning indicator 12
Light 12

P

Peep sight 12
Power-saving automatic cut-off/Backlight Off
..... 185
Power-saving automatic cut-off
(Power on command) 185
Precautions when performing resection 95
Prism check 186
Prism constant correction 187
Problems Powering OFF 49

R

Resection calculation process 94
Resume function 47
Rules regarding the assigning of
point numbers to automatically
calculated pegs 154
Rules regarding the automatic
assigning of point numbers to arbitrary
points 155

S

Scale correction..... 170
Sea level correction 183
Slope area 125
Symbols and terms used in Route Surveying 130

T

Trigger key 12

V

V mode (vertical angle display method) . 184



This is the mark of the Japan Surveying
Instruments Manufacturers Association.

©2010 TOPCON CORPORATION
ALL RIGHTS RESERVED

TOPCON CORPORATION

75-1 Hasunuma-cho, Itabashi-ku, Tokyo 174-8580, Japan <http://www.topcon.co.jp>

Please see the attached address list or the following website for contact addresses.

GLOBAL GATEWAY <http://global.topcon.com/>
